

EASTON

BRADEN AIRPARK (N43) 3 N UTC-5(-4DT) N40°44.53' W75°14.58'NEW YORK
L-33A, 34H
IAP

397 B NOTAM FILE IPT

RWY 18-36: H1956X165 (ASPH-TURF) LIRL(NSTD) 0.5% up N**RWY 18:** Thld dsplcd 192'. Tree.**RWY 36:** Trees.**SERVICE:** S2 FUEL 100LL LGT Rwy 18-36 NSTD LIRL, lgts spaced at 400' intervals.**AIRPORT REMARKS:** Attended 1300-2130Z±. Rwy 18-36 1956 ft by 50 ft asph aligned in center of 165 ft turf strip. Acft may not be visible on all parts of fld. 24 hr self serve fuel avbl.**AIRPORT MANAGER:** 610-231-5270**COMMUNICATIONS:** CTAF/UNICOM 123.0

Ⓡ ALLENTOWN APP/DEP CON 119.65 (3000' and blo) 124.45 (abv 3000')

CLEARANCE DELIVERY PHONE: For CD ctc Allentown Apch at 800-728-6322.**RADIO AIDS TO NAVIGATION:** NOTAM FILE ABE.**ALLENTOWN (L) (L) VORTACW** 117.5 FJC Chan 122 N40°43.60'

W75°27.28' 094° 9.7 NM to fld. 681/10W.

TACAN AZIMUTH & DME unusable:

061°-299° byd 30 NM blo 4,000'

300°-060° byd 26 NM blo 4,500'

VOR unusable:

021°-189° byd 10 NM

190°-260° blo 9,000'

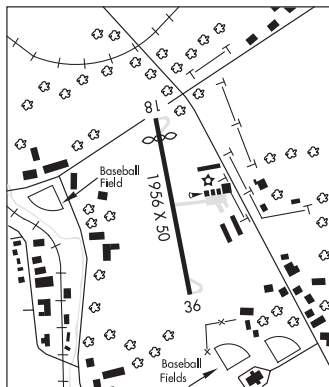
190°-260° byd 24 NM

261°-306° byd 9 NM blo 4,000'

307°-349°

350°-020° blo 3,500'

350°-020° byd 33 NM blo 4,000'

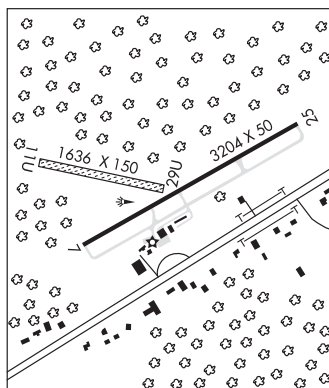
**EBENSBURG** (9G8) 3 SW UTC-5(-4DT) N40°27.68' W78°46.52'DETROIT
L-29D
IAP

2099 B NOTAM FILE AOO

RWY 07-25: H3204X50 (ASPH) S-12.5 MIRL 0.6% up NE**RWY 07:** Trees.**RWY 25:** Road.**RWY 11U-29U:** 1636X150 (TURF-DIRT) 1.9% up E**RWY 11U:** Tree.**RWY 29U:** Tree.**SERVICE:** FUEL 100LL LGT ACTIVATE MIRL Rwy 07-25 and twy lgts-CTAF.**AIRPORT REMARKS:** Attended irregularly. 24 hr self-serve fuel avbl. Deer on and in/ov arpt. Rwy 11U-29U for ultralight use only. Rwy 11U-29U rwy boundary marked with yellow cones. Barrels are rusting and grass covered. Rwy 07-25 BSC rwy markings.**AIRPORT MANAGER:** (814) 934-5717**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ JOHNSTOWN APP/DEP CON 121.2 (1200-0400Z±) or ctc 814-532-5960.

Ⓡ CLEVELAND CENTER APP/DEP CON 124.4 (0400-1200Z±) or ctc Cleveland ARTCC at 440-774-0234.

CLEARANCE DELIVERY PHONE: For CD ctc Johnstown Apch at 814-532-5960, when Apch clsd ctc Cleveland ARTCC at 440-774-0213.**RADIO AIDS TO NAVIGATION:** NOTAM FILE AOO.**REVLOC (L) DME** 114.75 REC Chan 94(Y) N40°32.79' W78°44.82' 194° 5.3 NM to fld. 2340.

EIGHTY FOUR

BANDEL (22D) 3 SE UTC-5(-4DT) N40°07.84' W80°05.77'

DETROIT

1210 NOTAM FILE AOO

RWY 01-19: 2260X100 (TURF-DIRT) 0.3% up N**RWY 01:** Hill.**RWY 19:** Trees.**AIRPORT REMARKS:** Attended irregularly. PAEW adj Rwy 01-19 indefly. 250 ft high terrain 3450 ft north of Rwy 19. Rwy 01-19 marked with flush white bucket lids boundary markers. Rwy 01 150 ft dthr mkd with flush orange bucket lids. Rwy 19 1330 ft dthr mkd with flush orange bucket lids. Rwy not maintained durg winter months.**AIRPORT MANAGER:** 412-877-4584**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Pittsburgh Apch at 412-472-5591.