

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE EKN.

GRANTSVILLE (L) DME 112.3 GRV Chan 70 N39°38.10' W79°03.03' 095° 13.5 NM to fld. 2640.

DME unusable:

071°-306° byd 20 NM blo 6,000'

108°-113° byd 38 NM

307°-070° byd 20 NM blo 5,000'

325°-345° byd 35 NM

LOC/DME 110.5 I-CBE Chan 42 Rwy 23. DME unusable byd 22° left of course. DME unusable byd 10 NM blw 3,500'.

MEXICO FARMS (1W3) 3 S UTC-5(-4DT) N39°36.36' W78°45.63'

WASHINGTON

607 TPA—1407(800) NOTAM FILE EKN

RWY 09-27: 2120X75 (TURF)

RWY 09: Rgt tfc.

RWY 27: Thld dsplcd 326'. Trees.

AIRPORT REMARKS: Unattended. Ultralight act and wildlife on and invof arpt. Rising trm 4500 ft W of arpt. Rwy 27 dsplcd thr mkd with cones on both sides. Rwy 09-27 may be soft.

AIRPORT MANAGER: 301-724-5231

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Johnstown Apch at 814-532-5960, when Apch clsd ctc Cleveland ARTCC at 440-774-0213.

COMM/NAV/WEATHER REMARKS: UNICOM 122.8 shared with Cumberland Muni 0.5 mi due N.

DAVIS (See LAYTONSVILLE on page 108)

EASTON/NEWMAM FLD (ESN)(KESN) 2 N UTC-5(-4DT) N38°48.25' W76°04.14'

WASHINGTON

72 B TPA—See Remarks NOTAM FILE ESN

H-101, 121, L-34F, 361, A

RWY 04-22: H5500X100 (ASPH-GRVD) S-40, D-60, 2D-100 HIRL

IAP, AD

0.7% up NE

RWY 04: PAPI(P4L)—GA 3.0° TCH 43'.

RWY 22: REIL. PAPI(P4L)—GA 3.0° TCH 45'. Thld dsplcd 325'. Rgt tfc.

RWY 15-33: H4003X100 (ASPH) S-40, D-60, 2D-100 MIRL

0.5% up SE

RWY 15: REIL. PAPI(P2L)—GA 3.5° TCH 45'. Trees.

RWY 33: REIL. PAPI(P2L)—GA 3.5° TCH 45'. Trees. Rgt tfc.

RUNWAY DECLARED DISTANCE INFORMATION


RWY 04: TORA-5175 TODA-5500 ASDA-4775 LDA-4775

RWY 22: TORA-5500 TODA-5500 ASDA-5500 LDA-5175

SERVICE: S4 FUEL 100LL, JET A OX4 LGT When twr clsd actvt REILS

Rwy 15, 22, & 33; HIRL Rwy 04-22; MIRL 15-33—CTAF.

NOISE: Noise abatement for Rwy 22: continue straight out or make a right turn to avoid overflight of the town of Easton. Departures should avoid overflight of the town of Easton below 2000'. Aircraft should avoid overflight of the Town of Easton and residential areas near the airport to the extent possible. Noise abatement for Runway 04: if traffic permits, make a slight left turn after departure to avoid overflying retirement community.

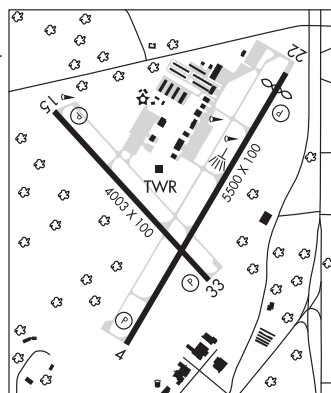

AIRPORT REMARKS: Attended 1300-dusk. Deer, birds and other wildlife on and invof arpt. TPA for jet acct 1598(1526), all other acct 1098(1026). Rwy 15-33 distance markers every 1000 ft west side rwy. NOTE: See Special Notices—Easton, Maryland Noise Abatement Procedure.

AIRPORT MANAGER: 410-770-8055

WEATHER DATA SOURCES: AWOS-3PT 124.475 (410) 822-2817.

COMMUNICATIONS: CTAF 118.525 ATIS 124.475

Ⓡ POTOMAC APP/DEP CON 124.55 133.75

TOWER 118.525 (1100-0300Z±) GND CON 119.075 CLNC DEL 119.075

CLEARANCE DELIVERY PHONE: For CD when ATCT is clsd ctc Potomac Apch at 866-429-5882.

AIRSPACE: CLASS D svc 1100-0300Z±; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE MIV.

WATERLOO (L) VOR/DME 112.6 ATR Chan 73 N38°48.59' W75°12.68' 279° 40.2 NM to fld. 5/9W.

DME unusable:

179°-293° byd 30 NM blo 2,000'

VOR unusable:

345°-010°

ILS/DME 109.35 I-FGH Chan 30(Y) Rwy 04. Class IA. Unmonitored when ATCT clsd. Glideslope unusable blw 600'. Autopilot cpd apch NA blw 1,230'.