TEXAS 295

**DECATUR MUNI** (LUD)(KLUD) 2 N UTC-6(-5DT) N33°15.26′ W97°34.83′

1047 B NOTAM FILE LUD

RWY 17-35: H4200X60 (ASPH) S-12.5, D-17 MIRL

RWY 17: REIL. PAPI(P2L)—GA 3.5° TCH 23'. Tree.

RWY 35: PAPI(P2L)-GA 3.5° TCH 40'. P-line. Rgt tfc.

SERVICE: S4 FUEL 100LL, JET A LGT Dusk-Dawn. MIRL Rwy 17-35 preset low intst: to incr intst actvt—CTAF.

AIRPORT REMARKS: Attended 1400–2300Z‡. Deer and wildlife on and invof arpt. Gnd drops sharply 160 north of Rwy 17 thr. Rwy 17–35 extensive pavement cracking. Due to rwy elev chg, acft not vsb at opposite end.

AIRPORT MANAGER: 940-627-2855


WEATHER DATA SOURCES: AWOS-3 118.225 (940) 627-2365.

COMMUNICATIONS: CTAF/UNICOM 122.8

RLONE STAR APP/DEP CON 118.1

CLEARANCE DELIVERY PHONE: For CD ctc Regional Apch at 972-615-2799. RADIO AIDS TO NAVIGATION: NOTAM FILE FTW.

**BOWIE (H) (H) VORTACW** 117.15 UKW Chan 118(Y) N33°32.15′ W97°49.28′ 138° 20.8 NM to fld. 1102/6E.

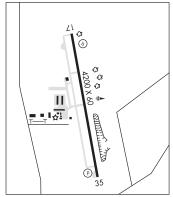

**HERITAGE CREEK AIRSTRIP** (58T) 9 SE UTC-6(-5DT) N33°09.96′ W97°28.79′

DALLAS-FT WORTH COPTER

DALLAS-FT WORTH

COPTER

L-17C, A

IAP

883 NOTAM FILE FTW

**RWY 13–31**: 3000X60 (TURF) LIRL 0.8% up NW

RWY 13: Tree.

RWY 31: Tree. Rgt tfc.

SERVICE: S4 LGT ACTVT LIRL Rwy 13–31 —CTAF. Rwy defined by white "L" markers on each corner—nights: two lights each side of cntrln mark rwy ends.

AIRPORT REMARKS: Unattended. Deer and birds on and invof arpt. RCO ctl model acft ops on arpt. All acft monitor CTAF due to the close proximity of Rhome Meadows arpt T76. Rwy 31 right tfc for fixed wing acft; remain east of the rwy.

AIRPORT MANAGER: 817-988-9745 COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Regional Apch at 972-615-2799.

**LAZY G BAR RANCH** (Ø9T) 5 NE UTC-6(-5DT) N33°16.88′ W97°29.80′

DALLAS-FT WORTH

931 NOTAM FILE FTW

RWY 17-35: 1600X40 (TURF-DIRT)

RWY 17: Brush. Rgt tfc.

AIRPORT REMARKS: Unattended. Livestock on and invof arpt. For fld condition call arpt manager. Call ahead to confirm rwy is clear of livestock. Rough, rolling gradient. Full rwy not visible from ends. Center 20′ mowed.

AIRPORT MANAGER: (719) 221-7993

 ${\color{red}\textbf{COMMUNICATIONS: CTAF}\ 122.9}$ 

 $\label{eq:clearance} \textbf{CLEARANCE DELIVERY PHONE:} \ \text{For CD ctc Regional Apch at } 972\text{-}615\text{-}2799.$ 

TRIPLE-ACE FLD (35X) 2 NE UTC-6(-5DT) N33°15.11′ W97°33.21′ DALLAS-FT WORTH

1010 NOTAM FILE 35X

RWY 02-20: 1271X40 (TURF)

RWY 02: Road. Rgt tfc.

RWY 20: Fence.

AIRPORT REMARKS: Unattended. Wildlife on and invof arpt. Acft oprg into or out of arpt will use Decatur Arpt freq 122.8 to communicate with Decatur Arpt ffc. Rwy soft aft rain. Call for ficons.

AIRPORT MANAGER: 940-627-6800 COMMUNICATIONS: CTAF 122.8