

HOLLOMAN AFB (HMN)(KHMN) AF (A) 6 SW UTC-7(-6DT) N32°51.11' W106°06.51'

ALBUQUERQUE

4093 B TPA—See Remarks NOTAM FILE HMN Not insp.

H-4L, L-6F

RWY 07-25: H12922X150 (PEM) PCN 34 R/C/W/T HIRL

DIAP, AD

RWY 25: PAPI(P4L)—GA 2.5° TCH 43'.

RWY 16-34: H12134X150 (PEM) PCN 45 R/B/W/T HIRL

RWY 16: ALSF1. PAPI(P4L)—GA 3.0° TCH 50'.

RWY 34: PAPI(P4L)—GA 2.5° TCH 43'.

RWY 04-22: H10578X300 (PEM) PCN 52 R/B/W/T HIRL

RWY 04: 0.3% up.

RWY 22: ALSF1. PAPI(P4L)—GA 3.0° TCH 53'.

ARRESTING GEAR/SYSTEM

RWY 07 BAK-15 CHAG (2276 FT OVRN) HOOK BAK-12(B) (1500 FT). HOOK BAK-12(B) (1630 FT). **RWY 25**

RWY 16 HOOK BAK-12(B) (63 FT OVRN) HOOK BAK-12(B) (1500 FT).

HOOK BAK-12(B) (1507 FT) HOOK BAK-12(B) (59 FT OVRN) BAK-15 (NI) UNK (121 FT OVRN). **RWY 34**

RWY 04 HOOK BAK-12(B) (1450 FT) HOOK BAK-12(B) (5287 FT). HOOK BAK-12(B) (1498 FT). **RWY 22**

SERVICE: S4 OX 1, 2 LGT Gated thld lgt all rwy. Rwy 16-34 dist rem mrk OTS. PAPI Rwy 22 and Rwy 34 unusbl byd 8°

left of centerline. Bcn lgt ABN unserviceable. **MILITARY—A-GEAR** Rwy 04-22 BAK-12(B) (mid fld) and Rwy 25 apch

BAK-12(B) 30 min PN. BAK-15 lctd Rwy 16 under-run unsvc. Nets avbl to be raised at pilot request. Rwy 34 HOOK

BAK-12 B (60' ovrn) unit is not Bi-directional. When winds greater than 35 kts and temperatures greater than 85° F,

BAK-15 nets in up position during T-38 ops. Nets avbl to be raised as req. Caution: Rwy 25 apch BAK-12 increased

strike haz to F-16 configured with external cntrln stores/tanks. **JASU 2(MD-3) 2(MA-1A) 3(MC-1) 1(MC-1A)**

1(M32A-60) FUEL A++ FLUID SP LHOX LOX OIL O-128-133-148-156 SOAP TRAN ALERT Tran Alert svc avbl

1230-0330Z† Mon-Fri, 1430-2230Z† Sat-Sun. No priority basis.

MILITARY REMARKS: Opr hrs by NOTAM. See FLIP AP/1 Supplementary Arpt Remarks. **RSTD** PPR must be req 72 hr prior but

no earlier than 7 days prior to arr. Ctc Afld Mgmt DSN 572-5411/5412, C575-572-5411/5412. PPR valid +/- 30 min

prior/after ETA. Early/late arr/dep must be re-coord with Afld Mgmt. Rwy 16-34 rstd to acct with wingspan 175' or less.

Heavy acct should exp to land Rwy 22. 180° turns on rwy asph sfc not permitted without afld manager approval. Heavy

acct prohibited from dep or arr Rwy 07-25. ILS/Radar, Rwy 16 ILS avbl for circle apch to Rwy 22. Live load ops conducted

on Twy E live load pad. Ctc AM ops DSN 572-5411, C575-572-5411 to sked. All acct rqrg cargo and/or pax svc rqrd to

ctc 49 LRS at DSN 572-0905, C575-572-0905. No eng running on/off loads without prior coord with 49 LRS. **CAUTION**

Use extreme caution, UAS acct conducting std ops in Holloman airspace. Mountainous terrain 10 NM east and 20 NM

west. Bird hazard: Wetlands and lake located less than 1 nm S of Rwy 34 apch end. Non-frangible sign lctd on Twy F/Twy

E int less than 100 ft fr Twy F cntrln on S side. BASH phase II in eff: 1 Mar-31 May and 1 Aug-31 Oct. Unctd vehicles

on movement area. Unctd afld ops (UAO) in effect dur outside published afld hrs. UAO only authorized for flying units listed

in HAFB1 11-250. Ctc Comd Post DSN 572-7575, (575) 572-7575 for current UAO status. Portions of arpt not visible

from twr. Exit Rwy 22 on Twy R hold short Twy G. Helicopter arr/dep avoid hover over unprepared sfc. Pavement markings

throughout afld faded and non reflective. Rwy 34 and Rwy 04 at 2000' distance remaining marker, only 1700' of rwy

avbl. Afld has hi potential for FOD from engine blast, minimize thrust during ground opr. **TFC PAT** TPA—Overhead

6100(2007)/300 kts. **MISC** Only single apch and full stop lgt authorized for tran acct. VFR hold lines lctd at int Rwy 16-34

(4 each). Acft given clnc to land or tkf shall disregard hold lines at the int dur ldg and tkf roll. Land and hold short ops not

auth. Tran acct last priority on refueling due to refueling mechanical problems, exp delays. Aerodrome wx svl avbl Mon-Sat

0600-0100Z†, Sat 1400-2100Z†, clsd Sun, hol or when afld is NOTAM clsd. Auto obsn avbl during non-opr hours.

Units wishing to forward deploy to Holloman AFB etc 49 WG/XP DSN 572-7483 for WG aplv. Wx obsn site ltd

220°-350° due to bldg, ngt obsn ltd due to high ints lghts. Svc unavbl when afld NOTAM clsd. Wx DSN 572-3924/5

C575-572-3924/5. For standby svc during non opr hr ctc 25 OWS DSN 228-6674. Std AETC RSRs applied, non-AETC

assigned acct rqrd written apvl. Radar monitoring not avbl all rwy. First 1850' Rwy 34, first 1700' Rwy 16 conc, mid

8581' asph. Rwy 04-22 has 1000' X 300' conc thld, remaining rwy 8575' X 300' asph. Rwy 04-22 marked 10,575'

X 150'. First 1000' Rwy 25 conc, west of Twy F middle 75' conc outer 37.5' weight bearing asph. Twy G width 150'

weight bearing. Twy Golf edge lghts located 150 ft south of Twy G pavement edge invof clsd end of Rwy (EOR) Gulf. A Opr

Mon-Sat 1000-0100Z†.

AIRPORT MANAGER: 575-572-5411

COMMUNICATIONS: SFA ATIS 273.5 (Ltd byd 15 NM 020°-140°) (Opr 24 hrs Mon 0900Z† thru Fri 0100Z†, Sat 1500-2200Z†.)

PTD 372.2

Ⓐ **APP CON** 120.6 269.225 (Ltd 020°-140° byd 15 NM) (Mon 0900Z† thru Fri 0100Z†, Sat 1500-2200Z† exc for final Sat of every month. Clsd Sun and federal hol)

TOWER 119.3 254.4 (Ltd 020°-140° byd 15 NM) (Opr H24 Mon 0900Z† thru Fri 0100Z†, Sat 1500-2200Z†.)

GND CON 127.05 275.8 **CLNC DEL** 126.7 289.4

Ⓐ **DEP CON** 128.1 284.0 (Ltd 020°-140° byd 15 NM) (Mon 0900Z† thru Fri 0100Z†. Clsd Sat, Sun and hol)

ALBUQUERQUE CENTER APP/DEP CON 132.65 257.6 (When Holloman apch control clsd) 24 hrs Sat, Sun and hol

COMD POST (RAYMOND 14) 251.25 (Have Quick timing avbl. Ltd 020°-140° byd 15 NM) **PMSV METRO** 346.55 (Ltd

020°-140° byd 15 NM) **CARMY AVIATION** 229.3 (Ltd 020°-140° byd 15 NM)

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS D.

RADIO AIDS TO NAVIGATION: NOTAM FILE HMN.

(L) **TACAN** Chan 92 HMN (114.5) N32°51.73' W106°06.55' at fld. 4075/10E.

TAC unmnt when rapcon clsd

No NOTAM MP: 1200-1400Z‡ Tue

TAC AZM unusable:

030°-069° byd 26 NM blo 18,000'

070°-095° byd 25 NM blo 15,000'

070°-095° byd 32 NM

096°-130° byd 25 NM blo 18,000'

160°-170° byd 38 NM blo 8,000'

DME unusable:

030°-069° byd 26 NM blo 18,000'

070°-095° byd 25 NM blo 15,000'

070°-095° byd 32 NM

096°-130° byd 25 NM blo 18,000'

160°-170° byd 38 NM blo 8,000'

ILS 108.9 I-MUK Rwy 16. Class IT. Unmonitored outside publ opr hr. No NOTAM MP: glideslope 1200-1400Z‡ Thu; ILS 1200-1400Z‡ Fri. Glideslope unavbl.

ILS 111.7 I-HMN Rwy 22. Class IE. Unmonitored outside publ opr hr. No NOTAM MP: ILS 1200-1400Z‡ Mon; glideslope 1200-1400Z‡ Wed. Glideslope unavbl.

COMM/NAV/WEATHER REMARKS: Rwy 16 TCH 41' Group 4 (B-747/767/777, L-1011, DC-10, A-300, B-1, KC-10, E-4, C-5 and VC-25 wheel crossing height 16' all Rwy ILS procedures.

JAL

LEA CO/JAL (E26) 3 NE UTC-7(-6DT) N32°07.86' W103°09.29'
3118 B NOTAM FILE ABQ

ALBUQUERQUE

L-6G

AD

RWY 01-19: H4704X60 (ASPH) S-23 PCN 4 F/C/Y/T MIRL**RWY 01:** PAPI(P2L)—GA 3.03° TCH 40'. Brush.**RWY 19:** PAPI(P2L)—GA 2.83° TCH 46'. Brush.**RWY 09-27:** H2604X50 (ASPH) S-12 PCN 3 F/B/Y/T 0.8% up W**RWY 09:** Thld dspcd 40'. Brush.**RWY 27:** Thld dspcd 45'.**SERVICE:** LGT Actvt PAPI Rwy 01 and 19; MIRL Rwy

01-19—CTAF. MIRL Rwy 01-19 preset low instnt—to incrintst—CTAF.

AIRPORT REMARKS: Unattended. For airframe/powerplant svc call

505-396-6719. Oil well drilling activity on and invof arpt. Rwy 01

+3' posts 145 ft from the thld, on centerline and 40 ft left and 110

ft right of centerline. Rwy 19 +20' pump jack 990' fm Rwy 19 thld

185' left of centerline. Rwy 09-27 +3-5' brush 75-125' from

centerline east side. Line of sight between rwys not avbl.

AIRPORT MANAGER: 575-391-2934**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Fort Worth ARTCC at

817-858-7584.

RADIO AIDS TO NAVIGATION: NOTAM FILE INK.**WINK (VH) (H) VORTACW** 112.1 INK Chan 58 N31°52.49'

W103°14.63' 005° 16.0 NM to fld. 2860/11E.

VOR unusable:

256°-267° byd 40 NM blo 10,000'

256°-267° byd 58 NM blo 18,000'

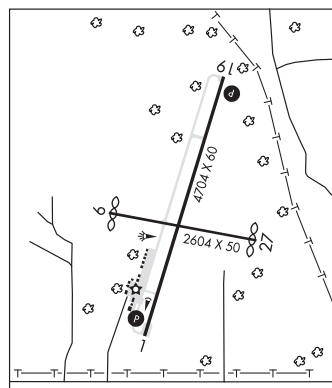
268°-280° byd 40 NM

281°-291° byd 40 NM blo 24,000'

292°-305° byd 40 NM

306°-320° byd 111 NM

306°-320° byd 40 NM blo 15,000'

**JEWETT MESA** (See APACHE CREEK on page 421)**JICARILLA APACHE NATION** (See DULCE on page 433)