

**HAGERSTOWN RGNL/RICHARD A HENSON FLD** (HGR)(KHGR) P (AR) 4 N UTC-5(-4DT)

WASHINGTON

N39°42.51' W77°43.59'

H-10H, 12I, L-29D, A

703 B ARFF Index—See Remarks NOTAM FILE HGR

IAP, AD

**RWY 09-27:** H7000X150 (ASPH-GRVD) S-100, D-150, 2S-175,

2D-250 PCR 750 F/A/X/T HIRL 0.3% up E

**RWY 09:** REIL. PAPI(P4L)—GA 3.0° TCH 55'.**RWY 27:** MALSR. PAPI(P4L)—GA 3.0° TCH 55'.**RWY 02-20:** H3165X100 (ASPH) S-80, D-100, 2S-127, 2D-170

PCR 600 F/A/X/T MIRL 0.3% up N

**RWY 02:** REIL. PAPI(P2L)—GA 4.0° TCH 53'.**RWY 20:** REIL. PAPI(P2L)—GA 4.0° TCH 33'.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 02:** TORA-3165 TODA-3165 ASDA-3165 LDA-3165**RWY 09:** TORA-7000 TODA-7000 ASDA-7000 LDA-7000**RWY 20:** TORA-3165 TODA-3165 ASDA-3165 LDA-3165**RWY 27:** TORA-7000 TODA-7000 ASDA-7000 LDA-7000**SERVICE:** S4 FUEL 100LL, JET A OX 1, 2, 3, 4 LGT When ATCT clsd

ACTVT MALSR Rwy 27; REIL Rwy 09; HIRL Rwy

09-27—CTAF. **MILITARY—FUEL A, A+** (Avbl 1000-0300Z†,

C301-791-9119, OT 3 hr PN C301-730-4700/301-730-4100,

fee \$100/hr.) (NC-100LL) OIL O-128

**AIRPORT REMARKS:** Attended 1000-0300Z†. Airport unatnd

0300-1000Z†. Birds on and invof arpt. Ultralight act 12 NM east to 5000' MSL. Low level mil acft 10 NM north on VR708 operating east to west. Fuel avbl 1000-0300Z†, call 301-791-9119. DOD contract fuel avbl. Rwy 02-20 CLOSED when ATCT clsd. Class I, ARFF Index B. ARFF Index C avbl upon req; ctc amgr. PPR 24 hrs for unskd acr opns with more than 30 psgr seats call amgr 240-313-2764. Rwy 02-20 clsd to sked acr opns with more than 9 pax seats and non sked acr opns with more than 30 pax seats excp for taxi. Twy P not avbl for air carrier ops. Ldg fee.

**AIRPORT MANAGER:** 240-313-2764**WEATHER DATA SOURCES:** ASOS 126.375 (301) 745-3497.**COMMUNICATIONS:** CTAF 120.3 UNICOM 122.95Ⓡ **POTOMAC APP/DEP CON** 126.825

TOWER 120.3 (1200-0300Z†) GND CON 120.8

**CLEARANCE DELIVERY PHONE:** For CD when ATCT is clsd ctc Potomac Apch at 866-709-4993.**AIRSPACE:** CLASS D svc 1200-0300Z†; other times CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE HGR.

(L) VORW 109.8 HGR N39°41.86' W77°51.34' 091° 6.0 NM to fld. 563/7W.

VOR unusable:

251°-280° byd 16 NM blo 4,000'

281°-300° byd 24 NM blo 8,000'

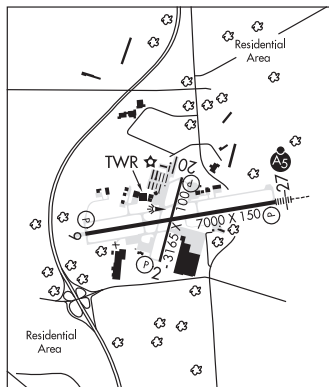
351°-050°

**ST THOMAS (L) TACAN** Chan 97 THS (115.0) N39°55.99' W77°57.06' 149° 17.0 NM to fld.

2338/7W. NOTAM FILE AOO.

ILS/DME 111.9 I-UYK Chan 56 Rwy 09. ILS unavbl when ATCT clsd.

ILS/DME 111.9 I-HGR Chan 56 Rwy 27. Class IE. OM/LOM OTS indef.

**HARFORD CO** (See CHURCHVILLE on page 95)**HAVRE DE GRACE SPB** (M06) 1 E UTC-5(-4DT) N39°32.49' W76°04.18'

WASHINGTON

00 NOTAM FILE DCA

**WATERWAY E-W:** 8000X200 (WATER)**WATERWAY E:** Bridge.**WATERWAY N-S:** 8000X200 (WATER)**WATERWAY S:** Bridge.**SEAPLANE REMARKS:** Attended May-Nov dawn-dusk. Birds on and invof arpt. +100 ft bridge aprxly 3500 ft north of N/S rwy.**AIRPORT MANAGER:** (410) 258-9648**COMMUNICATIONS:** CTAF/UNICOM 123.0**CLEARANCE DELIVERY PHONE:** For CD ctc Washington ARTCC at 703-771-3587.