

**ROUND LAKE** (W57) 2 E UTC-5(-4DT) N42°55.87' W73°46.25'

NEW YORK

178 NOTAM FILE BTV

**RWY 14-32:** 1927X76 (TURF) 1.0% up SE

**RWY 14:** Tree.

**RWY 32:** Trees.

**AIRPORT REMARKS:** Attended on call. Deer on and invof arpt. Arpt clsd to itinerant acft Nov-May. Rwy 14-32 has 80' trees rgt and left of centerline in primary sfc. Rwy 14-32 soft during spring (Mar-Jun). Military helicopters and ultralight acft use rwy. Access to arpt from lake overgrown. Ctc arpt mgr prior to seaplane arrival.

**AIRPORT MANAGER:** 518-899-6316

**COMMUNICATIONS:** CTAF/UNICOM 122.8

**CLEARANCE DELIVERY PHONE:** For CD ctc Albany Apch at 518-862-2299.

• • • • •  
**WATERWAY 14W-32W:** 4000X600 (WATER)

**ROYALTON** (See GASPORT on page 208)

**SANDS POINT SPB** (See PORT WASHINGTON on page 240)

## SARANAC LAKE

**ADIRONDACK RGNL** (SLK)(KSLK) 4 NW UTC-5(-4DT) N44°23.12' W74°12.37'

MONTREAL  
 H-11C, 12K, L-32G  
 IAP, AD

1663 B LRA ARFF Index—See Remarks NOTAM FILE SLK

**RWY 05-23:** H6573X150 (ASPH-GRVD) S-40, D-73, 2S-92, 2D-115

PCR 363 F/B/X/T HIRL 0.3% up NE

**RWY 05:** PAPI(P4L)—GA 3.0° TCH 35'. Trees.

**RWY 23:** MALSR. Trees.

**RWY 09-27:** H3997X100 (ASPH) S-40, D-73, 2S-92, 2D-115

PCR 349 F/A/X/T MIRL

**RWY 09:** Trees.

**RWY 27:** Thld dsplcd 400'. Trees.

### RUNWAY DECLARED DISTANCE INFORMATION

**RWY 05:** TORA-6573 TODA-6573 ASDA-6573 LDA-6573

**RWY 09:** TORA-3997 TODA-3997 ASDA-3997 LDA-3997

**RWY 23:** TORA-6573 TODA-6573 ASDA-6333 LDA-6333

**RWY 27:** TORA-3997 TODA-3997 ASDA-3997 LDA-3597

**SERVICE:** S4 FUEL 100LL, JET A LGT ACTVT MALSR Rwy 23, PAPI

Rwy 05, HIRL Rwy 05-23, MIRL Rwy 09-27 and twy lgts—CTAF.

**AIRPORT REMARKS:** Attended May-Oct 1100-0200Z†. Nov-Apr

1100-0100Z†. For arpt attendant after hrs call 518-637-7329.

Rwy/twy/apron conds not mnt outside of nml atnd hrs. All sfcfs work

in prog; grass cutting Apr thru Oct. Class IV, ARFF Index A. PPR 48 hr

for unscheduled acft ops with more than 30 passenger seats call arpt

manager 518-891-4600 ext 106. Index B coverage is avbl. Twy B unavbl to acft with wingspan 79' and abv. Abv ground

twy edge lgts adjacent to Twy B tie down apron area. Rwy 09 nstd markings, thld markings 400' from rwy end. Cold

temperature airport. Altitude correction required at or below -29C. Ldg fee.

**AIRPORT MANAGER:** 518-891-4600

**WEATHER DATA SOURCES:** ASOS 124.175 (518) 891-6696.

**COMMUNICATIONS:** CTAF/UNICOM 123.0

® **BOSTON CENTER APP/DEP CON** 120.35

**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on freq, ctc Boston ARTCC at 603-879-6859.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE SLK.

**SARANAC LAKE (L) DME** 109.2 SLK Chan 29 N44°23.07' W74°12.27' at fld. 1647.

DME unusable:


089°-104° byd 25 NM blo 10,000'

105°-110° byd 25 NM

111°-165° byd 25 NM blo 10,000'

300°-350° byd 36 NM blo 10,000'

ILS 108.9 I-SLK Rwy 23. Class IA. Unmonitored.

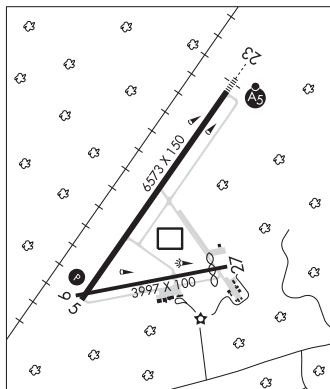

**SARATOGA CO** (See SARATOGA SPRINGS on page 245)