

HILL CITY MUNI (HLC)(KHLK) 1 NE UTC-6(-5DT) N39°22.81' W99°49.89'

WICHITA
H-5B, L-10H
IAP

2238 B TPA—3038(800) NOTAM FILE HLC
RWY 18-36: H5001X75 (CONC) S-12.5, D-16 PCN 8 R/C/X/U

HIRL 1.0% up N
RWY 18: REIL. PAPI(P4L)—GA 3.0° TCH 46'.
RWY 36: REIL. PAPI(P4L)—GA 3.0° TCH 33'. Road.
SERVICE: FUEL 100LL, JET A+ LGT ACTVT REIL Rwy 18 and Rwy 36;
PAPI Rwy 18 and Rwy 36; HIRL Rwy 18-36—CTAF.
AIRPORT REMARKS: Attended on call. 24 hr attendant 785-421-5613. Self
svc fuel. Agricultural acct opr vicinity of arpt dalgt hrs.


AIRPORT MANAGER: 785-769-3400
WEATHER DATA SOURCES: ASOS 118.425 (785) 421-3471.

COMMUNICATIONS: CTAF 122.9
RCO 122.3 (WICHITA RADIO)
DENVER CENTER APP/DEP CON 132.7

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Denver
ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE HLC.
(VH) (H) VORTACW 113.7 HLC Chan 84 N39°15.52'
W100°13.55' 060° 19.8 NM to fld. 2690/8E.

VOR unusable:
271°-274° byd 40 NM
279°-289° byd 40 NM blo 4,800'
279°-289° byd 47 NM

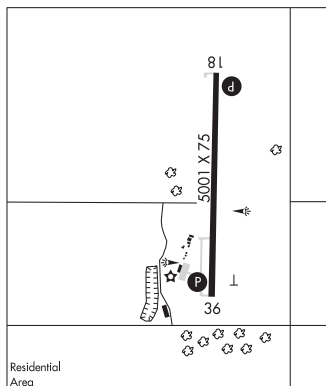

HILLSBORO

ALFRED SCHROEDER FLD (M66) 0 SW UTC-6(-5DT) N38°20.49' W97°12.83'

WICHITA
L-10I

1434 B NOTAM FILE ICT
RWY 17-35: H3229X44 (ASPH) LIRL 0.6% up N

RWY 17: PAPI(P4L)—GA 3.75° TCH 39'. Road.
RWY 35: PAPI(P4L)—GA 3.75° TCH 39'. Trees.
SERVICE: FUEL 100LL LGT ACTIVATE LIRL Rwy 17-35, PAPI Rwy 17
and Rwy 35—CTAF.


AIRPORT REMARKS: Unattended. Self svc 100LL fuel avbl 24 hrs with credit
card. Ultralight activity invof arpt. Rwy 17-35 turnaround and runup
area on apch to Rwy 35 extended approximately 23'.

AIRPORT MANAGER: 620-947-3162
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Wichita Apch at 316-350-1520.
RADIO AIDS TO NAVIGATION: NOTAM FILE SLN.

SALINA (VH) (H) VORTACW 117.1 SLN Chan 118 N38°55.51'
W97°37.28' 144° 39.9 NM to fld. 1316/7E.

VOR unusable:
017°-026° byd 40 NM
315°-016° byd 15 NM blo 6,000'
DME unusable:
300°-042° byd 15 NM blo 6,000'

HELIPAD H1: H40X40 (CONC)
HELIPAD H1: Bldg.

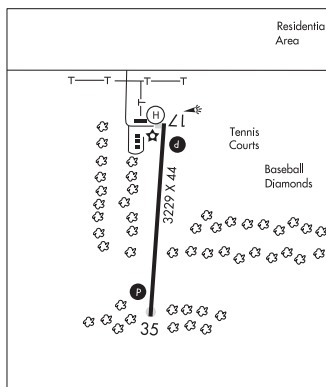

HILLSIDE (See STILWELL on page 137)