

JEROME CO (JER)(KJER) 3 E UTC-7(-6DT) N42°43.60' W114°27.40'

4053 B NOTAM FILE JER

RWY 09-27: H5002X75 (ASPH) S-20 MIRL 1.8% up E

RWY 09: PAPI(P4L)—GA 3.0° TCH 40'. Rgt tfc.

RWY 27: Fence.

SERVICE: S4 FUEL 100LL, JET A, A+ LGT ACTVT MIRL Rwy
09-27—CTAF.

AIRPORT REMARKS: Attended 1500-0000Z \ddagger . 18 cell twrs farm lctd 1.5
NM ENE of arpt at 2500' right of Rwy 27 apch; tallest twr is 700'
AGL. Reflectors on parallel twy.

AIRPORT MANAGER: 208-420-1158

WEATHER DATA SOURCES: ASOS 135.225 (208) 324-7076.

COMMUNICATIONS: CTAF/UNICOM 122.8

TWIN FALLS APP/DEP CON 126.7 (1300-0400Z \ddagger)

Ⓡ **SALT LAKE CENTER APP/DEP CON** 118.05 (0400-1300Z \ddagger)

CLEARANCE DELIVERY PHONE: For CD ctc Twin Falls Apch at 208-734-7160,
when Apch clsd ctc Salt Lake ARTCC at 801-320-2568.

RADIO AIDS TO NAVIGATION: NOTAM FILE TWF.

TWIN FALLS (VL) (H) VORTACW 113.1 TWF Chan 78 N42°28.79'
W114°29.37' 348° 14.9 NM to fld. 4149/18E.

VOR unusable:

000°-010° byd 40 NM blo 7,000'

000°-010° byd 50 NM

011°-015° byd 40 NM

040°-091° byd 40 NM

092°-102° byd 40 NM blo 16,500'

092°-102° byd 77 NM

103°-106° byd 40 NM

107°-117° byd 40 NM blo 14,000'

107°-117° byd 64 NM blo 22,000'

118°-171° byd 40 NM

120°-160° byd 35 NM blo 12,000'

172°-182° byd 40 NM blo 13,000'

172°-182° byd 55 NM

183°-185° byd 40 NM

186°-196° byd 40 NM blo 10,600'

186°-196° byd 57 NM


197°-230° byd 40 NM

TACAN AZIMUTH unusable:

120°-160° byd 35 NM blo 12,000'

DME unusable:

120°-160° byd 35 NM blo 12,000'

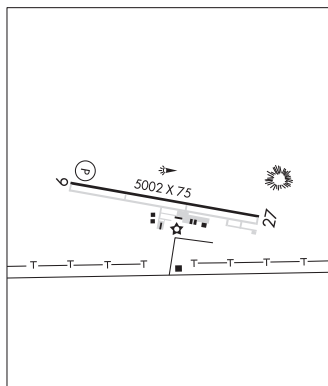

JOHNSON CREEK (See YELLOW PINE on page 90)

JOSLIN FLD/MAGIC VALLEY RGNL (See TWIN FALLS on page 88)

KAMIAH MUNI (S73) 1 SE UTC-8(-7DT) N46°13.19' W116°00.83'

GREAT FALLS

1206 NOTAM FILE BOI

RWY 14-32: 3000X90 (TURF) LIRL(NSTD) 0.3% up SE

RWY 14: Trees. Rgt tfc.

RWY 32: Trees.

SERVICE: FUEL 100LL LGT Rwy 14-32 NSTD LIRL bgn 500 ft fm each apch end-500 ft unlgtd dthr at both rwy ends.
ACTVT LIRL Rwy 14-32—CTAF.

AIRPORT REMARKS: Attended irregularly. Canadian geese on and invof arpt. Deer may be present on rwy at night. Numerous
obst on both rwy apchs; downdrafts prevalent over river on Rwy 32 apch. Not rmod tsnt pilots land aft dark wo first bcmg
fam with arpt due to hi trn 0.5 mi fm rwy. For rwy cond dur winter months call arpt mgr 208-935-0089.

AIRPORT MANAGER: 208-935-0089

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.