

APP CRS
061°

Rwy Idg
TDZE
998

10900
Apt Elev
1009

RNAV (RNP) Y RWY 6L


JAMES M COX DAYTON INTL (DAY)

GPS required. For uncompensated Baro-VNAV systems, procedure NA below -19°C (-2°F) or above 54°C (130°F). For inop ALS, increase RNP 0.10 all Cats visibility to RVR 6000. For inop ALS, increase RNP 0.30 all Cats visibility to 1 ½.

ALSIF-2

MISSED APPROACH: Climb to 3000 on the RNAV missed approach route to BONEE and hold.

ATIS 125.8	COLUMBUS APP CON 134.45 323.15	DAYTON TOWER 119.9 257.7	GND CON 121.9	CLNC DEL 121.75
----------------------	--	------------------------------------	-------------------------	---------------------------

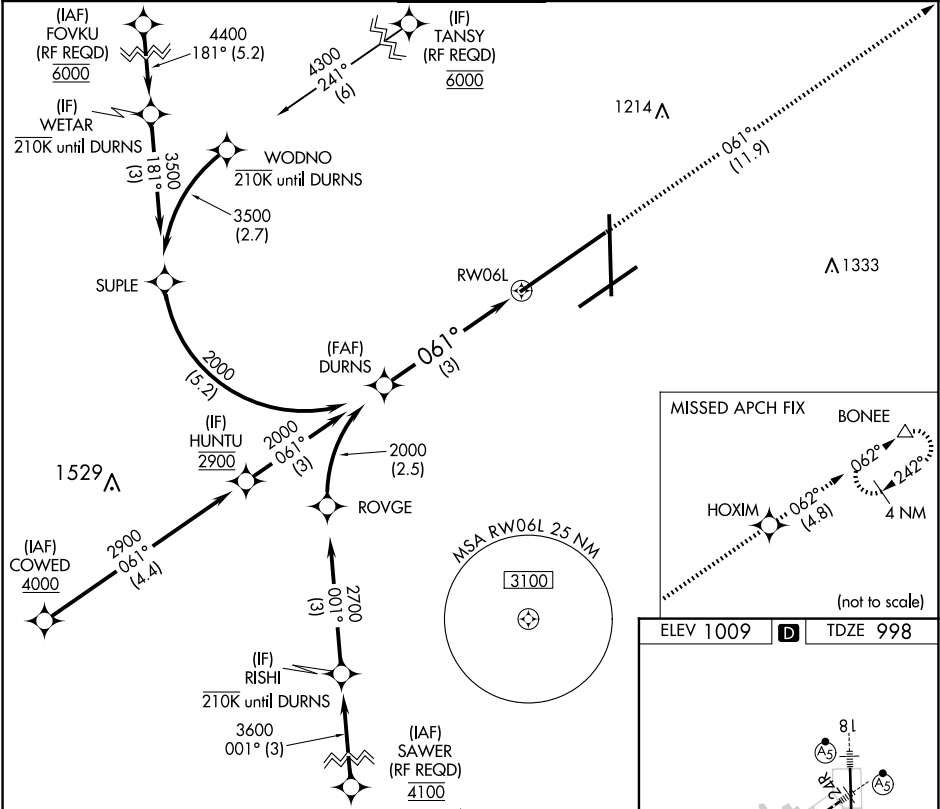

VGSI and RNAV glidepath not coincident DURNS (VGSI Angle 3.00/TCH 67).

2000
GP 3.00°
TCH 51

See planview for multiple IF locations.

3000
↑
tr 061°

HOXIM
tr 062°

BONEE
△

CATEGORY	A	B	C	D
RNP 0.10 DA		1358/40	360 (400-¾)	
RNP 0.30 DA		1464/60	466 (500-1½)	

AUTHORIZATION REQUIRED

ELEV 1009 **D** TDZE 998

TWR 1260

81

8592 X 150

785 X 150

36

061°

DAYTON, OHIO

Orig-B 24MAY18

39°54'N-84°13'W

JAMES M COX DAYTON INTL (DAY)

RNAV (RNP) Y RWY 6L