

BETHANY MEML (75K) 2 NE UTC-6(-5DT) N40°16.61' W94°00.45'

OMAHA

1035 NOTAM FILE COU

RWY 03-21: H2255X48 (ASPH) LIRL(NSTD) 0.4% up NE**RWY 03:** Trees. Rgt tfc.**RWY 21:** Thld dsplcd 143'. Bldg.**SERVICE:** LGT LIRL Rwy 03-21 three clicks to ACTIVATE—CTAF. Rwy 03-21 NSTD LIRL due to incorrect spacing and non-frangible mounts.**AIRPORT REMARKS:** Unattended. Rwy 03-21 has multiple open cracks, pavement raveling and producing foreign object damage. Rwy 03 nstd basic markings, rwy centerline incorrect spacing of stripes and gaps at designation marking. Markings faded. Rwy 21 nstd basic markings, rwy centerline incorrect spacing of stripes and gaps at designation markings and incorrect lateral spacing of designation numbers. Rwy 3-21 markings faded. Nstd rwy safety areas byd each rwy end, Rwy 03 incorrect terrain gradients, Rwy 21 large drop off, brush, small trees, fence and road.**AIRPORT MANAGER:** 660-425-3511**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Kansas City ARTCC at 913-254-8508.**BISMARCK MEML** (H57) 1 SE UTC-6(-5DT) N37°45.53' W90°37.01'

ST LOUIS

1038 B NOTAM FILE STL

RWY 17-35: H2050X50 (ASPH-AFSC) LIRL(NSTD)**RWY 17:** Trees.**RWY 35:** Tree. Rgt tfc.**SERVICE:** LGT Rwy 17-35 NSTD LIRL, 1 thld lgts 3-7' from rwy end on each side of rwy at each thld.**AIRPORT REMARKS:** Attended irregularly. Wildlife on and invof arpt.**AIRPORT MANAGER:** 415-377-7070**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Kansas City ARTCC at 913-254-8508.**BOLIVAR MUNI** (M17) 4 E UTC-6(-5DT) N37°35.77' W93°20.86'

KANSAS CITY

1092 B NOTAM FILE COU

RWY 18-36: H4000X75 (ASPH) S-12.5 MIRL**RWY 18:** PAPI(P2L)—GA 3.75° TCH 40'.**RWY 36:** PAPI(P2L)—GA 3.0° TCH 40'.**SERVICE:** S4 FUEL 100LL, JET A LGT Rwy 18-36 MIRL dusk-0530Z; after 0530Z; ACTIVATE—CTAF.**AIRPORT REMARKS:** Attended Mon-Sat 1400-2300Z. Fuel credit card 100LL and Jet A hrs 24 hrs avbl. Extensive student pilot training invof arpt. Wildlife and birds on and invof arpt.**AIRPORT MANAGER:** 417-777-6800**COMMUNICATIONS:** CTAF/UNICOM 123.0

② SPRINGFIELD APP/DEP CON 124.95

CLEARANCE DELIVERY PHONE: For CD ctc Springfield Apch at 417-868-5620/5619.**RADIO AIDS TO NAVIGATION:** NOTAM FILE SGF.**SPRINGFIELD (VH) (H) VORTACW** 116.9 SGF Chan 116

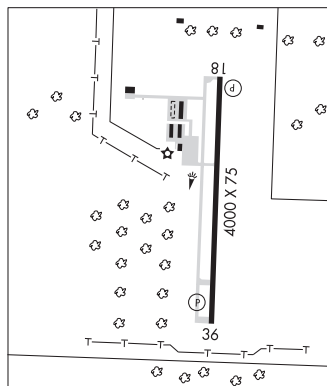
N37°21.36' W93°20.04' 353° 14.4 NM to fld. 1240/4E.

VOR unusable:

073°-085° byd 40 NM blo 18,000'

095°-120° byd 40 NM

121°-137° byd 40 NM blo 18,000'

L-16F
IAP**BOLLINGER-CRASS MEML** (See VAN BUREN on page 283)**BONNE TERRE MUNI** (1BT) 1 W UTC-6(-5DT) N37°55.14' W90°34.51'

ST LOUIS

910 B NOTAM FILE COU

RWY 14-32: H2800X49 (ASPH) MIRL 0.4% up SE**RWY 14:** Trees. Rgt tfc.**RWY 32:** Trees.**SERVICE:** LGT To incr intst and ACTVT MIRL Rwy 14-32—CTAF. Arpt ben opr SS-SR.**AIRPORT REMARKS:** Attended 1500-2300Z. NSTD rwy safety area Rwy 14-32 both ends insufficient length and obstructions. Large drop off Rwy 14 end. Hangar storage based on availability.**AIRPORT MANAGER:** 573-454-1266**COMMUNICATIONS:** CTAF/UNICOM 122.975**CLEARANCE DELIVERY PHONE:** For CD ctc Kansas City ARTCC at 913-254-8508.

L-16H