
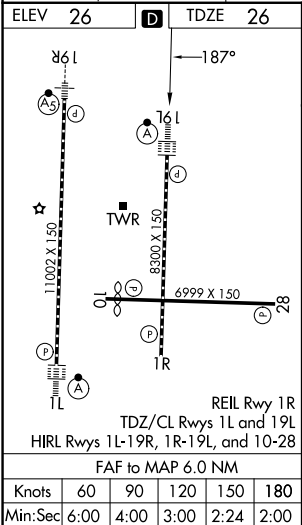


LOC/DME I-TPA 110.3 Chan 40	APP CRS 187°	Rwy Ldg TDZE 26 Apt Elev 26
---	------------------------	---

ILS or LOC RWY 19L
TAMPA INTL (TPA)

RADAR required for procedure entry.				ALSIF-2 		MISSED APPROACH: Climb to 600 then climbing left turn to 4000 on heading 160° and on PIE VORTAC R-138 to GIBBS INT and hold.	
 Simultaneous approach authorized. For inop ALS, increase S-ILS 19L Cat E visibility to RVR 4000 and S-LOC 19L Cat C, D, and E visibility to 1 3/8 SM.							
ARR 126.45	D-ATIS 128.475	DEP 118.5 307.175	TAMPA APP CON 119.5 269.4	TAMPA TOWER 119.5 269.4	GND CON 121.7 269.4	CLNC DEL 133.6	CPDLC

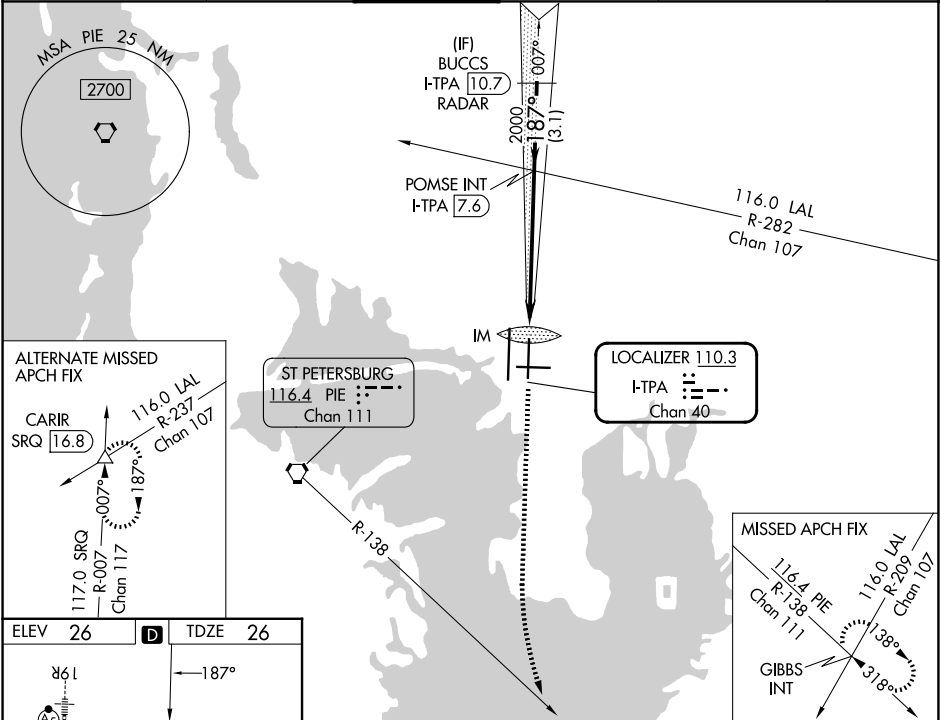

600 4000		PIE R-138	GIBBS INT	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 74).		BUCCS I-TPA 10.7 RADAR
hdg 160°				POMSE INT I-TPA 7.6		
				I-TPA 2.9		
				2000		
				187°		
				3000		
				GS 3.00° TCH 51		
				0.2 1.2 4.7 NM		
CATEGORY	A	B	C	D	E	
S-ILS 19L	226/18 200 (200-1/2)					
S-LOC 19L	520/24	494 (500-1/2)	520/50	494 (500-1)		
CIRCLING	600-1	574 (600-1)	680-1 3/4 654 (700-1 3/4)	980-3 954 (1000-3)	NA	

SE-3, 25 DEC 2025 to 22 JAN 2026

SE-3, 25 DEC 2025 to 22 JAN 2026