

**FRANKLIN RGNL** (FKN)(KFKN) 2 NE UTC-5(-4DT) N36°42.02' W76°54.13'

40 B TPA—See Remarks NOTAM FILE FKN

**RWY 09-27:** H4977X100 (ASPH-GRVD) MIRL

**RWY 09:** PAPI(P2L)—GA 3.0° TCH 40'. Tree.

**RWY 27:** PAPI(P2L)—GA 3.0° TCH 40'. Tree.

**SERVICE:** S4 **FUEL** 100LL, JET A **LGT** Actvt MIRL Rwy 09-27—CTAF.

Rwy 27 PAPI unusable byd 1 NM fm thr.

**AIRPORT REMARKS:** Attended 1300-2200Z†. Deer on and invof arpt.

Possible tfc from the Southampton Memorial Helipad 2 NM west of arpt. TPA—840(800) lgt acft, 1540(1500) hvy acft. Drainage ditches next to rwy & twys. Arpt FBO clsd Sat and Sun.

**AIRPORT MANAGER:** 757-562-8764

**WEATHER DATA SOURCES:** AWOS-3PT 124.675 (757) 562-8765.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

® **NORFOLK APP/DEP CON** 127.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Norfolk Apch at 757-464-0757.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE DCA.

**HOPEWELL (VL) (H) VORTACW** 114.35 HPW Chan 90(Y)

N37°19.73' W77°06.96' 171° 39.0 NM to fld. 70/6W.

VOR unusable:

052°-060° byd 40 NM

100°-105° byd 40 NM


150°-160° byd 40 NM

205°-220° blo 4,500'

225°-242° byd 30 NM blo 6,000'

295°-305° byd 40 NM

330°-345° byd 40 NM

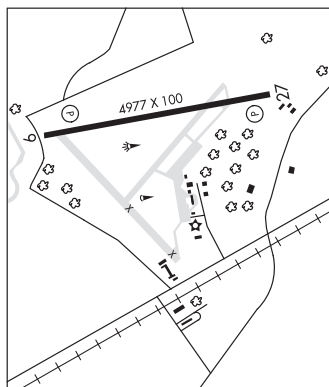

**WASHINGTON**

**L-35C, 36H**

**IAP**