

PINEHURST/SOUTHERN PINES

MOORE CO (SOP)(KSOP) 3 N UTC-5(-4DT) N35°14.25' W79°23.34'

CHARLOTTE

459 B NOTAM FILE SOP

H-9C, 12H, L-35A, 36F

RWY 05-23: H6503X150 (ASPH-GRVD) S-100, D-162

IAP

PCN 27 F/A/X/T HIRL 0.4% up SW

RWY 05: MALSR. PAPI(P4L)—GA 3.0° TCH 40'. Thld dsplcd 600'. Trees.

RWY 23: REIL. PAPI(P4R)—GA 3.0° TCH 41'. Thld dsplcd 400'. Trees.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 05: TORA-6502 TODA-6502 ASDA-6102 LDA-5502

RWY 23: TORA-6502 TODA-6502 ASDA-6102 LDA-5722

SERVICE: S4 FUEL 100LL, JET A+ OX 3 LGT Actvt MALSR Rwy 05; REIL Rwy 23; HIRL Rwy 05-23; twy lgts—CTAF. PAPI Rwy 05 & 23 opers consly.

NOISE: Noise abatement procedures in effect. Ctc amgr 910-692-3212.

AIRPORT REMARKS: Attended 1300-0100Z†. Bird activity on and invof arpt Apr-Oct. Fixed wing aircraft operations not authorized from any grass/turf surface. Clsd to unscheduled air carrier ops with more than 30 passenger seats, call arpt mgr 910-692-3212. 12 hr PPR for jet ops conducted 0400-1100Z†, ctc arpt mgr 910-692-3212. Maint avbl. Flt trng avbl.

AIRPORT MANAGER: 910-692-3212

WEATHER DATA SOURCES: AWOS-3PT 127.575 (910) 692-4287.

COMMUNICATIONS: CTAF/UNICOM 123.05

® FAYETTEVILLE APP/DEP CON 127.8

CLNC DEL 127.0

CLEARANCE DELIVERY PHONE: For CD ctc Fayetteville Apch 910-484-8012.

RADIO AIDS TO NAVIGATION: NOTAM FILE RDU.

SANDHILLS (L) VORTACW 111.8 SDZ Chan 55 N35°12.93' W79°35.28' 085° 9.9 NM to fld. 588/3W.

VOR unusable:

075°-143°

144°-154° blo 6,000'

144°-154° byd 23 NM

155°-179° blo 5,000'

180°-264° blo 8,000'

301°-019° byd 10 NM blo 10,000'


DME unusable:

041°-092° blo 3,000'

TAC AZM unusable:

016°-050° byd 28 NM blo 3,000'

ILS/DME 111.5 I-SOP Chan 52 Rwy 05. Class IT. LOC unmonitored 0100-1300Z†.

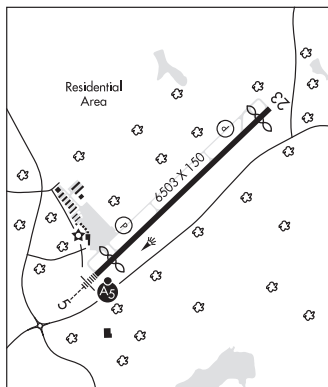

PITT-GREENVILLE (See GREENVILLE on page 320)

PLYMOUTH

DONALD'S AIR PARK INC (7NC) 8 SE UTC-5(-4DT) N35°43.90' W76°40.28'

CHARLOTTE

18 NOTAM FILE RDU

RWY 05-23: 4195X100 (TURF) LIRL(NSTD)

RWY 05: Brush.

RWY 23: Pole.

SERVICE: S3 LGT To ACTVT LIRL Rwy 05-23 call 252-809-9010. Rwy 05-23 nstd LIRL due to spacing of rwy lgts and no end lgts.

AIRPORT REMARKS: Attended Mon-Sat 1300-2200Z†, Sun 1800-2200Z†. Heavy agricultural acft ops Mar-Nov. Parallel turf rwy arpt within 3/4 mile NW. Rwy 23 has unmkd p-line 60' +/- each side of thld with p-line buried acrs rwy width at thld. Addnl unmkd 50' p-line 1200' from Rwy 23 thld. Rwy 05 and Rwy 23 mkd with yellow cones. Rwy 5 has 8' ditch 12' from thld both sides cntrln.

AIRPORT MANAGER: 252-809-9010

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.

COMM/NAV/WEATHER REMARKS: Mnt freq 122.8 for tfc adzy.