

WAAS CH 65708 W02A	APP CRS 018°	Rwy Ldg 6201 TDZE 488 Apt Elev 488
--	------------------------	---

RNAV (GPS) RWY 2
DILLANT/HOPKINS (EEN)

RNP APCH - GPS.	
-----------------	--


T Circling Rwy 32 NA at night. Rwy 2 helicopter visibility reduction below $\frac{3}{4}$ SM NA. Inop table does not apply to LPV all Cats and LNAV Cat A. For inop ALS, increase LNAV Cat B visibility to $\frac{1}{4}$ SM. When local altimeter setting not received, use ORE altimeter setting; increase LPV DA to 897; increase all MDAs 60 feet. For inop ALS when using ORE altimeter setting, increase LNAV Cats A/B visibility to $\frac{1}{4}$ SM. VDP NA when using ORE altimeter setting.

MALSR



MISSED APPROACH:
Climb to 1600 then
climbing left turn to
3400 direct JUNPU
and hold.

AWOS-3PT 119.025	BOSTON CENTER 123.75 338.2	UNICOM 123.0 (CTAF) 0
----------------------------	--------------------------------------	--

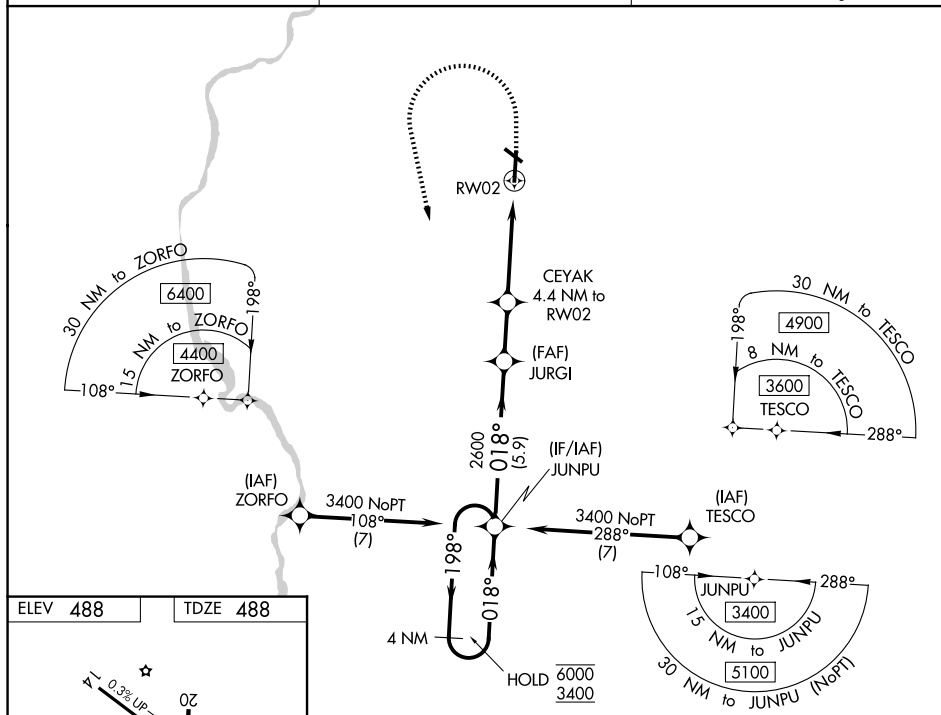

VGS and RNAV glidepath not coincident
(VGS Angle 3.00/TCH 39).

Holding Pattern

JUNPU
2600

CHEYAK
4.4 NM to RWY 02

JURGI
2600

RWY 02

GP 3.00°
TCH 43

5.9 NM

CATEGORY	A	B	C	D
LPV DA	843-1		355 (400-1)	
LNAV MDA	1340-1	852 (900-1)	1340-2	852 (900-2)
CIRCLING	1380-1½ 892 (900-1½)	1480-1½ 992 (1000-1½)	1760-3 1272 (1300-3)	1980-3 1492 (1500-3)