

APP CRS	Rwy Ldg	12000
353°	TDZE	5354
	Apt Elev	5434

RNAV (RNP) Z RWY 34R

DENVER INTL (DEN)



For uncompensated Baro-VNAV systems, procedure NA below -25°C (-13°F) or above 46°C (114°F). GPS required. For inoperative ALSF, increase RNP 0.10 all Cats visibility to RVR 6000 and RNP 0.20 all Cats visibility to 1½ mile and RNP 0.30 all Cats visibility to 2¼ mile. Simultaneous approach authorized. Use of FD or AP providing RNAV track guidance required during simultaneous operations.

ALSF-2

MISSED APPROACH:
Climb to 6000 then
climbing left turn to 10000
direct HYGEN and hold.

D-ATIS 125.6 379.9	DENVER APP CON 119.3 307.3 (N) 120.35 379.3 (S)	DENVER TOWER 135.3 351.95	GND CON 121.35 379.175 (W) 121.85 377.1 (E)
-----------------------	---	------------------------------	---

MISSED APCH FIX

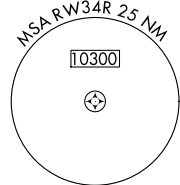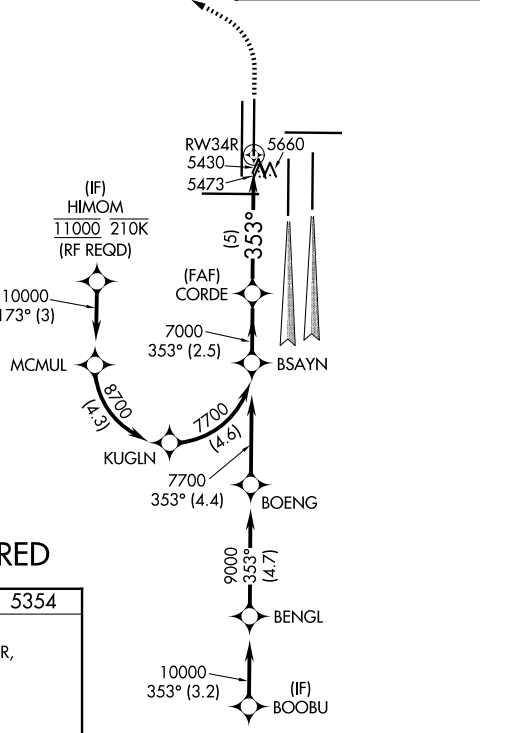

RADAR REQUIRED

ELEV 5434 TDZE 5354

HIRL all Rwys
TDZ/CL Rwys 7, 16L, 16R, 17R,
26, 34L, 34R, 35L, 35R

GP 3.00° TCH 59

BSAYN 7700 353° 7000

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 63).

6000 10000 HYGEN

See planview for multiple IF locations.

RW34R

CATEGORY	A	B	C	D
RNP 0.10 DA	5739/40	385 (400-¾)		
RNP 0.20 DA	5849/60	495 (500-1¼)		
RNP 0.30 DA	5980-1 ½	626 (600-1½)		

AUTHORIZATION REQUIRED