

**RIO VISTA MUNI** (088) 3 NW UTC-8(-7DT) N38°11.60' W121°42.22'

**SAN FRANCISCO**

23 B NOTAM FILE RIU

L-2F, 3A, A

IAP

**RWY 07-25:** H4199X75 (ASPH) S-30 MIRL  
**RWY 07:** REIL. PAPI(P2L)—GA 4.0° TCH 40'.  
**RWY 25:** REIL. PAPI(P2L)—GA 4.0° TCH 40'. Rgt tfc.  
**RWY 15-33:** H2199X60 (ASPH) S-12.5 MIRL  
**RWY 15:** REIL. PAPI(P2L)—GA 4.0° TCH 40'. Pole.  
**RWY 33:** REIL. PAPI(P2L)—GA 4.0° TCH 40'. Rgt tfc.

**SERVICE:** FUEL 100LL LGT ACTVT REIL Rwy 07, 15, 25 and 33; PAPI Rwy 07, 15, 25 and 33; MIRL Rwy 07-25 and 15-33; Perimeter H1—CTAF.

**NOISE:** Noise sensitive area N of Rwy 33. Do not overfly ranch and corrals off Rwy 33. All rwy climbs to 700' before turns.

**AIRPORT REMARKS:** Attended Mon-Thu 1600-0100Z†. Fast pay fuel system avbl 24 hours. Rwy 25 calm wind rwy.

**AIRPORT MANAGER:** 707-249-7510

**WEATHER DATA SOURCES:** AWOS-AV 127.075 (707) 374-5396.

**COMMUNICATIONS:** CTAF/UNICOM 122.725


Ⓡ TRAVIS APP/DEP CON 119.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Oakland ARTCC at 510-745-3380.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE SAC.

**SACRAMENTO (VH) (H) VORTACW** 115.2 SAC Chan 99 N38°26.62' W121°33.10' 189° 16.6 NM to fld. 3/17E.

- VOR unusable:  
 031°-041° byd 40 NM blo 5,000'  
 031°-041° byd 45 NM blo 18,000'  
 157°-169° byd 40 NM blo 4,500'  
 157°-169° byd 56 NM blo 18,000'  
 246°-251° byd 40 NM  
 252°-262° byd 40 NM blo 7,000'  
 252°-262° byd 65 NM  
 263°-269° byd 40 NM  
 353°-013° byd 40 NM blo 5,000'  
 353°-013° byd 49 NM blo 5,500'  
 353°-013° byd 58 NM

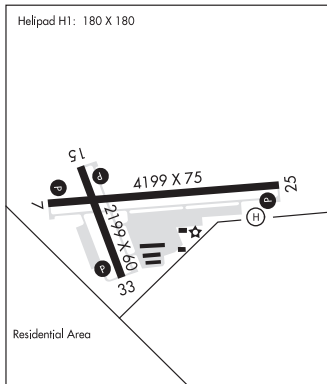

**HELIPAD H1:** H180X180 (CONC) PERIMETER LGTS

**HELIPORT REMARKS:** No autorotations, hovering auto's or running landings to pavement. Helicopter tfc to helipad remain S of arpt 500'. When wind favors Rwy 15-33 helicopters may use apron area W of Rwy 15-33, remain W of arpt 500'.