

APP CRS 344°	Rwy Idg TDZE Apt Elev	9426 387 432
------------------------	-----------------------------	---

RNAV (RNP) Z RWY 34C
SEATTLE-TACOMA INTL (SEA)

RNP AR APCH.

T For uncompensated Baro-VNAV systems, procedure NA below -6°C or above 54°C. Simultaneous approach authorized except arrivals at SHIPZ. Use of FD or AP required during simultaneous operations.



MALSR



MISSED APPROACH: Climb to 5000 on track 344° to MGNUM and hold, continue climb-in-hold to 5000.

D-ATIS 118.0	SEATTLE APP CON 133.65 273.45	SEATTLE TOWER 119.9 239.3 (Rwys 16L, 16C, 34C, 34R) 120.95 239.3 (Rwys 16R, 34L)	GND CON 121.7	CLNC DEL 128.0	CPDLC
------------------------	---	--	-------------------------	--------------------------	-------

MISSED APCH FIX

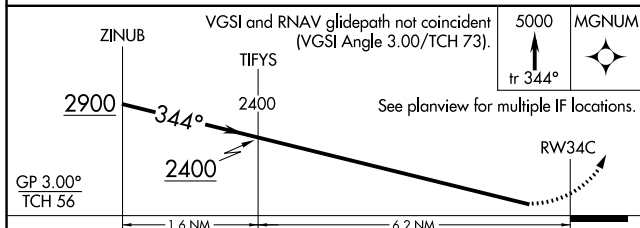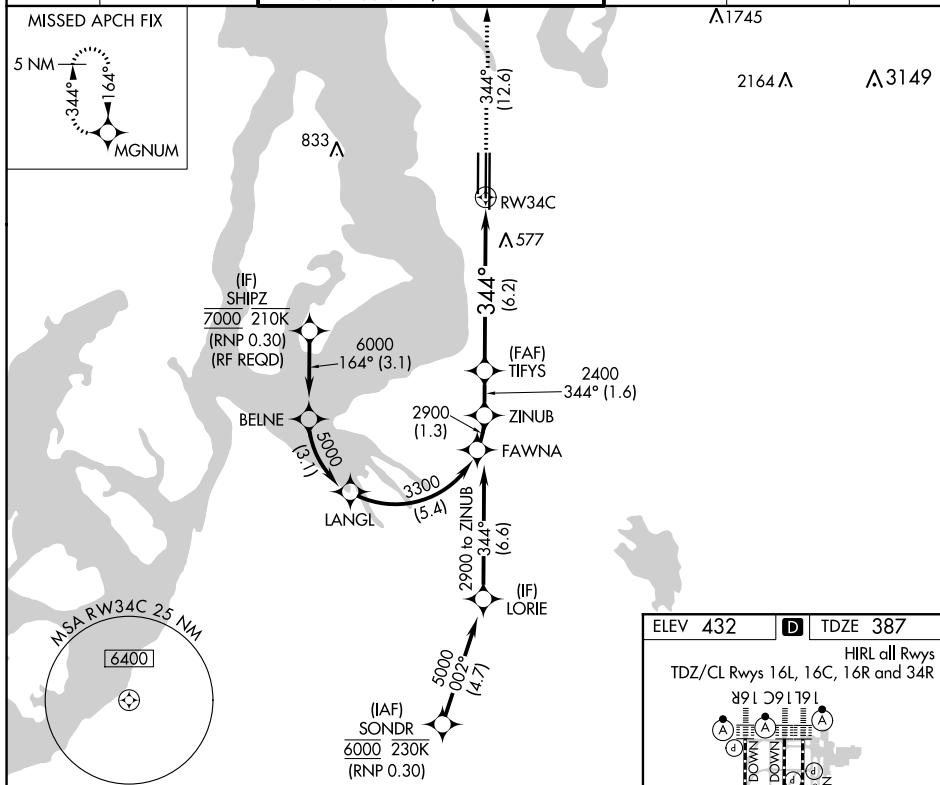

CATEGORY	A	B	C	D
RNP 0.30 DA	829/50 442 (400-1)			

ELEV 432

TDZE 387

HIRL oil Rwyys

TDZ/CL Rwyys 16L, 16C, 16R and 34R

8500 X 150

8226 X 150

11901 X 150

3440

344°

34L

34C

34R

TWR 696

TWR 517