


LOC/DME I-LLM 111.7 Chan 54	APP CRS 317°	Rwy Idg 7120 TDZE 102 Apt Elev 107
---	------------------------	---

ILS or LOC RWY 32
MC ALLEN INTL (MF'E)

⚠ Circling NA northeast of Rwy 14-32. ADF and DME or Radar required. When local altimeter setting not received, use Weslaco altimeter setting: increase all DA 39 feet and MDA 40 feet.		MISSED APPROACH: Climb to 2100 direct MF LOM and hold		
ATIS 128.5	VALLEY APP CON 126.55 377.2	MC ALLEN TOWER ★ 118.5 (CTAF) 0 256.9	GND CON 121.8	UNICOM 122.95

DME or RADAR REQUIRED

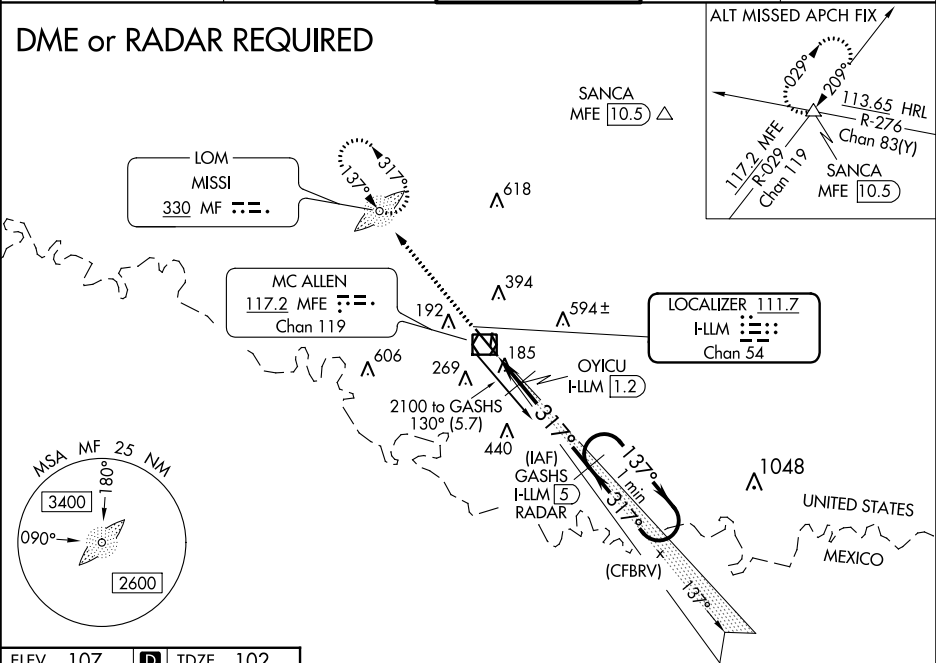

ELEV 107	D	TDZE 102
REIL Rwy 32 HIRL Rwy 14-32 MIRL Rwy 18-36		
FAF to MAP 5.2 NM		
Knots	60	90 120 150 180
Min:Sec	5:12	3:28 2:36 2:05 1:44

2100	MF	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 53).	GASHS I-LLM 5 RADAR	One Minute Holding Pattern
*LOC only	OYICU I-LLM 1.2		1800	137°→ 2100
				← 317°
				GS 3.00° TCH 50
				*600 when using Weslaco altimeter setting.
				1.4 NM 3.8 NM
CATEGORY	A	B	C	D
S-ILS 32	302-3/4		200 (200-3/4)	
S-LOC 32	560-1	458 (500-1)	560-1 3/8	458 (500-1 3/8)
CIRCLING	580-1	473 (500-1)	580-1 1/2 473 (500-1 1/2)	800-2 1/4 693 (700-2 1/4)
OYICU FIX MINIMUMS				
S-LOC 32	440-1		338 (400-1)	
CIRCLING	580-1	473 (500-1)	580-1 1/2 473 (500-1 1/2)	800-2 1/4 693 (700-2 1/4)