

## LEONARDTOWN

**ST MARY'S CO RGNL** (2W6) 4 NE UTC-5(-4DT) N38°18.92' W76°33.01'

WASHINGTON  
L-29E, 34E, 36I, A  
IAP

142 B NOTAM FILE DCA

**RWY 11-29:** H4150X75 (ASPH) S-12.5 MIRL 0.4% up W

**RWY 11:** REIL. PAPI(P2L)—GA 3.0° TCH 37'. Hill.

**RWY 29:** REIL. PAPI(P2L)—GA 3.0° TCH 32'. Trees.

**SERVICE:** S4 FUEL 100LL, JET A LGT ACTIVATE MIRL Rwy 11-29,  
REIL Rwys 11 and 29—CTAF.

**AIRPORT REMARKS:** Attended 1300-2200Z±. Deer on & invof Rwy 11-29 SS-SR. Glider, UAS, and ultralight activity on and invof arpt. Mil acct on instr apch to Pax River NAS may overfly arpt at 1600' MSL & not mon CTAF. When Pax Rwy 14 in use, 2W6 acct cross apch path at or blw 1000' or above 3000'. Mil helo ops invof arpt. Self serve 100LL avbl with credit card. Rwy 29 15 ft depression (downslope) 300 ft fr thr 150 ft R-125 ft L. Rwy 11-29 unfilled cracks, vegetative growth, oxidation, ravelling. Rwy 29 markings faded. When R-4007 in effect, acct operating VFR at arpt must remain within 1.5 NM of arpt, at or blw 1500 MSL, and above 700' AGL. All VFR fit ops conducted within R-4007 shall be at or blw 1000' MSL. IFR and VFR apchs within R-4077 will be coordinated with Patuxent Apch on 121.0 or by phone 301-342-3740.

**AIRPORT MANAGER:** (301) 475-4200

**WEATHER DATA SOURCES:** AWOS-3 119.575 (301) 373-6514.

**COMMUNICATIONS:** CTAF/UNICOM 123.0

Ⓡ PATUXENT APP/DEP CON 121.0 (1200-0400Z± Mon-Sun. Other times by NOTAM) other time ctc

Ⓡ POTOMAC APP/DEP CON 135.625

**CLEARANCE DELIVERY PHONE:** For CD ctc Patuxent Apch at 301-342-3740, when Patuxent Apch is clsd ctc Potomac Apch at 866-640-4124.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE SBY.

**SALISBURY (L) (L) VORTACW** 111.2 SBY Chan 49 N38°20.70' W75°30.63' 280° 49.1 NM to fld. 48/12W.

VOR unusable:

007°-026° byd 20 NM blo 7,000'

027°-089° byd 13 NM blo 5,000'

090°-110° byd 20 NM blo 5,000'

111°-113° byd 19 NM blo 5,000'

114°-120° byd 16 NM blo 5,000'

261°-285° blo 6,000'

294°-007° blo 5,000'

TACAN AZIMUTH unusable:

009°-055° byd 20 NM

261°-285° blo 6,000'


294°-007° blo 5,000'

DME unusable:

009°-055° byd 20 NM

261°-285° blo 6,000'

294°-007° blo 5,000'

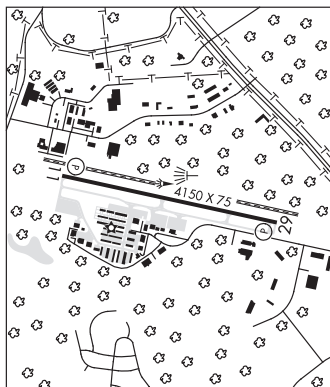

**MARTIN STATE** (See BALTIMORE on page 95)

**MARYLAND** (See INDIAN HEAD on page 108)

**MASSEY AERODROME** (MD1) 2 E UTC-5(-4DT) N39°17.96' W75°47.96'

WASHINGTON

73 NOTAM FILE DCA

**RWY 02-20:** 3000X100 (TURF)

**RWY 20:** Thld dsplcd 120'. P-line.

**AIRPORT REMARKS:** Attended 1500-2200Z±. Gliders, hang-glidors, powered prchts, ultralight act, on and invof arpt. Rwy thr and sides marked with white cones. Rwy 20 dsplcd thr marked with 3 white cones on both sides.

**AIRPORT MANAGER:** 410-928-5270

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Philadelphia Apch at 800-354-9884.

**MEXICO FARMS** (See CUMBERLAND on page 100)

**MONTGOMERY CO AIRPARK** (See GAITHERSBURG on page 106)