

MAHLON SWEET FLD (See EUGENE on page 168)**MALIN** (4S7) 1 SE UTC-8(-7DT) N42°00.07' W121°23.78'

KLAMATH FALLS

4053 NOTAM FILE MMV
RWY 14-32: H2800X30 (ASPH)

RWY 32: Road.

SERVICE: FUEL 100LL

AIRPORT REMARKS: Unattended. Rwy 14-32 numbers smaller than standard, no centerline. Rwy 32 thld marked with white chevrons. Rwy 32 has NSTD displaced threshold markings. Rwy 14-32 has many areas of unsealed longitudinal and transverse cracking throughout rwy. Gaps 1-3 in. Twy not marked with centerline. Parking apron not equipped with tie downs. Remote ctld acft in vcnty.**AIRPORT MANAGER:** 541-891-5718**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Seattle ARTCC at 253-351-3694.**MANZANITA****MEHALEM BAY STATE** (3S7) 2 S UTC-8(-7DT) N45°41.89' W123°55.78'

SEATTLE

30 NOTAM FILE MMV
RWY 15-33: H2350X50 (ASPH)

RWY 15: Hill.

AIRPORT REMARKS: Unattended. Wildlife invof rwy. Unpaved twy and ramp. Sfc conds not rptd.**AIRPORT MANAGER:** 503-378-4880**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Seattle ARTCC at 253-351-3694.**MC DERMITT STATE** (26U) 0 W UTC-8(-7DT) N42°00.62' W117°43.63'

KLAMATH FALLS

4478 B NOTAM FILE MMV
RWY 16-34: H5900X60 (ASPH) S-12.5 PCN 13 F/C/X/T MIRL
1.0% up N

SERVICE: LGT ACTIVATE MIRL Rwy 16-34—CTAF.

AIRPORT REMARKS: Unattended. Surface conditions not reported. P-lines South and East.**AIRPORT MANAGER:** 503-378-4880**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Salt Lake ARTCC at 801-320-2568.**RADIO AIDS TO NAVIGATION:** NOTAM FILE REQ.**ROME (VH) (DH) VOR/DME** 112.5 REO Chan 72 N42°35.43'
W117°52.09' 151° 35.4 NM to fld. 4040/19E.

DME unusable:

095°-105° byd 30 NM blo 10,000'

115°-125° byd 30 NM blo 10,000'

VOR unusable:

011°-021° byd 40 NM

044°-054° byd 40 NM blo 31,000'

055°-119° byd 40 NM

120°-130° byd 40 NM blo 29,000'

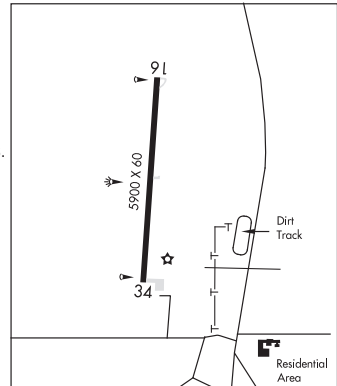
131°-179° byd 40 NM

180°-190° byd 40 NM blo 19,000'

191°-214° byd 40 NM

225°-303° byd 40 NM

304°-315° byd 40 NM blo 18,000'

**MC KENZIE BRIDGE STATE** (ØØS) 3 E UTC-8(-7DT) N44°10.89' W122°05.13'

KLAMATH FALLS

1620 NOTAM FILE MMV
RWY 06-24: 2600X90 (TURF)

RWY 06: Trees.

RWY 24: Trees.

AIRPORT REMARKS: Unattended. Arprt CLOSED Nov 1-May 1. Wildlife on and invof arprt year round. Owner advises ctc with Oregon Dept of Aviation 503-378-4880 prior to use. Rwy 06-24 slopes up to the east. Expect significant turbulence and downdrafts near rwy. Rwy 06-24 rough on east half. Land east-tnk west. Rwy 06 thld marked with white mats. Rwy edges marked with white panel markers. Sfc conds not rptd.**AIRPORT MANAGER:** 503-378-4880**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Seattle ARTCC at 253-351-3694.