


SW-3, 24 MAY 2018 to 21 JUN 2018

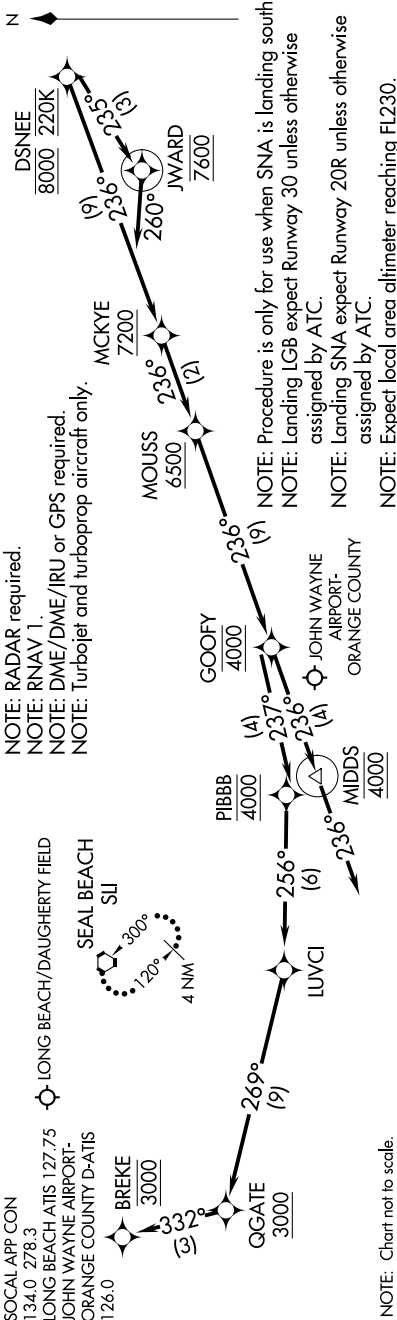

SOCAL APP CON  
134.0 278.3  
LONG BEACH ATIS 127.75  
JOHN WAYNE AIRPORT-  
ORANGE COUNTY D-ATIS  
126.0

NOTE: RADAR required.  
NOTE: RNAV 1.  
NOTE: DME/DME/IRU or GPS required.  
NOTE: Turbojet and turboprop aircraft only.

NOTE: Procedure is only for use when SNA is landing south.  
NOTE: Landing LGB expect Runway 30 unless otherwise assigned by ATC.  
NOTE: Landing SNA expect Runway 20R unless otherwise assigned by ATC.  
NOTE: Expect local area altimeter reaching FL230.

ARRIVAL ROUTE DESCRIPTION

**LANDING LGB RUNWAY 12:** From DSNEE on track 236° to cross MCKYE at or above 7200, then on track 236° to cross MOUSS at or above 6500, then on track 236° to cross GOOFY at 4000, then on track 237° to cross PIBBB at 4000, then on track 256° to LUVCI, then on track 269° to cross QGATE at or above 3000, then on track 332° to cross BREKE at 3000. Expect RNAV (RNP) RWY 12 approach.

**LANDING LGB RUNWAYS 25R, 30:** From DSNEE on track 236° to cross MCKYE at or above 7200, then on track 236° to cross MOUSS at or above 6500, then on track 236° to cross GOOFY at 4000, then on track 236° to cross MIDS at 4000, then on track 236° Expect ILS or RNAV (RNP) RWY 30 approach, or RNAV (RNP) RWY 25R approach.

**LANDING SNA:** From DSNEE on track 235° to cross JWARD at 7600, then on heading 260° or as assigned by ATC. Expect RADAR vectors to ILS or RNAV (RNP) RWY 20R final approach course.

**LOST COMMUNICATIONS:** In the event of lost communications:  
**LANDING LGB RUNWAYS 25R, 30:** After MIDS proceed on the RNAV (RNP) RWY 30 or ILS RWY 30 approach.  
**LANDING LGB RUNWAY 12:** After BREKE proceed on the RNAV (RNP) RWY 12 approach, if unable approach, after MIDS/BREKE climb to 4000 direct SUI VORTAC and hold.  
**LANDING SNA RUNWAY 20R:** After DSNEE proceed on the RNAV (RNP) RWY 20R approach. If unable approach, after DSNEE maintain 6000 direct SUI VORTAC and hold.

SW-3, 24 MAY 2018 to 21 JUN 2018