

CODY

YELLOWSTONE RGNL (COD)(KCOD) 2 SE UTC-7(-6DT) N44°31.21' W109°01.43'

GREAT FALLS
H-1E, L-13D
IAP

5102 B Class I, ARFF Index A NOTAM FILE COD

RWY04-22: H8268X100 (ASPH-GRVD) S-95, D-124, 2S-101, 2D-193

PCN 38 F/D/X/T HIRL

RWY 04: REIL. PAPI(P4L)—GA 3.5° TCH 63'. Thld dspcld 690'. Pole. 0.7% down.

RWY 22: REIL. PAPI(P4L)—GA 3.0° TCH 53'. Thld dspcld 400'. Ground.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 04: TORA-8268 TODA-8268 ASDA-7868 LDA-7178

RWY 22: TORA-8268 TODA-8268 ASDA-7578 LDA-7178

SERVICE: S4 FUEL 100, JET A OX1 LGT ACTIVATE HIRL and REIL Rwy 04-22—CTAF. Rwy 04 PAPI byd 4 NM unusbl. Rwy 04 PAPI unusbl byd 4.0 NM due to rapidly rising terrain N of final to Rwy 04.

AIRPORT REMARKS: Attended 1200-0700Z†. Call out after hrs svcs is 307-587-9262. Airfield surface conditions are not monitored btn the hrs of 0600-1200Z†. Clsd to unscheduled air carrier ops with more than 30 pax seats exc PPR call arpt ops 307-899-5096. Low level waterfowl on lake 1/4 mile SE of Rwy 04 thld. Cold temperature restricted airport. Altitude correction required at or below -31C. Ldg fee for acft over 9,000 lbs.

AIRPORT MANAGER: 307-587-5096

WEATHER DATA SOURCES: AWOS-3PT 135.075 (307) 527-5197.

COMMUNICATIONS: CTAF/UNICOM 122.8

CODY RCO 122.3 (CASPER RADIO)

SALT LAKE CENTER APP/DEP CON 127.75

AIRSPACE: CLASS E svc continuous.

RADIO AIDS TO NAVIGATION: NOTAM FILE COD.

CODY (L) VORW/DME 111.8 COD Chan 55 N44°37.23' W108°57.90' 189° 6.5 NM to fld. 4800/14E.

VOR unusable.

043°-113° byd 10 NM blo 9,500'


DME portion unusable:

043°-113° byd 10 NM blo 9,500'

113°-138° byd 22 NM blo 10,000'

138°-183° byd 32 NM blo 11,000'

183°-343° byd 30 NM blo 17,000'

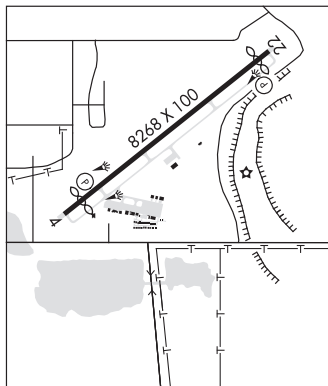

COKEVILLE MUNI (U06) 3 S UTC-7(-6DT) N42°02.75' W110°57.96'

SALT LAKE CITY
L-11D

6270 B NOTAM FILE CPR

RWY 15-33: H3400X60 (ASPH) S-10 RWY LGTS(NSTD)

RWY 33: Fence.

SERVICE: LGT MIRL Rwy 15-33 OTS indef. Rwy 15-33 NSTD MIRL.

MIRL has missing lgts causing NSTD spacing. ACTIVATE MIRL Rwy 15-33—CTAF.

AIRPORT REMARKS: Unattended. 120' high electrical transmission lines running east-west 2 miles north of arpt. +2' ground 70' west of cntrl full length. Unctl vehicle access to arpt. Rwy 15-33 elev highest near midfld. Rwy 15-33 pavement has lost all structural integrity. Pot holes beginning to form. No line of sight between rwy ends. Some thld lenses clear. Variable rwy conds and braking action during winter months due to thawing and freezing precipitation. Old yellow X visible at Rwy 33 end. Wind indicator lgts OTS indef. Bcn OTS indef.


AIRPORT MANAGER: (307) 270-8266

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Salt Lake ARTCC at 801-320-2568.

RADIO AIDS TO NAVIGATION: NOTAM FILE CPR.

FORT BRIDGER (L) VORW/DME 108.6 FBR Chan 23 N41°22.71' W110°25.44' 315° 46.8 NM to fld. 7058/14E.

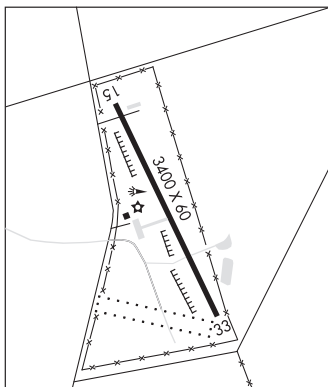

CONVERSE CO (See DOUGLAS on page 246)