

LOC/DME I-PDX 110.5 Chan 42	APP CRS 103°	Rwy Idg 11000 TDZE 24 Apt Elev 31
--	------------------------	--


ILS RWY 10R (CAT II & III)

PORTLAND INTL (PDX)


⚠ Simultaneous approach authorized with Rwy 10L. CAT II: RVR 1000 authorized with specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown.

⚠ MISSED APPROACH: Climb to 1100 then climbing right turn to 5000 on BTG VORTAC R-160 to MULES INT/BTG 17.7 DME and hold, continue climb-in-hold to 5000.

D-ATIS 128.35 269.9	PORTLAND APP CON 124.35 299.2	PORTLAND TOWER Rwy 10L-28R 118.7 257.8 Rwys 3-21, 10R-28L 123.775 251.125	GND CON 121.9 348.6	CLNC DEL 120.125 318.1	CPDLC
---	---	---	-------------------------------	----------------------------------	-------

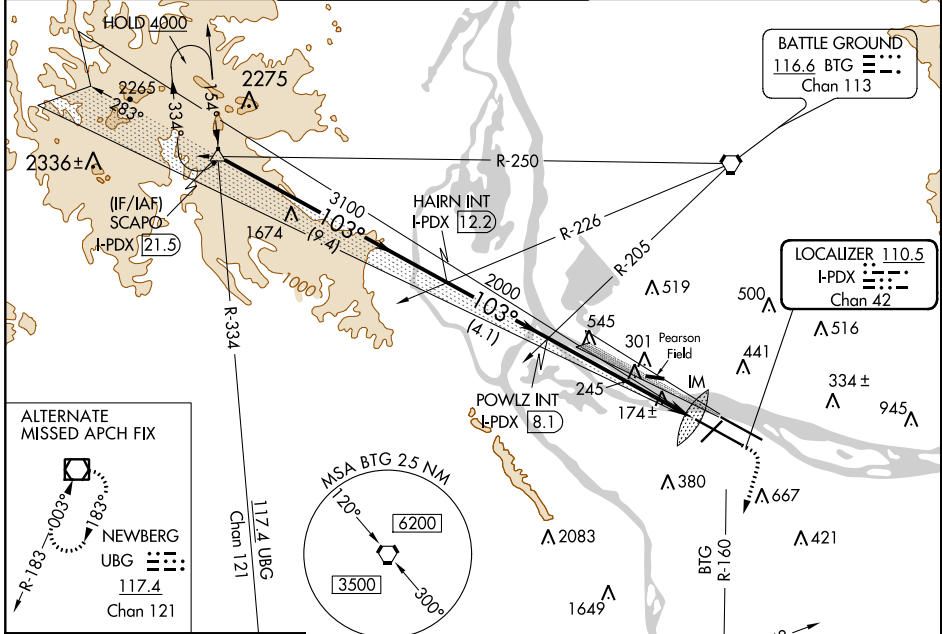

ELEV 31	D	TDZE 24
---------	----------	---------

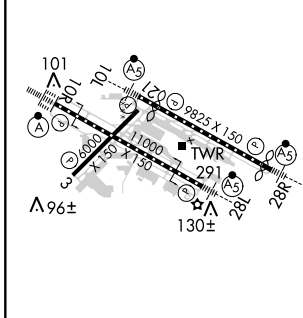

SCAPO I-PDX 21.5	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 71).	1100	5000	MULES
HAIRN INT I-PDX 12.2		↑	↷	△
POWLZ INT I-PDX 8.1				
4000	3100	2000	IM 121	
GS 3.00° TCH 53				

CATEGORY	A	B	C	D
S-ILS 10R	CAT II RA 107/12 100 DA 124			
S-ILS 10R	CAT III a RVR 07			
S-ILS 10R	CAT III b RVR 06			
S-ILS 10R	CAT III c NA			

CATEGORY II & III ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

REIL Rwys 3 and 21
TDZ/CL Rwy 10R
MIRL Rwy 3-21
HIRL Rwys 10L-28R and 10R-28L

NW-1, 12 SEP 2019 to 10 OCT 2019

NW-1, 12 SEP 2019 to 10 OCT 2019