

SANTA MONICA MUNI (SMO)(KSMO) 3 E UTC-8(-7DT) N34°00.95' W118°27.08'

170 B TPA—See Remarks LRA NOTAM FILE SMO

RWY 03-21: H3500X150 (ASPH-GRVD) S-40, D-60, 2D-105 MIRL

1.2% up NE

RWY 03: PAPI(P4L)—GA 3.42° TCH 28'. Tree. Rgt tfc.

RWY 21: REIL. PAPI(P4L)—GA 3.5° TCH 45'.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 03: TORA-3500 TODA-3500 ASDA-3500 LDA-3500

RWY 21: TORA-3500 TODA-3500 ASDA-3500 LDA-3500

SERVICE: S4 FUEL 100LL, JET A 0X1, 3 LGT When twr clsd ACTIVATE REIL Rwy 21; MIRL Rwy 03-21—CTAF.

AIRPORT REMARKS: Attended continuously. PPR required for dual wheel acft in excess of 60,000 pounds certified maximum ldg weight, ctc arpt manager 310-458-8592. Helicopter flight training ops prohibited, helicopter ops apch boundry at midfield at or above 900' MSL. No touch/go, stop/go, or low apch permitted on Sat, Sun, holidays, weekdays SS-1500Z±. IFR jets and turboprops ctc ground prior to engine start. Tsnt parking south side, next to bcn. Turbine acft and acft over 12,000 lbs prohibited on south side transit parking. Continuous noise ordinance in effect ctc noise office for procedures 310-458-8692. Noise limits all acft: Pure Jet and Stage II (with/without hush kits) prohibited. Maximum noise limit 95.0 DBA single event noise exposure level (senel) RCRDD 2200' extended centerline. Curfew, no engine starts, APU, or tkofs except PPR lifeguard flights 0700-1500Z± Mon-Fri and 0700-1600Z± weekends. PPR ex-military acft ctc arpt manager 310-458-8692. VFR departures Rwy 21 turn left 10° over SMO VOR then turn right 225°. If departure north, no right turns before reaching shoreline. Rwy 03 departure no turns prior to 405 freeway located 1 mile E. Engine maintenance runup: Jets and turboprop N side, within 300' E of Twy A4. Piston single and twins on S side, within 300' E of Twy B4. TPA—1370(1200) single engine, 1870(1700) twin engine. Intersection departures and formation landings/departures prohibited. Rwy 03-21 dep end approximately 1000' from residential homes. Extended high power settings on run-up or dep negatively impact the community. The paved areas preceding the Rwy 03-21 thlds are not avbl for ldg, tkof, or taxi Ops. The paved areas are now blast pads created from thlds relocation and rwy len reduction in December 2017. Acft must now exit the rwy at designated connector twys. The continuous rwy exit system is no longer avbl. Ldg fee.

AIRPORT MANAGER: (310) 458-8692

WEATHER DATA SOURCES: ASOS (310) 392-6453 LAWRS.

COMMUNICATIONS: CTAF 120.1 ATIS 119.15 310-450-4620 UNICOM 122.95

® **SOCAL APP CON** 124.3 (101°-245°) 124.9 (069°-100°) 125.2 (246°-341°) 128.5 (342°-068°)

TOWER 120.1 (1500-0500Z±) **GND CON** 121.9 **CLNC DEL** For clnc del when twr clsd call SoCal Apch 800-448-3724.

® **SOCAL DEP CON** 125.2

AIRSPACE: CLASS D svc 1500-0500Z±; other times CLASS G.

VOR TEST FACILITY (VOT) 113.9

RADIO AIDS TO NAVIGATION: NOTAM FILE SMO.

(L) **VOR/DME** 110.8 SMO Chan 45 N34°00.61' W118°27.40' at fld. 114/15E.

VOR & DME unusable:


070°-080° byd 30 NM blo 7,000'

265°-275° byd 25 NM blo 14,000'

275°-005° byd 30 NM blo 14,000'

HELIPAD H1: H40X40 (ASPH) PERIMETER LGTS

HELIPORT REMARKS: Helicopter flt training opr prohibited, helicopters cross arpt boundary at 900' MSL. Rwy H1 perimeter lgts.

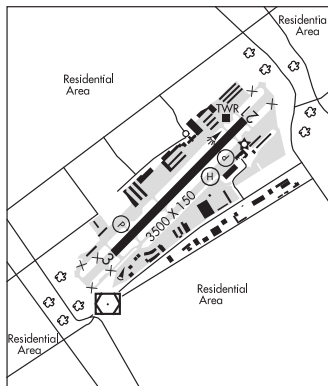

**LOS ANGELES
COPTER
L-3E, 4G, 7B, A
IAP, AD**