

FORT COLLINS/LOVELAND

NORTHERN COLORADO RGNL (FNL)(KFNL) 9 SE UTC-7(-6DT) N40°27.11' W105°00.68'

CHEYENNE
H-3F, 5A, L-10F
IAP, AD

5016 B Class I, ARFF Index B NOTAM FILE FNL

Rwy 15-33: H8500X100 (ASPH-GRVD) S-50, D-65, 2S-82, 2D-130

PCN 49 F/C/W/T HIRL

Rwy 15: REIL. PAPI(P4L)—GA 3.0° TCH 54'. 0.5% up.

Rwy 33: MALS. PAPI(P4L)—GA 3.0° TCH 52'. 0.5% down.

Rwy 06-24: H2273X40 (ASPH)

RUNWAY DECLARED DISTANCE INFORMATION

Rwy 06: TORA-2273 TODA-2273 ASDA-2273 LDA-2273

Rwy 15: TORA-8500 TODA-8500 ASDA-8500 LDA-8500

Rwy 24: TORA-2273 TODA-2273 ASDA-2273 LDA-2273

Rwy 33: TORA-8500 TODA-8500 ASDA-8500 LDA-8500

SERVICE: S4 FUEL 100LL, JET A OX 1, 2 LGT HIRL Rwy 15-33 preset low ints; to increase ints and ACTIVATE parallel twy lights; REIL Rwy 15; MALS. Rwy 33; and PAPI Rwy 33—CTAF. Rwy 15 PAPI on continuous.

AIRPORT REMARKS: Attended continuously. 24 hr PPR for unscheduled air carrier ops with more than 30 passenger seats call arpt manager 970-962-2852. Rwy 33 preferred tkf and ldg with winds 5 kts or less any direction. Sfc condition unmonitored 0500-1300Z±. Twy A2 and Twy A3 weight bearing limit 12,500 lbs SWA. Rwy 06-24 rwy edge reflectors full length. NOTE: See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 970-962-2852

WEATHER DATA SOURCES: AWOS-3PT 135.075 (970) 669-9187.

COMMUNICATIONS: CTAF/UNICOM 122.7

FT. COLLINS-LOVELAND RCO 122.4 (DENVER RADIO)

GILL RCO 122.65 (DENVER RADIO)

Ⓡ DENVER APP/DEP CON 134.85 CLNC DEL 120.25


AIRSPACE: CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE DEN.

GILL (H) VORW/DME 114.2 GLL Chan 89 N40°30.23' W104°33.18' 249° 21.2 NM to fld. 4904/13E.

COLLN NDB (LOHW) 400 FN N40°21.79' W104°58.28' 332° 5.6 NM to fld. 4957/9E. NOTAM FILE FNL.

ILS 109.5 I-FNL Rwy 33. Class IE. LOM COLLN NDB. Unmonitored when arpt unattended.

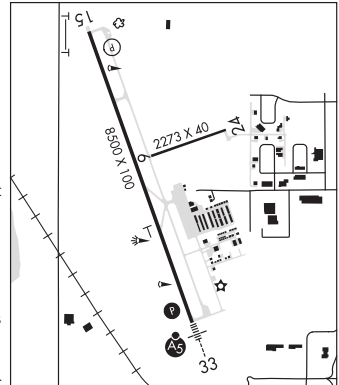

FORT MORGAN MUNI (FMM)(KFMM) 5 N UTC-7(-6DT) N40°20.13' W103°48.25'

CHEYENNE
H-5A, L-10F
IAP

4595 B TPA-5626(1031) NOTAM FILE DEN

Rwy 14-32: H5731X75 (ASPH) S-30 MIRL 1.5% up NW

Rwy 14: REIL. PAPI(P2L)—GA 3.0° TCH 28'.

Rwy 32: REIL. PAPI(P2L)—GA 3.0° TCH 27'. Road.

Rwy 17-35: 5216X80 (TURF-DIRT) 0.6% up N

Rwy 35: Road.

Rwy 08-26: 2468X100 (TURF)

Rwy 26: Road.

SERVICE: FUEL 100LL, JET A1 LGT ACTIVATE REIL Rwy 14 and Rwy 32; MIRL Rwy 14-32—CTAF.

AIRPORT REMARKS: Attended Mon-Sat 1500-0000Z±. Fuel avbl 24 hrs with credit card. Parachute Jumping. Be alert, intensive USAF student training invof Colorado Springs and Pueblo Colorado. Rwy 17-35, 21 road 100' east of and parallel to rwy cntrln full length. NOTE: See Special Notices—Aerobatic Operations in Colorado. USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 970-867-8414

WEATHER DATA SOURCES: AWOS-3 132.95 (970) 867-4823.


COMMUNICATIONS: CTAF/UNICOM 123.05

DENVER CENTER APP/DEP CON 118.475

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE AKO.

AKRON (H) VORW/DME 114.4 AKO Chan 91 N40°09.33' W103°10.78' 278° 30.6 NM to fld. 4623/13E.

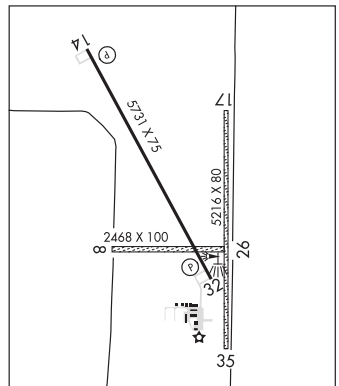

FREMONT CO (See CANON CITY on page 259)

FRONT RANGE (See DENVER on page 268)