

GUNNISON—CRESTED BUTTE RGNL (GUC)(KGUC) 1 SW UTC-7(-6DT) N38°32.06' W106°55.91' DENVER
 7680 B Class I, ARFF Index B NOTAM FILE GUC MON Airport H-3E, L-9E
 RWY 06-24: H9400X150 (ASPH-GRVD) S-75, D-160, 2D-250 IAP
 PCN 40 F/A/X/T HIRL

RWY 06: MALSF. PAPI(P4L)—GA 3.2° TCH 49'. Rgt tfc.
 RWY 24: REIL. PAPI(P4L)—GA 3.6° TCH 71'. 0.3% up.
 RWY 17-35: 2981X150 (TURF-GRVL) 0.5% up N
 RWY 17: Rgt tfc.
 RWY 35: Thld dspcd 233'.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 06: TORA-9397 TODA-9397 ASDA-9397 LDA-9397
 RWY 17: TORA-2980 TODA-2980 ASDA-2980 LDA-2980
 RWY 24: TORA-9397 TODA-9397 ASDA-9397 LDA-9397
 RWY 35: TORA-2980 TODA-2980 ASDA-2980 LDA-2980

SERVICE: FUEL 100LL, JET A+ OX 1, 2 LGT Rotating bcn opr
 SS-0530Z± and 1300Z±-SR. ACTIVATE MALSF Rwy 06; PAPI Rwy
 06 and Rwy 24—CTAF. HIRL Rwy 06-24 and REIL Rwy 24 opr
 1300-0530Z±. Rwy 24 PAPI unusable byd 2.5 NM; does not provide
 obst clnc byd 2.5 NM from thld.

AIRPORT REMARKS: Attended 1300-0530Z±. Arpt CLOSED 0530-1300Z±
 exc for emerg. Rwy 17-35 CLOSED Dec 1-May 1. CLOSED to
 unscheduled operations with more than 30 passenger seats except
 PPR. Call arpt manager 970-641-2304. High terrain all quadrants. Cold temperature rstd arpt. Alt correction required
 at or blo -28C. Migratory bird act Jan 1-Jun 1.

AIRPORT MANAGER: (970) 642-7388

WEATHER DATA SOURCES: AWOS-3PT 135.075 (970) 641-3240.

COMMUNICATIONS: CTAF/UNICOM 122.7


DENVER CENTER APP/DEP CON 124.5

AIRSPACE: CLASS E svc; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE DEN.

BLUE MESA (H) VOR/DME 114.9 HBU Chan 96 N38°27.13' W107°02.38' 032° 7.1 NM to fld. 8740/14E.
 DME portion unusable.

315°-325° byd 27 NM blo 17,500'
 ILS/DME 110.5 I-GUC Chan 42 Rwy 06. Class IE. Glideslope unmonitored. LOC unusable byd 20° left of course.

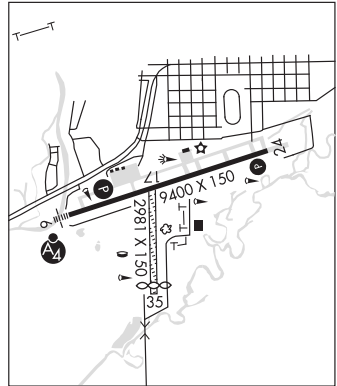

HAXTUN MUNI (17V) 2 SE UTC-7(-6DT) N40°37.47' W102°36.48' CHEYENNE
 4035 NOTAM FILE DEN L-10G

RWY 08-26: H3860X40 (ASPH) LIRL(NSTD)

RWY 08: Road.

RWY 26: Road.

RWY 17-35: 1650X30 (TURF-DIRT) 0.8% up S

RWY 17: Road.

RWY 35: Road.

SERVICE: LGT Rwy 08-26 NSTD LIRL. No thld lgts. Edge lgts begin 250'
 of Rwy 08 end.

AIRPORT REMARKS: Unattended. Rwy 17-35 not maintained, very rough.
 Large animal holes throughout rwy. Gravel road parallels both rwys
 45-55' from centerlines. +20' hangar and 25' wind cone located
 300' east of Rwy 08 thld 75R. Rwy 08 has +3' pole from left edge
 500' from rwy end.

AIRPORT MANAGER: 970-854-2735

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE SNY.

SIDNEY (H) VOR/DME 115.9 SNY Chan 106 N41°05.80'
 W102°58.98' 136° 33.1 NM to fld. 4300/13E. HIWAS.

