

**PLATTEVILLE MUNI** (PVB)(KPVB) 3 SE UTC-6(-5DT) N42°41.36' W90°26.66'  
1025 B NOTAM FILE GRB

CHICAGO  
L-28G  
IAP

**RWY 15-33:** H3999X75 (ASPH) S-30, D-35 MIRL

**RWY 15:** REIL. PAPI(P2L)—GA 3.0° TCH 30'.

**RWY 33:** REIL. PAPI(P2L)—GA 3.0° TCH 25'. Trees.

**RWY 07-25:** H3599X75 (ASPH) S-30, D-35 MIRL 0.6% up NE

**RWY 07:** PAPI(P2L)—GA 3.0° TCH 20'. Tree.

**RWY 25:** PAPI(P2L)—GA 3.0° TCH 28'. Road.

**SERVICE:** S4 FUEL 100LL, JET A OX 1, 2, 3, 4 LGT ACTIVATE REIL  
Rwy 15 and Rwy 33; PAPI Rwy 07 and Rwy 25; MIRL Rwy 07-25  
and Rwy 15-33—CTAF.

**AIRPORT REMARKS:** Attended 1400-2300Z†. 24 hr self svc fuel avbl with  
credit card.

**AIRPORT MANAGER:** 608-348-3582

**WEATHER DATA SOURCES:** AWOS-3 120.575 (608) 348-3637.

**COMMUNICATIONS:** CTAF/UNICOM 122.7

RCO 122.5 (GREEN BAY RADIO)

Ⓡ CHICAGO CENTER APP/DEP CON 133.95

**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Chicago  
ARTCC at 630-906-8921.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE DBQ.


**DUBUQUE (H) VORTACW** 115.8 DBQ Chan 105 N42°24.09'  
W90°42.54' 030° 20.9 NM to fld. 1051/4E.

TACAN AZIMUTH unusable:

170°-265° blo 17,500'

DME unusable:

171°-199°

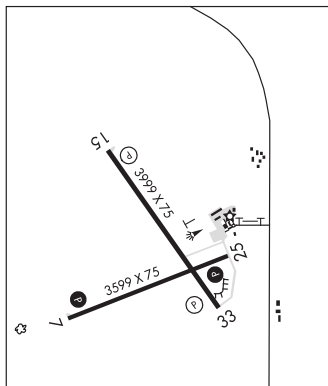

**POBER** N43°52.43' W88°33.46' NOTAM FILE OSH.  
NDB (LOMW) 395 OS 003° 6.6 NM to Wittman Rgnl. 851/3W.

CHICAGO

**PORTAGE MUNI** (C47) 2 NW UTC-6(-5DT) N43°33.62' W89°28.97'  
824 B NOTAM FILE GRB

CHICAGO  
L-28G  
IAP

**RWY 18-36:** H3768X60 (ASPH) MIRL(NSTD) 0.3% up S

**RWY 18:** REIL. PAPI(P2L)—GA 3.75° TCH 40'. Thld dsplcd 92'. Road.

**RWY 36:** Thld dsplcd 260'. Tree.

**RWY 04-22:** H2559X40 (ASPH-AFSC) 0.3% up SW

**RWY 04:** Trees.

**RWY 22:** Trees.

**SERVICE:** FUEL 100LL, UL91 LGT Rwy 18-36 NSTD MIRL. Rwy 18  
first 100' not lgtd; Rwy 36 first 193' not lgtd.

**AIRPORT REMARKS:** Attended Apr-Nov Mon-Fri 1400-2200Z†, Dec-Mar  
Mon-Fri 1500-2100Z†. Fuel avbl 24 hrs with credit card. Rwy 04-22  
CLOSED Nov 15 to Apr 15, rwy not plowed during winter. Deer on &  
invof of arpt. Powerline 110' AGL 1580' from dsplcd thld Rwy 36. Rwy  
36 large hangars and tree 200' west of rwy may cause wind shear with  
strong northwest winds.

**AIRPORT MANAGER:** 608-566-1343

**COMMUNICATIONS:** CTAF/UNICOM 122.7

DELLS RCO 122.1R 117.0T (GREEN BAY RADIO)

Ⓡ MADISON APP/DEP CON 135.45 (1200-0500Z†) other times ctc

Ⓡ CHICAGO CENTER APP/DEP CON 133.3

**CLEARANCE DELIVERY PHONE:** For CD ctc Chicago ARTCC at 630-906-8921.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE DLL.

**DELLS (H) VORTAC** 117.0 DLL Chan 117 N43°33.05' W89°45.82' 084° 12.3 NM to fld. 1023/3E.

VOR unusable:

103°-114° byd 30 NM blo 17,000'

