

APP CRS	Rwy Idg	3850
360°	TDZE	203
	Apt Elev	205


RNAV (GPS) RWY 36

MCCHAREN FIELD (M83)



▼ Use Golden Triangle Rgnl altimeter setting, when not received, use Columbus AFB altimeter setting. DME/DME RNP-0.3 NA. Helicopter visibility reduction below 1 SM NA. Procedure NA at night.

▲NA MISSED APPROACH: Climb to 1000 then climbing left turn to 2500 direct CLOUT and hold.

COLUMBUS APP CON *	CTAF
135.6 323.275	122.9

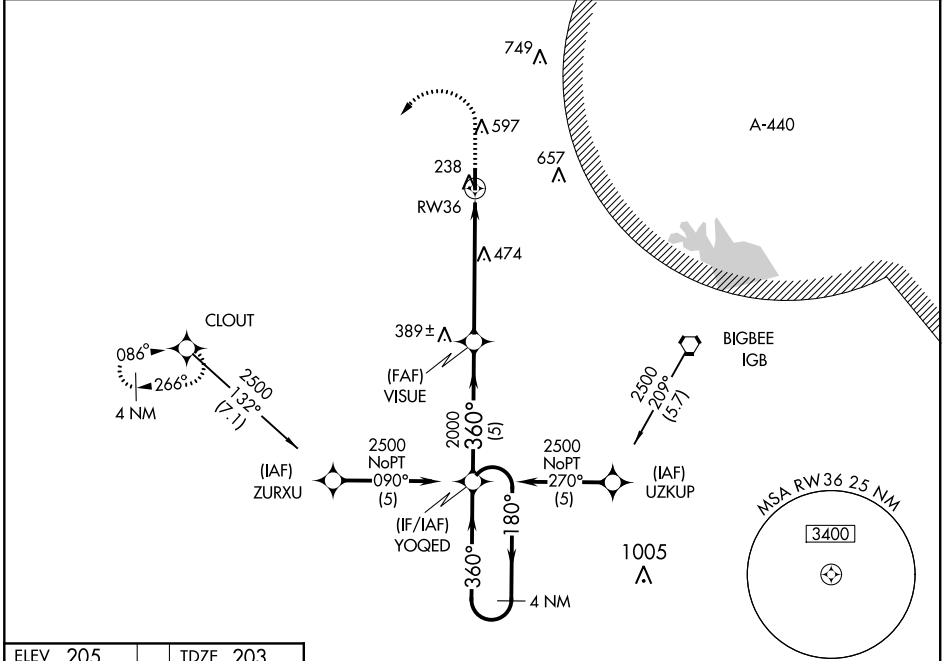

ELEV 205	TDZE 203
----------	----------

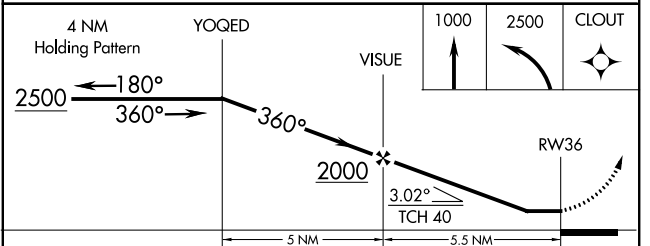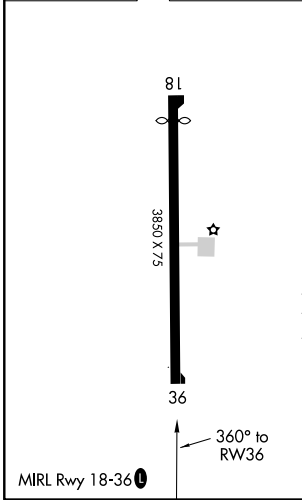

CATEGORY	A	B	C	D
GLS DA		NA		
LNAV/VNAV DA		NA		
LNAV MDA	760-1	557 (600-1)	760-1½ 557 (600-1½)	NA
C CIRCLING	920-1 715 (800-1)	1020-1¼ 815 (900-1¼)	1020-2½ 815 (900-2½)	NA

SC-4, 25 MAR 2021 to 22 APR 2021

SC-4, 25 MAR 2021 to 22 APR 2021