

**LAKEWOOD** (N12) 3 SE UTC-5(-4DT) N40°04.01' W74°10.65'

**NEW YORK**  
L-34H  
IAP

42 B NOTAM FILE MIV

**RWY 06-24:** H2987X60 (ASPH) S-25 MIRL 0.3% up SW

**RWY 06:** REIL. PAPI(P2R)—GA 3.0° TCH 15'. Thld dsplcd 261'. Trees.

**RWY 24:** REIL. PAPI(P2L)—GA 3.0° TCH 42'. Road. Rgt t/c.

**SERVICE:** S4 FUEL 100LL LGT ACTVT PAPI Rwy 06 and Rwy 24; MIRL Rwy 06-24—CTAF.

**AIRPORT REMARKS:** Attended May-Oct 1300-0100Z. Nov-Apr 1300-2300Z. Deer on and in/ovf arpt. Heavy banner towing ops Apr-Oct.

**AIRPORT MANAGER:** 732-363-6400

**WEATHER DATA SOURCES:** AWOS-AV 122.8 (732) 363-6471.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ **MC GUIRE APP/DEP CON** 126.475

GCO 121.725 thru McGuire Apch Control

**CLEARANCE DELIVERY PHONE:** For CD use GCO 121.725, if una ctc Mc Guire Apch at 609-754-2767.


**RADIO AIDS TO NAVIGATION:** NOTAM FILE MIV.

**COYLE (H) VORTACW** 113.4 CYN Chan 81 N39°49.04'

W74°25.90' 048° 19.0 NM to fld. 203/10W.

VOR unusable:

044°-054° blo 3,800'

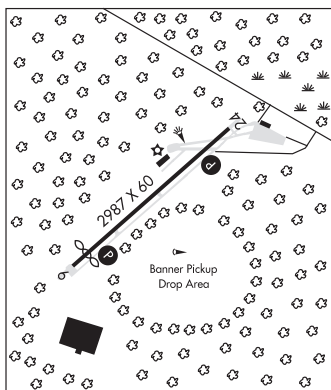

**LINCOLN PARK** (NØ7) 2 N UTC-5(-4DT) N40°56.85' W74°18.87'

**NEW YORK**  
COPTER  
L-33A, 34H  
IAP

182 B NOTAM FILE MIV

**RWY 01-19:** H2942X40 (ASPH) HIRL

**RWY 01:** Thld dsplcd 840'. Trees.

**RWY 19:** PAPI(P2L)—GA 4.0° TCH 30'. Thld dsplcd 260'. Stack.

**SERVICE:** S4 FUEL 100LL, JET A OX 4 LGT ACTIVATE HIRL Rwy 01-19—CTAF.

**AIRPORT REMARKS:** Attended Mon-Fri 1400Z-dusk. Unattended Sat-Sun. Deer and birds in/ovf rwy. Touch and go ldgs prohibited. Narrow taxilanes and twys caused by NSTD clearances. Rwy 19 dsplcd thld lgts located 108' short of dsplcd thld markings.

**AIRPORT MANAGER:** 973-960-4400

**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ **NEW YORK APP/DEP CON** 127.6

GCO 121.725 (MILLVILLE RADIO)

**CLEARANCE DELIVERY PHONE:** For CD ctc New York Apch at 800-645-3206.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE MIV.

**SPARTA (H) VORTACW** 115.7 SAX Chan 104 N41°04.05'

W74°32.30' 136° 12.5 NM to fld. 1400/11W.

VOR unusable:

075°-085° blo 6,500'

155°-165°

