

CONCORD-PADGETT RGNL (JQF)(KJQF) 7 W UTC-5(-4DT) N35°23.27' W80°42.55'

704 B Class I, ARFF Index C NOTAM FILE JQF

CHARLOTTE
H-9B, 12H, L-25D, 36E
IAP, AD**RWY 02-20:** H7402X100 (ASPH-GRVD) D-129 PCN 37 F/C/X/T HIRL 0.9% up N**RWY 02:** REIL. PAPI(P4L)—GA 3.5° TCH 69'. Trees.**RWY 20:** MALSR. TDZL. PAPI(P4L)—GA 3.0° TCH 45'. Thld dsplcd 650'. Trees.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 02:** TORA-7400 TODA-7400 ASDA-7400 LDA-7400**RWY 20:** TORA-7400 TODA-7400 ASDA-7000 LDA-6350**SERVICE:** S4 **FUEL** 100LL, JET A, A1+ **OX 3** **LGT** When twr clsd TDZL Rwy 20, HIRL Rwy 02-20 and REIL Rwy 02 preset low ints. **ACTIVATE** MALSR Rwy 20, REIL Rwy 02, TDZL Rwy 20, HIRL Rwy 02-20—CTAF.**AIRPORT REMARKS:** Attended continuously. Rwy 02-20 grvd full length asph.**AIRPORT MANAGER:** (704) 920-5941**WEATHER DATA SOURCES:** AWOS-3 133.675 (704) 785-2145.**COMMUNICATIONS:** CTAF 134.65 ATIS 133.675 704-785-2145 (1200-0400Z) **UNICOM** 122.95Ⓡ **CHARLOTTE APP/DEP CON** 128.325 **CLNC DEL** 127.25**TOWER** 134.65 (1200-0400Z) **GND CON** 121.85 **CLNC DEL** 118.55**CLEARANCE DELIVERY PHONE:** For CD when ATCT is clsd ctc clt Apch at 704-359-0241.**AIRSPACE:** CLASS D svc 1200-0400Z; other times CLASS G.**RADIO AIDS TO NAVIGATION:** NOTAM FILE CLT.**CHARLOTTE (L) VOR/DME** 115.0 CLT Chan 97 N35°11.42' W80°57.11' 050° 16.8 NM to fld. 732/5W.

DME portion unusable:

015°-050° byd 25 NM blo 3,000'

050°-100° byd 25 NM blo 2,500'

203°-220°

270°-350° byd 20 NM blo 5,000'

VORDME controlled by charlotte ATCT

VOR unusable:

203°-220°

ILS/DME 111.95 I-JQF Chan 56(Y) Rwy 20. Class IE. ILS monitored full-time.**CURRITUCK CO RGNL** (ONX)(KONX) 4 S UTC-5(-4DT) N36°24.00' W76°00.93'

18 B NOTAM FILE ONX

WASHINGTON
H-9C, 12I, L-35D
IAP**RWY 05-23:** H5500X150 (ASPH-CONC) S-35, D-47.5 MIRL**RWY 05:** REIL. PAPI(P4R)—GA 3.0° TCH 43'. P-line.**RWY 23:** REIL. PAPI(P2L)—GA 3.0° TCH 41'. Trees.**SERVICE:** **FUEL** 100LL, JET A1+ **LGT** **ACTIVATE** MIRL Rwy 05-23,

PAPI Rwy 05 and Rwy 23 and REIL Rwy 05 and Rwy 23 after

SS—CTAF. PAPI Rwy 05 and Rwy 23 opr continuously dur dalgt hrs.

AIRPORT REMARKS: Attended 1300-2100Z. Unattended on all state hol.

After hrs svc call 252-232-2216. Currituck Co emerg number com ctr

252-232-2216. Fuel avbl 24 hrs with credit card. Birds and deer on

and invof arpt.

AIRPORT MANAGER: (252) 453-2876**WEATHER DATA SOURCES:** AWOS-3 119.775 (252) 453-8939.**COMMUNICATIONS:** CTAF 122.9Ⓡ **OCEANA APP/DEP CON** 123.9**CLEARANCE DELIVERY PHONE:** For CD ctc Oceana Apch at 757-433-2968.**RADIO AIDS TO NAVIGATION:** NOTAM FILE ECG.**ELIZABETH CITY (L) VOR/DME** 112.5 ECG Chan 72 N36°15.45'

W76°10.54' 049° 11.5 NM to fld. 7/7W.

DME unusable:

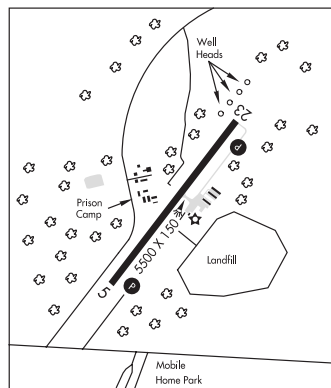
160°-200° byd 10 NM blo 3,000'

160°-200° byd 25 nm. blo 5,000'

290°-330° byd 18 NM blo 3,000'

290°-330° byd 25 NM blo 5,000'

324°-334° byd 28 NM

**CURTIS L BROWN JR FLD** (See ELIZABETHTOWN on page 292)**DARE CO RGNL** (See MANTEO on page 312)**DAVIDSON CO** (See LEXINGTON on page 307)**DERBY AERODROME** (See PINEHURST on page 321)