

LAMAR

SOUTHEAST COLORADO RGNL (LAA)(KLA) 3 SW UTC-7(-6DT) N38°04.18' W102°41.31'

WICHITA
H-5A, L-10G
IAP

3706 B NOTAM FILE LAA MON Airport

RWY 18-36: H6304X100 (CONC-GRVD) S-45, D-55, 2D-100

PCN 12 R/B/W/U MIRL 0.4% up S

RWY 18: REIL. VASI(V4L)—GA 3.0° TCH 45'. Road.

RWY 36: REIL. PAPI(P4L)—GA 3.0° TCH 45'. Hill.

RWY 08-26: H5001X60 (ASPH-PFC) S-35, D-50, 2D-95 MIRL

RWY 08: REIL. PAPI(P2L)—GA 3.0° TCH 30'. Road.

RWY 26: REIL. PAPI(P2L)—GA 3.0° TCH 31'.

SERVICE: S4 FUEL 100LL, JET A OX 1, 3 LGT ACTVT and incr intst
REIL Rwy 08, Rwy 26, Rwy 18 and Rwy 36; PAPI Rwy 08, Rwy 26
and Rwy 36; VASI Rwy 18; MIRL Rwy 08-26 and Rwy 18-36; twy
lghts—CTAF. All lghts preset med intst.

AIRPORT REMARKS: Attended 1500-0100Z†. For svc after hrs phone
719-336-7701. Be alert, intensive USAF student training invof
Colorado Springs and Pueblo Colorado. Twr 500' AGL 4.5 mile SE
unlighted. NOTE: See Special Notices—Aerobatic Operations in
Colorado. USAF 306 FTG Flight Training Areas, Vicinity of Colorado
Springs and Pueblo Colorado.

AIRPORT MANAGER: 719-336-2002

WEATHER DATA SOURCES: ASOS 135.625 (719) 336-3854.


COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ DENVER CENTER APP/DEP CON 133.4

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAA.

LAMAR (H) VOR/DME 116.9 LAA Chan 116 N38°11.83' W102°41.25' 168° 7.6 NM to fld. 3944/12E.

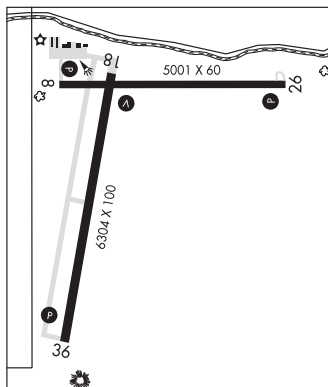

LAS ANIMAS

CITY OF LAS ANIMAS — BENT CO (7V9) 1 S UTC-7(-6DT) N38°03.24' W103°14.31'

WICHITA
L-10F

3915 NOTAM FILE DEN

RWY 08-26: H3870X40 (ASPH) S-5 HIRL 0.4% up W

RWY 08: REIL. Tree.

RWY 26: REIL. Road.

SERVICE: LGT ACTIVATE HIRL Rwy 08-26—CTAF. Med ints 5 clicks, high ints 7 clicks.

AIRPORT REMARKS: Unattended. Be alert, intensive USAF student training invof Colorado Springs and Pueblo Colorado. Rwy
26 has +30' poles 105' from thld 210' left of extd rwy centerline. Rwy 08-26 has trees growing 50+ ft fm either side
of rwy cntrln. Thld lghts NSTD; three lghts each end. Thld lghts OTS indef. Rwy 08 thld lghts 23' from thld. Rwy 26 thld lghts
12' from thld. Rwy 08 has +4' fence 275' from thld obstruction, has -3' ditch 35' from rwy end on both sides. Rwy
08-26 numbers smaller than standard. See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado
Springs and Pueblo Colorado.

AIRPORT MANAGER: (719) 469-5252

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAA.

LAMAR (H) VOR/DME 116.9 LAA Chan 116 N38°11.83' W102°41.25' 240° 27.5 NM to fld. 3944/12E.

LEACH (See CENTER on page 264)