

VORTAC RIC 114.1 Chan 88	APP CRS 323°	Rwy Idg 9003 TDZE 161 Apt Elev 167
--	------------------------	---

VOR RWY 34



RICHMOND INTL (RIC)

DME or RADAR required. RADAR required for procedure entry.

ALSF-2

MISSED APPROACH: Climbing right turn to 2000 via RIC R-018 to EPICS INT and hold.

ATIS 119.15 263.025	POTOMAC APP CON 126.4 282.375 (001°-185°) 126.75 307.2 (186°-360°)	RICHMOND TOWER 121.1 257.8	GND CON 121.9 348.6	CLNC DEL 127.55 348.6
-------------------------------	--	--------------------------------------	-------------------------------	---------------------------------

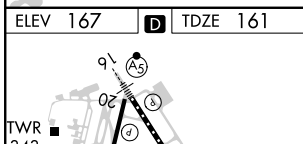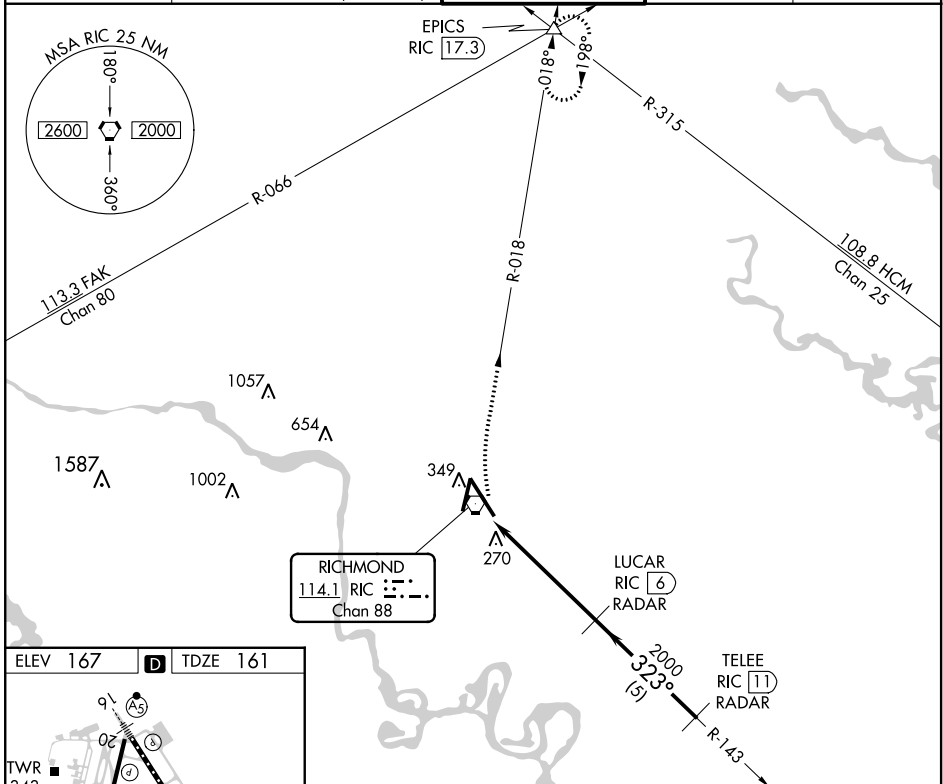

ELEV 167	D	TDZE 161			
TDZ/CL Rwy 34 HIRL Rwys 2-20 and 16-34 REIL Rwy 20					
FAF to MAP 5.3 NM					
Knots	60	90	120	150	180
Min:Sec	5:18	3:32	2:39	2:07	1:46

2000 RIC R-018	EPICS △	VGSI and descent angles not coincident (VGSI Angle 3/00/TCH 79).		LUCAR RIC 6 RADAR	TELEE RIC 11 RADAR
RIC VORTAC RIC 0.8	RIC 1.7	RIC 1.7	323°	2000	323°
TCH 55		≤ 3.19°		2000	
1 NM		4.3 NM		5 NM	
CATEGORY	A	B	C	D	
S-34	540/24	379 (400-½)	540/40	540/50	
			379 (400-¾)	379 (400-1)	
<input checked="" type="checkbox"/> CIRCLING	660-1	493 (500-1)	700-1½	720-2	
			533 (600-1½)	553 (600-2)	

NE-3, 15 JUL 2021 to 12 AUG 2021

NE-3, 15 JUL 2021 to 12 AUG 2021