

STERLING/ROCKFALLS

WHITESIDE CO/JOS H BITTORF FLD (SQI)(KSQI) 2 S UTC-6(-5DT) N41°44.57' W89°40.58'

CHICAGO
H-5D, L-28G
IAP

648 B NOTAM FILE SQI

RWY 07-25: H6499X150 (ASPH-PFC) S-50, D-60, 2D-90 HIRL

RWY 07: REIL. P4P(P4L)—GA 3.0° TCH 49'.

RWY 25: MALSR.

RWY 18-36: H3900X100 (ASPH-GRVD) S-18 MIRL

RWY 18: REIL.

RWY 36: REIL.

SERVICE: S4 FUEL 100LL, JET A LGT MIRL Rwy 18-36 preset on low ints; to increase ints and ACTIVATE HIRL Rwy 07-25; MALSR Rwy 25; REIL Rws 07, 18 and 36—CTAF.

AIRPORT REMARKS: Attended 1400-2300Z†. Unattended New Years; Christmas; and Thanksgiving. 100LL fuel dispenser is self service with credit card. Terminal bldg can be accessed after hrs by cipher lock which has applicable instructions. Rwy 07 preferred calm wind rwy. OX svc unavbl.

AIRPORT MANAGER: (815) 213-7939

WEATHER DATA SOURCES: AWOS-3PT 119.175 (815) 626-2704.

COMMUNICATIONS: CTAF/UNICOM 123.0

Ⓡ **ROCKFORD APP/DEP CON** 126.0


CLNC DEL 128.0

CLEARANCE DELIVERY PHONE: For CD ctc Chicago ARTCC at 630-906-8921.

RADIO AIDS TO NAVIGATION: NOTAM FILE IKK.

POLO (L) VORW/DME 111.2 PLL Chan 49 N41°57.94' W89°31.45' 204° 15.0 NM to fld. 840/3E.

ILS/DME 111.5 I-SQI Chan 52 Rwy 25. Class IE. Localizer backcourse unusable byd 15 NM. Unmonitored. DME backcourse unusable byd 10 NM.

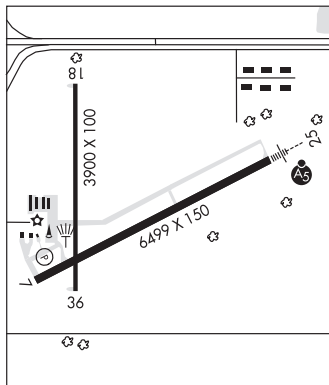

TAYLORVILLE MUNI (TAZ)(KTAZ) 2 SW UTC-6(-5DT) N39°31.96' W89°19.84'

ST LOUIS
L-27C
IAP

622 B TPA—See Remarks NOTAM FILE TAZ

RWY 18-36: H4001X75 (ASPH-PFC) MIRL

RWY 18: REIL. PVASI(PSIL)—GA 3.0° TCH 39'.

RWY 36: PVASI(PSIL)—GA 3.0° TCH 34'.

RWY 09R-27L: H3501X60 (ASPH) MIRL

RWY 09R: REIL. PVASI(PSIL)—GA 3.0° TCH 26'. Rgt tfc.

RWY 27L: REIL. PVASI(PSIL)—GA 4.0° TCH 34'.

RWY 09L-27R: 1933X165 (TURF)

RWY 27R: Thld dspcd 286'. Road. Rgt tfc.

SERVICE: S4 FUEL 100LL, JET A LGT ACTIVATE REIL Rwy 09R, Rwy 18, Rwy 27L; PVASI Rwy 09R, Rwy 18, Rwy 27L, Rwy 36; MIRL Rwy 09R-27L—CTAF. MIRL Rwy 18-36 preset low ints; to incr ints—CTAF. Rwy 09R PVASI unusbl byd 8° rgt of cntrln. Rwy 18 PVASI unusbl byd 6° left/rgt of cntrln, opr only when rwy lgts are activated by CTAF. Rwy 27L PVASI unusbl 6° rgt and 8° left of cntrln. Rwy 36 PVASI unusbl byd 5° left/rgt of cntrln.

AIRPORT REMARKS: Attended Mon-Fri 1500-2300Z†. Self svc fuel lctd on N ramp avbl 24 hrs with credit card. Parachute Jumping. TPA—Rwy 09L-27R 1222 (600), Rwy 09R-27L and Rwy 18-36 1422 (800). Rwy 09L marked with white rocks. 172' lgtd water twr located 3007' from Rwy 27L end and 488' L.

AIRPORT MANAGER: 217-824-9313

WEATHER DATA SOURCES: AWOS-3 123.875 (217) 824-9323.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **SPRINGFIELD APP/DEP CON** 126.15 (1200-0400Z†)

KANSAS CITY CENTER APP/DEP CON 124.3 (0400-1200Z†)

CLEARANCE DELIVERY PHONE: For CD ctc Springfield Apch at 217-535-1425. when Springfield Apch is clsd, ctc Kansas City ARTCC at 913-254-8508.

RADIO AIDS TO NAVIGATION: NOTAM FILE SPI.


SPINNER (H) VORTAC 112.7 SPI Chan 74 N39°50.38' W89°40.66' 140° 24.4 NM to fld. 586/1W.

TACAN AZIMUTH unusable:

025°-045° byd 15 NM blo 3,000'

190°-244° byd 15 NM blo 4,000'

245°-300° byd 10 NM

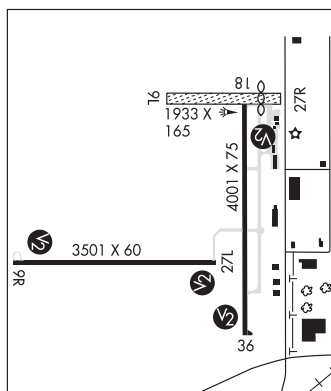

TINLEY PARK HELISTOP HELIPORT (See CHICAGO/TINLEY PARK on page 50)