

THERMOPOLIS

HOT SPRINGS CO (HSG)(KHSG) 10 NW UTC-7(-6EDT) N43°42.82' W108°23.38'

CHEYENNE
H-3E, L-11E
IAP

4892 B NOTAM FILE CPR

RWY 05-23: H6370X75 (ASPH) S-30, D-45 PCN 29 F/A/X/T MIRL
0.3% up NE

RWY 05: REIL. PAPI(P2L)—GA 2.75° TCH 39'. Rgt tfc.

RWY 23: REIL. PAPI(P2L)—GA 2.75° TCH 39'.

SERVICE: FUEL 100LL, JET A LGT ACTIVATE REIL Rwy 5 and Rwy 23, PAPI Rwy 05 and Rwy 23; MIRL Rwy 05-23—CTAF. PAPI Rwy 05 and Rwy 23 on continuously daylight hrs.

AIRPORT REMARKS: Attended 1400-2300Z† Mon-Fri. For svc after hrs phone 307-921-8579. Fuel avbl with self-serve credit card. Full svc avbl upon req. No call out fee for svc after hrs. Birds and wildlife on and invof arpt. Cold temperature restricted airport. Altitude correction required at or below -36C.

AIRPORT MANAGER: (307) 867-2027

WEATHER DATA SOURCES: AWOS-3PT 121.125 (307) 867-2033.

COMMUNICATIONS: CTAF/UNICOM 122.8


Ⓡ SALT LAKE CENTER APP/DEP CON 133.25

CLEARANCE DELIVERY PHONE: For CD ctc Salt Lake ARTCC at 801-320-2568.

RADIO AIDS TO NAVIGATION: NOTAM FILE CPR.

BOYSEN RESERVOIR (H) VORW/DME 117.8 BOY Chan 125

N43°27.79' W108°17.98' 329° 15.5 NM to fld. 7550/16E.

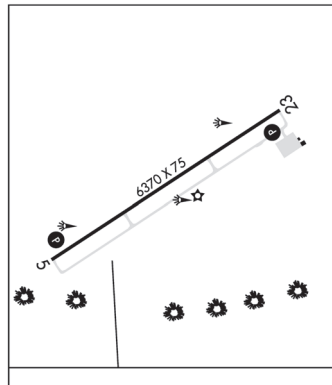

THOMAS MEML (See GLENDO on page 244)

TORRINGTON MUNI (TOR)(KTOR) 2 E UTC-7(-6EDT) N42°03.87' W104°09.16'

CHEYENNE
H-5A, L-12F
IAP

4207 B NOTAM FILE TOR

RWY 10-28: H5703X75 (ASPH) S-33, D-45 PCN 9 F/B/X/T MIRL

RWY 10: PAPI(P2L)—GA 3.0° TCH 40'.

RWY 28: REIL. PAPI(P2L)—GA 3.0° TCH 40'. Hill.

RWY 02-20: H3001X60 (ASPH)

RWY 02: Rgt tfc.

SERVICE: FUEL 100LL, JET A LGT ACTV† REIL Rwy 28; PAPI Rwy 10 and Rwy 28; MIRL Rwy 10-28—CTAF.

AIRPORT REMARKS: Attended 1500-0000Z†, exc natl hol. 100LL: For fuel aft hrs call 307-338-8835. Deer and waterfowl on and invof arpt.

AIRPORT MANAGER: 307-532-8551

WEATHER DATA SOURCES: ASOS 118.375 (307) 532-8958.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ DENVER CENTER APP/DEP CON 127.95

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE BFF.

SCOTTSBLUFF (H) VORTAC 112.6 BFF Chan 73 N41°53.65'


W103°28.92' 276° 31.7 NM to fld. 4169/13E.

TACAN AZIMUTH & DME unusable:

025°-060° 25 NM blo 6,300'

310°-025° 25 NM blo 6,500'

NDB (MHW) 293 TOR N42°03.95' W104°09.20' at fld. 4200/11E. NOTAM FILE TOR.

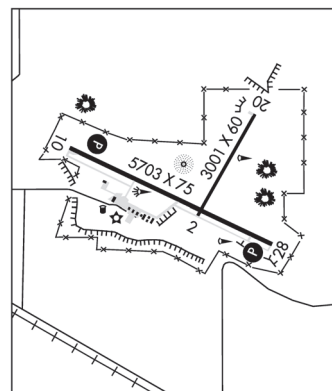

UPTON MUNI (83V) 1 SW UTC-7(-6EDT) N44°05.43' W104°38.45'

CHEYENNE

4290 B NOTAM FILE CPR

RWY 13-31: 3710X80 (GRVL-DIRT) MIRL

RWY 13: SAVASI(S2L)—GA 3.0° TCH 25'.

RWY 31: SAVASI(S2L)—GA 3.0° TCH 25'. Fence.

AIRPORT REMARKS: Unattended. For arpt attendant call 307-746-8411. Wildlife on and invof arpt. Radio ctdid airplane activity within rwy environment. Ctc arpt mgr for rwy cond prior to winter ops phone 307-746-8411. No regular snow removal. Hangars within transitional sc. Rwy 13-31 marginal line of sight from rwy ends. +3' berms along rwy edges.

Non-working +3' lgts on non-frangible bases at rwy edges OTS indef. All arpt lggt OTS indef. Rwy 13 and Rwy 31 VASI OTS indef.

AIRPORT MANAGER: (307) 746-8411

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.