

**BOZEMAN YELLOWSTONE INTL** (BZN)(KBZN) 7 NW UTC-7(-6DT) N45°46.63' W111°09.02'  
 4473 B TPA—See Remarks AOE Class I, ARFF Index C NOTAM FILE BZN MON Airport

**GREAT FALLS**  
 H-1E, L-13C  
 IAP, AD


**RWY 12-30:** H8994X150 (ASPH-GRVD) S-120, D-250, 2D-550,  
 2D/2D2-1120 PCN 123F/A/X/T HIRL  
**RWY 12:** MALSR. PAPI(P4L)—GA 3.0° TCH 53'. 0.5% up.  
**RWY 30:** REIL. PAPI(P4L)—GA 3.0° TCH 45'. 0.3% down.  
**RWY 11-29:** H5050X75 (ASPH-GRVD) S-12.5 PCN 61 F/A/X/U  
 MIRL 0.4% up E  
**RWY 11:** PAPI(P4L)—GA 3.0° TCH 42'.  
**RWY 29:** PAPI(P4L)—GA 3.0° TCH 47'.  
**RWY 11G-29G:** 2802X80 (TURF) 0.3% up E  
**RWY 03-21:** H2650X75 (ASPH-GRVD) S-12.5 PCN 90 F/A/X/T  
 0.7% up SW

**LAND AND HOLD—SHORT OPERATIONS**

LDG RWY	HOLD—SHORT POINT	AVBL LDG DIST
RWY 12	03-21	6841

**RUNWAY DECLARED DISTANCE INFORMATION**

<b>RWY 03:</b> TORA-2650 TODA-2650 ASDA-2650 LDA-2650
<b>RWY 11:</b> TORA-5050 TODA-5050 ASDA-5050 LDA-5050
<b>RWY 12:</b> TORA-8994 TODA-8994 ASDA-8994 LDA-8994
<b>RWY 21:</b> TORA-2650 TODA-2650 ASDA-2650 LDA-2650
<b>RWY 29:</b> TORA-5050 TODA-5050 ASDA-5050 LDA-5050
<b>RWY 30:</b> TORA-8994 TODA-8994 ASDA-8994 LDA-8994

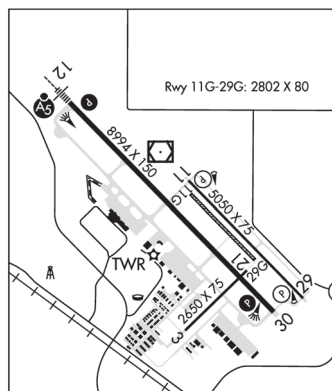

**SERVICE:** S4 FUEL 100, 100LL, JET A OX 1, 2, 3, 4 LGT When twr clsd ACTIVATE MALSR Rwy 12; PAPI Rwy 12 and Rwy 30; HIRL Rwy 12-30; MIRL Rwy 11-29—CTAF. At all times ACTIVATE REIL Rwy 30—CTAF.

**AIRPORT REMARKS:** Attended 1300-0700Z±. Migratory birds in/ovf arpt. Glider ops on and in/ovf arpt. Parachute Jumping. HVY student TRNG ACTVTY WI 15 MIS of AP. Rwy 12 is normally used for arrivals/departures when the wind speed is less than 10 knots. If aircraft is unable to use Rwy 12, other rwys may be used but delays may occur. Ldg area 11G-29G turf located 240' south of Rwy 11-29. Avbl when dry with ATC apvl. Marked with white cones. Rwy 21 btn Rwy 12-30 and Twy A avbl for acft greater than 12,500 lbs day/VFR only. Snow removal eqpt monitors CTAF. Txf Rwy 03 prohibited until after confirming no tfc using Rwy 12. TPA—Single Engine acft 5302(829), Multi Engine/Turbojet acft 5802(1329). Cold temperature airport. Altitude correction required at or below -31C. U.S. Customs avbl 1600-2400Z± Thu-Mon. Ldg fee for acft over 12,500 lbs.

**AIRPORT MANAGER:** 406-388-6632

**WEATHER DATA SOURCES:** ASOS (406) 388-4882

**COMMUNICATIONS:** CTAF 118.2 ATIS 135.425 (406-388-4767) UNICOM 122.95

RCO 122.5 (GREAT FALLS RADIO)

Ⓡ BIG SKY APP/DEP CON 118.975 (1200-0615Z±)

Ⓡ SALT LAKE CENTER APP/DEP CON 118.975 (0615-1200Z±)

TOWER 118.2 (1200-0800Z±) GND CON 121.8

**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Salt Lake ARTCC at 801-320-2568.

**AIRSPACE:** CLASS D svc 1200-0800Z± other times CLASS E..

**RADIO AIDS TO NAVIGATION:** NOTAM FILE BZN.

(H) VOR/DME 112.4 BZN Chan 71 N45°47.03' W111°09.33' at fld. 4436/18E.

VOR portion unusable:  
 360°-105° byd 20 NM

DME portion unusable:  
 350°-105° byd 20 NM

**MANNI NDB (MHW/LOM)** 266 BZ N45°52.32' W111°17.14' 122° 8.0 NM to fld. 4218/13E.

NDB unusable:  
 340°-110° byd 15 NM

ILS 109.3 I-BZN Rwy 12. Class IB. LOM MANNI NDB.