

ESTANCIA MUNI (E92) 1 E UTC-7(-6DT) N34°45.80' W106°02.48'

ALBUQUERQUE

6100 NOTAM FILE ABQ

RWY 08-26: 4000X50 (GRVL)

RWY 08: Pole.

RWY 26: Brush.

SERVICE: LGT Rwy 08 markings NSTD, thld and edge marked with reflective material. Several reflectors missing and reflective material in poor cond. Rwy 26 markings NSTD, thld and edge marked with reflective material. Several reflectors missing and reflective material in poor cond.

AIRPORT REMARKS: Unattended. Cattle and birds on and invof rwy. Rwy 08-26 soft when wet. Rwy 08 +12' tree 134' from thld, 78' rgt of cntrln. Rwy 26 +3-5' brush 0-200' from thld, 125' left and rgt of cntrln. Rwy 08-26 scattered brush in primary surface, +2-3 ft high, 30-40 ft fm cntrln both sides.

AIRPORT MANAGER: 505-384-2708

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.

FARMINGTON**FOUR CORNERS RGNL** (FMN)(KFMN) 1 NW UTC-7(-6DT) N36°44.48' W108°13.80'

DENVER

5507 B Class III, ARFF Index A NOTAM FILE FMN MON Airport

H-4K, L-8H

RWY 07-25: H6704X100 (ASPH-PFC) S-50, D-90, 2S-114

IAP, AD

PCN 29 F/C/X/T MIRL 0.4% up E

RWY 07: VASI(V4L)—GA 3.0° TCH 50'. Thld dspcd 239'.

RWY 25: REIL. VASI(V4L)—GA 3.0° TCH 55'. Thld dspcd 217'.

RWY 05-23: H6501X150 (ASPH-PFC) S-47, D-66, 2S-84

PCN 29 F/C/X/T MIRL 0.5% up NE

RWY 05: VASI(V4R)—GA 3.0° TCH 61'.

RWY 23: REIL. PAPI(P4R)—GA 3.0° TCH 42'. Thld dspcd 511'.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 05: TORA-6500 TODA-6500 ASDA-5590 LDA-5590

RWY 07: TORA-6704 TODA-6704 ASDA-6487 LDA-6248

RWY 23: TORA-6500 TODA-6500 ASDA-6100 LDA-5590

RWY 25: TORA-6704 TODA-6704 ASDA-6465 LDA-6248

SERVICE: S4 FUEL 100LL, JET A, A1+ OX 2, 4 LGT When twr clsd MIRL Rwy 07-25 and REIL Rwy 25 preset low ints, to increase ints and ACTIVATE MIRL Rwy 05-23 and REIL Rwy 23 and Rwy 25—CTAF.

AIRPORT REMARKS: Attended 1300-0500Z‡.

AIRPORT MANAGER: 505-599-1394

WEATHER DATA SOURCES: ASOS 127.15 (505) 325-9268. LAWRS SAWRS.

COMMUNICATIONS: CTAF 118.9 ATIS 127.15 UNICOM 122.95

FARMINGTON RCO 122.4 (ALBUQUERQUE RADIO)

Ⓡ DENVER CENTER APP/DEP CON 118.575

FARMINGTON TOWER 118.9 (1300-0500Z‡) GND CON 121.7

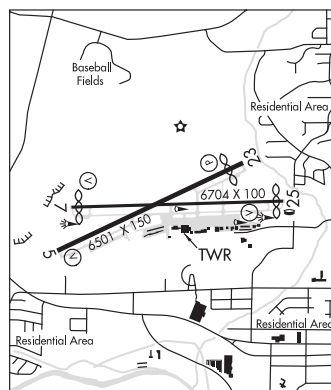
CLEARANCE DELIVERY PHONE: For CD ctc farmington ATCT ground control 121.7, when ATCT clsd ctc Denver ARTCC at 303-651-4257

AIRSPACE: CLASS D svc 1300-0500Z‡; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE FMN.

RATTLESNAKE (H) VORTACW 115.3 RSK Chan 100 N36°44.90' W108°05.93' 252° 6.3 NM to fld. 5821/14E.

ILS/DME 111.9 I-FMN Chan 56 Rwy 25. Class IE. Unmonitored when ATCT clsd.

**FORT SUMNER MUNI** (FSU)(KFSU) 2 NE UTC-7(-6DT) N34°29.33' W104°12.99'

ALBUQUERQUE

4165 B NOTAM FILE ABQ

H-6F, L-6G

RWY 03-21: H5800X75 (ASPH) S-25 PCN 3 F/C/Y/T MIRL 0.7% up NE

RWY 03: Tree.

RWY 21: PVASI(PSIL). Brush.

RWY 08-26: H5250X60 (ASPH) S-17 PCN 3 F/D/Y/T MIRL

RWY 08: Road.

RWY 26: PVASI(PSIL). Brush.

SERVICE: LGT ACTIVATE MIRL Rwy 08-26—CTAF. MIRL Rwy 03-21 preset low ints till 0500Z‡. After 0500Z‡ ACTIVATE—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1400-2300Z‡. For attendant after hrs call (575) 355-2405. Gate code is 2019.

AIRPORT MANAGER: 575-799-7654

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.

RADIO AIDS TO NAVIGATION: NOTAM FILE TCC.

TUCUMCARI (H) VORTACW 113.6 TCC Chan 83 N35°10.93' W103°35.91' 204° 51.5 NM to fld. 4035/12E.