

WAAS CH 45813 W35E	APP CRS 005°	Rwy ldg 10000 TDZE 88 Apt Elev 96
--	------------------------	--

RNAV (GPS) RWY 35L




ORLANDO INTL (MCO)

▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -1°C (31°F) or above 54°C (130°F). DME/DME RNP-0.3 NA. Bright lights on highway midway between Rwy 35L and Rwy 35R may be mistaken for runway lights. Simultaneous approach authorized with Rwy 35R, Rwy 36L, or Rwy 35R and Rwy 36R. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations. For inop ALSF-2, increase LNAV/VNAV all Cats visibility to RVR 5100 and LNAV Cat C/D visibility to RVR 6000.

ALSF-2



MISSED APPROACH: Climb to 4000 direct SACRO and hold.

D-ATIS ARR 121.25 DEP 120.525	ORLANDO APP CON 124.8 307.0	ORLANDO TOWER 118.45 253.5 (Rwys 17L-35R, 17R-35L) 124.3 253.5 (Rwys 18L-36R, 18R-36L)	GND CON 126.4 (East) 121.8 (West)	CLNC DEL 134.7 341.7	CPDLC
---	---------------------------------------	--	---	--	-------

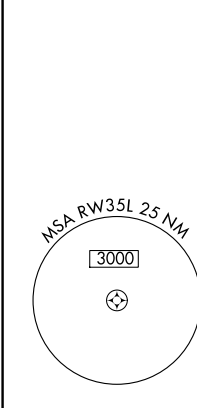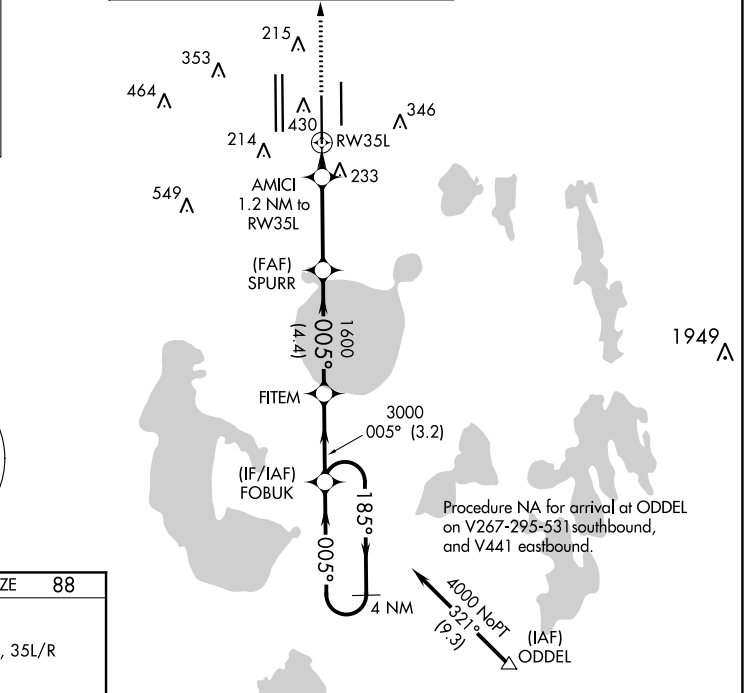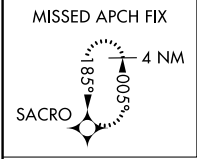

ELEV 96	D	TDZE 88
---------	----------	---------

HIRL all Rwys
REIL Rwy 36L
TDZ/CL Rwys 17L/R, 18R, 35L/R and 36R

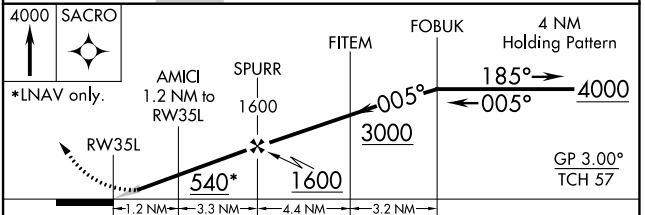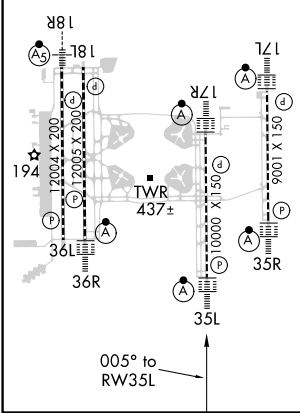

CATEGORY	A	B	C	D
LPV DA		288/18	200 (200-½)	
LNAV/VNAV DA		407/27	319 (400-¾)	
LNAV MDA	500/24	412 (500-½)	500/40	412 (500-¾)
C CIRCLING	740-1	644 (700-1)	740-1¾ 644 (700-1¾)	740-2 644 (700-2)

SE-3, 09 SEP 2021 to 07 OCT 2021

SE-3, 09 SEP 2021 to 07 OCT 2021