
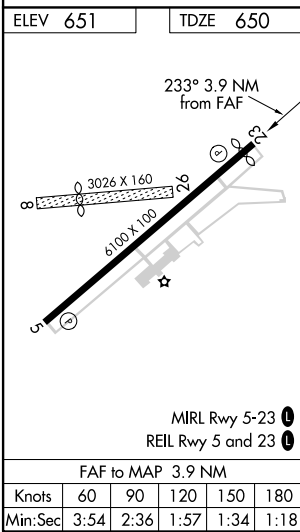


LOC I-MWO	APP CRS	Rwy Idg	5801
111.1	233°	TDZE	650
		Apt Elev	651

LOC RWY 23

MIDDLETOWN RGNL/HOOK FLD (MWO)

ADF required.		<p>MISSED APPROACH: Climb to 2600 then climbing left turn to 3000 direct MW LOM and hold.</p>
<p>▼ Circling Rwy 5 NA at night. Circling NA to Rwys 8 and 26. Rwy 23 helicopter visibility reduction below ¼ SM NA. When local altimeter setting not received, use Dayton-Wright Brothers altimeter setting and increase all MDAs 80 feet and S-23 Cat C/D visibility ¼ SM.</p>		
AWOS-3	COLUMBUS APP CON	UNICOM
120.025	118.85 269.275	123.0 (CTAF)

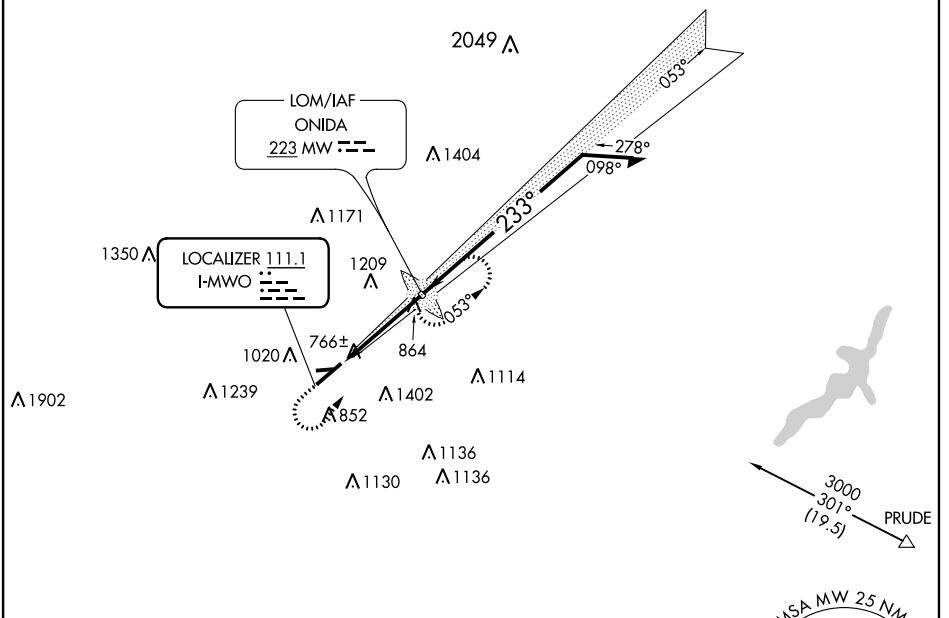

ELEV 651	TDZE 650					
		2600 ↑	3000 ↙	MW 	MW LOM ↓	Remain within 10 NM ↓
VGSIs and descent angles not coincident (VGSIs Angle 2.50/TCH 20). 						
CATEGORY	A	B	C	D		
S-23	1140-1	490 (500-1)	1140-1⅜ 490 (500-1⅜)	1140-1½ 490 (500-1½)		
CIRCLING	1480-1¼	829 (900-1¼)	1720-3 1069 (1100-3)	1940-3 1289 (1300-3)		

LOC RWY 23

EC-2, 09 SEP 2021 to 07 OCT 2021

EC-2, 09 SEP 2021 to 07 OCT 2021