



MARY ESTHER, FLORIDA

ILS or LOC RWY 36


LOC I-HRT 111.3	APCH CRS 358°	Rwy Ldg TDZE Arprt Elev 9600 37 38	AL-734 [USAF]	HURLBURT FLD (KHRT)
---------------------------	-------------------------	--	---------------	---------------------

DME or RADAR required for S-LOC 36.	ALSIF-1 	MISSED APPROACH: Climb to 1800 on HRT TACAN R-360 to ORTIZ/11 DME and hold.
-------------------------------------	-------------	---

ATIS 134.475 360.675	EGLIN APP CON 125.1 281.45 (271°-089°) 132.1 360.6 (090°-270°)	HURLBURT TOWER 126.5 351.675	GND CON 123.975 275.8
--------------------------------	--	--	---------------------------------

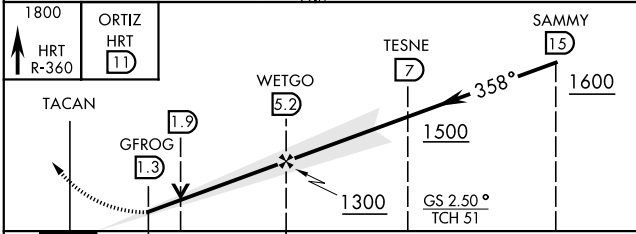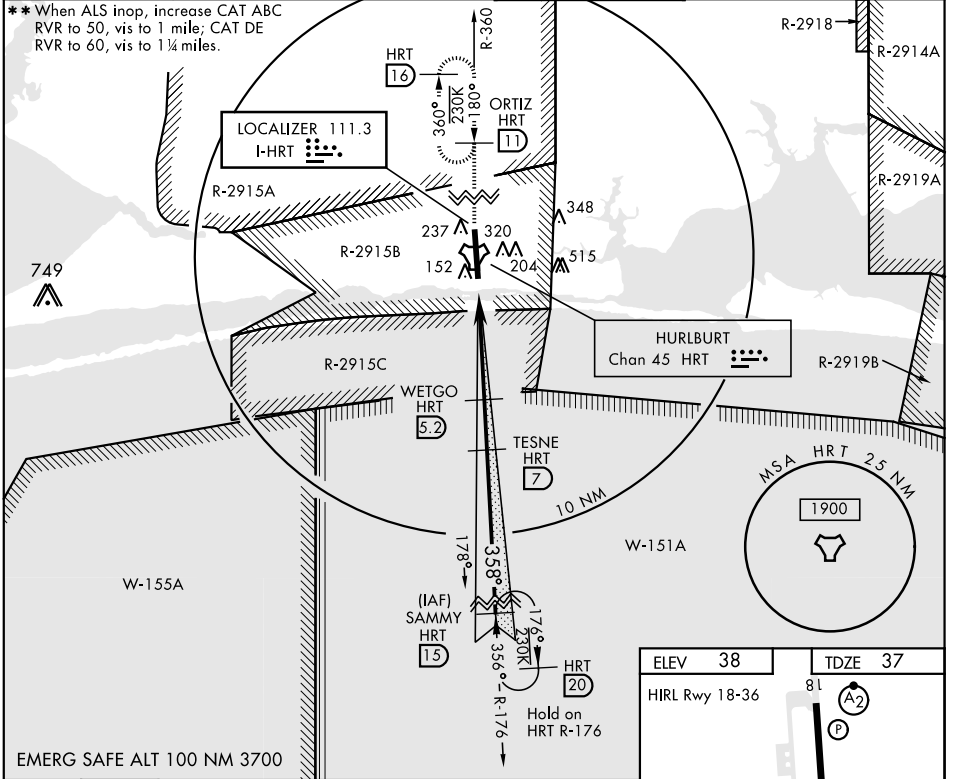

CATEGORY	A	B	C	D	E
S-ILS 36*	237/24		200	(200-1/2)	
S-LOC 36**	360/24	323 (400-1/2)	360/40		323 (400-3/4)
CIRCLING	640-1	602 (700-1)	640-1 3/4 602 (700-1 3/4)	640-2 602 (700-2)	880-3 842 (900-3)

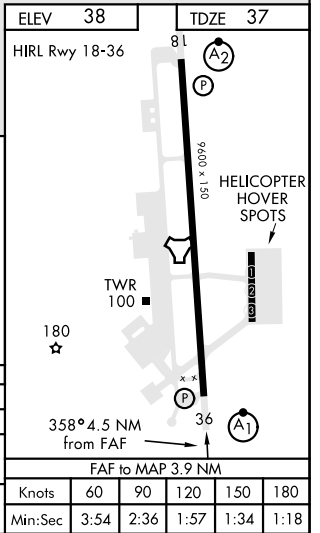

MARY ESTHER, FLORIDA 30°26'N-86°41'W HURLBURT FLD (KHRT)

Amdt 2 05APR07

ILS or LOC RWY 36

SE-3, 09 SEP 2021 to 07 OCT 2021

SE-3, 09 SEP 2021 to 07 OCT 2021