

APP CRS	Rwy Idg	<b>3850</b>
<b>360°</b>	TDZE	<b>203</b>
	Apt Elev	<b>205</b>


# RNAV (GPS) RWY 36

MCCHAREN FIELD (M83)



**▽** Use Golden Triangle Rgnl altimeter setting, when not received, use Columbus AFB altimeter setting. DME/DME RNP-0.3 NA. Helicopter visibility reduction below 1 SM NA. Procedure NA at night.

**△NA** MISSED APPROACH: Climb to 1000 then climbing left turn to 2500 direct CLOUT and hold.

COLUMBUS APP CON *	CTAF
<b>135.6 323.275</b>	<b>122.9</b>

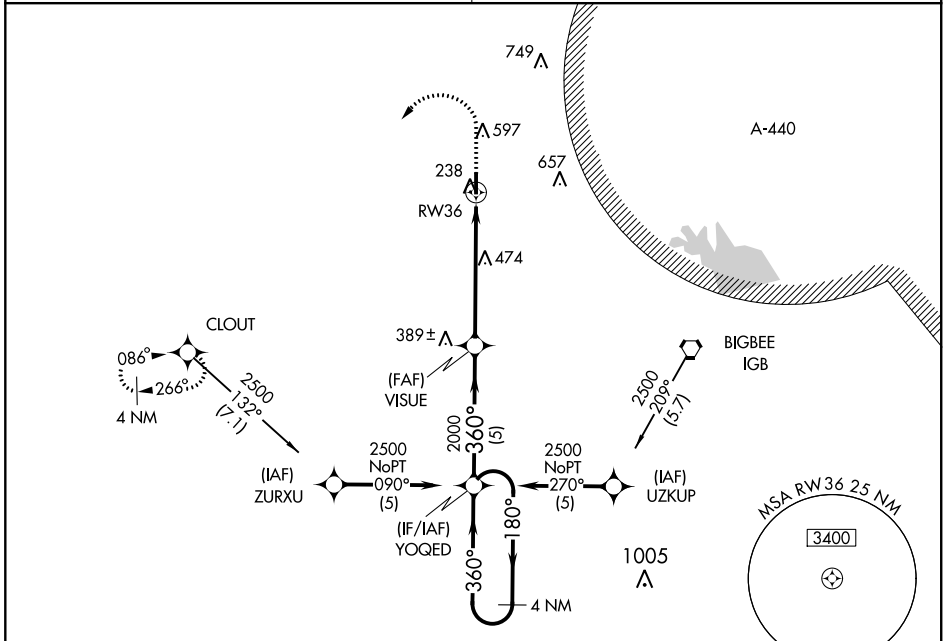

ELEV 205	TDZE 203
----------	----------

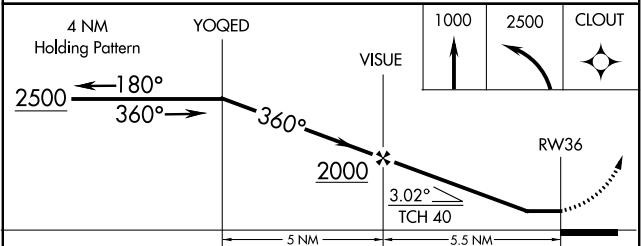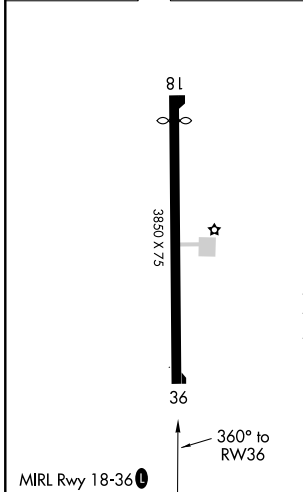

CATEGORY	A	B	C	D
GLS DA		NA		
LNAV/VNAV DA		NA		
LNAV MDA	760-1	557 (600-1)	760-1½ 557 (600-1½)	NA
<b>C</b> CIRCLING	920-1 715 (800-1)	1020-1¼ 815 (900-1¼)	1020-2½ 815 (900-2½)	NA

SC-4, 09 SEP 2021 to 07 OCT 2021

SC-4, 09 SEP 2021 to 07 OCT 2021