


WAAS CH 78022 W05B	APP CRS 050°	Rwy Idg 11004 TDZE 744 Apt Elev 744
--	------------------------	--

RNAV (GPS) RWY 5L


RICKENBACKER INTL (LCK)

RNP APCH.	MALSRL 	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct XUB VOR and hold.
-----------	------------	---

ATIS 132.75	COLUMBUS APP CON 134.0 279.6	RICK TOWER 120.05 348.4	GND CON 125.275 275.8	CLNC DEL 125.275 275.8
-----------------------	--	-----------------------------------	---------------------------------	----------------------------------

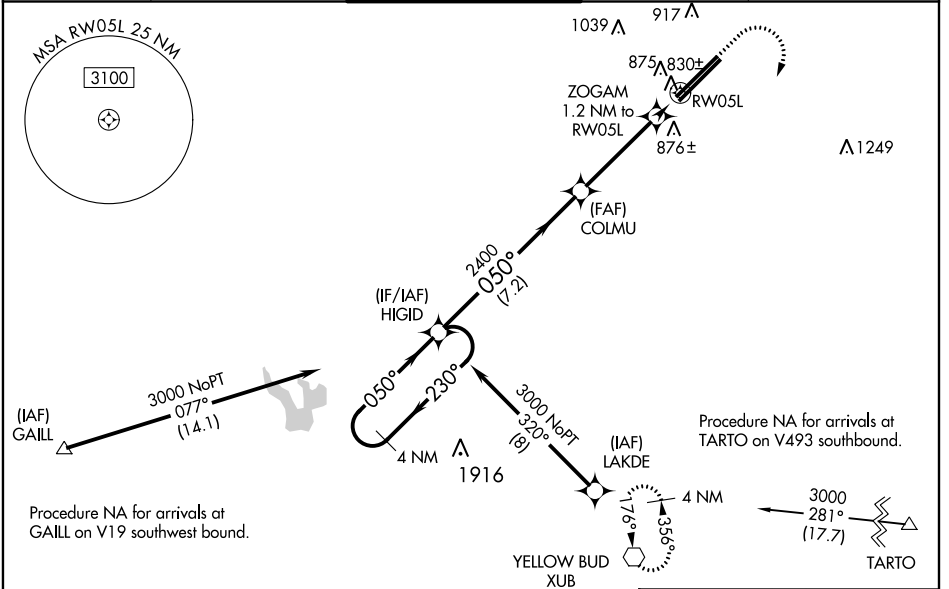

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 70). 4 NM Holding Pattern		1500 3000 XUB		
GP 3.00° TCH 55 HIGID COLMU ZOGAM RWY05L		*RNAV only. XUB		
7.2 NM 3.8 NM 1.2 NM				
CATEGORY	A	B	C	D
LPV DA		944-1/2	200 (200-1/2)	
LNAV/VNAV DA		1007-1/2	263 (300-1/2)	
LNAV MDA	1100-1/2	356 (400-1/2)	1100-5/8	356 (400-5/8)
CIRCLING	1240-1	496 (500-1)	1280-1 1/2	1400-2
			536 (600-1 1/2)	656 (600-2)

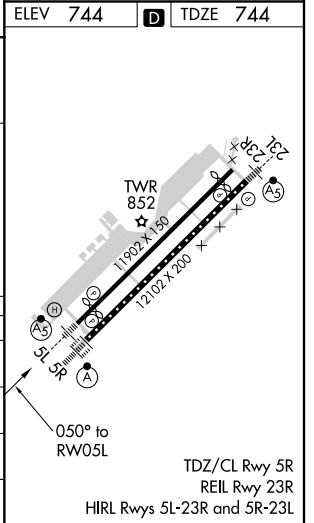

EC-2, 07 OCT 2021 to 04 NOV 2021

EC-2, 07 OCT 2021 to 04 NOV 2021