

**HORTON MUNI** (K91) 1 NW UTC-6(-5DT) N39°40.73' W95°32.05'

KANSAS CITY

1134 NOTAM FILE ICT

**RWY 17-35:** 2223X100 (TURF) 0.7% up N

**RWY 17:** Fence.

**RWY 35:** Brush.

**RWY 15-33:** 1636X100 (TURF) 1.6% up NW

**RWY 15:** Road.

**RWY 33:** Fence.

**AIRPORT REMARKS:** Unattended. For arpt attendant, call 785-486-2681/2694. No public phone or facilities at arpt. No snow removal winter months. +150' unlighted antenna on water twr 3684' SE of AER 33. Rwy 17-35 boundary marked by 3x5 yellow conc pads. Rwy 17 +15 rd 35' from AER 17. Rwy 17 fence obstruction marked with a 4x4 yellow and black striped board. Rwy 35 fence obstruction marked with 4x4 yellow and black striped board. Rwy 15-33 boundary marked by 3x5 yellow conc pads. Rwy 15 +5' fence 212' from thld. Rwy 33 fence obstruction marked with yellow and black striped board. Tie down area and twy unmarked, minimal maintenance, very rough.

**AIRPORT MANAGER:** 785-486-2681

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc St Joseph Apch at 816-236-3035. when St Joseph Apch is clsd, ctc Kansas City ARTCC at 913-254-8508.

**HOXIE-SHERIDAN CO** (1F5) 0 N UTC-6(-5DT) N39°21.91' W100°26.29'

WICHITA

2733 B NOTAM FILE ICT

L-10H

**RWY 17-35:** H4400X50 (ASPH) MIRL 1.4% up W

**RWY 17:** Tower.

**RWY 35:** Trees.

**RWY 08-26:** 1750X150 (TURF)

**RWY 08:** Road.

**RWY 26:** Fence.

**SERVICE:** LGT Dusk-Dawn. ACTIVATE MIRL Rwy 17-35—CTAF.

**AIRPORT REMARKS:** Unattended. Rwy 08-26 CLOSED. 300' to AER 26 heavily overgrown with weeds and grass, limiting usable rwy length. Rwy 17 markings faded. No public telephone at arpt.

**AIRPORT MANAGER:** 785-675-3988


**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Denver ARTCC at 303-651-4257.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE HLC.

**HILL CITY (H) (H) VORTACW** 113.7 HLC Chan 84 N39°15.52'

W100°13.55' 295° 11.8 NM to fld. 2690/8E.

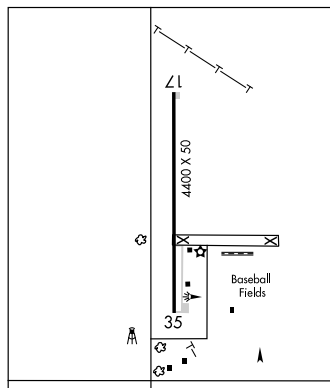

**HUGOTON MUNI** (HQQ)(KHQG) 2 SW UTC-6(-5DT) N37°09.80' W101°22.24'

WICHITA

3134 B NOTAM FILE ICT

H-5B, L-15B

**RWY 02-20:** H5000X75 (CONC) S-30 PCN 11 R/C/X/U HIRL

IAP

**RWY 02:** PAPI(P2L)—GA 3.0° TCH 29'. Road.

**RWY 20:** PAPI(P2L)—GA 3.0° TCH 29'. Road.

**RWY 13-31:** H3039X60 (ASPH) PCN 5 F/C/Y/U

**RWY 13:** Thld dsplcd 412'. Road.

**RWY 31:** Thld dsplcd 202'. Tower.

**SERVICE:** FUEL 100LL LGT ACTIVATE HIRL Rwy 02-20, PAPI Rwy 02 and Rwy 20—CTAF.

**AIRPORT REMARKS:** Attended Mon-Fri 1400-2300Z±, Sat continuously. On call 24 hrs at 620-544-7600. Rwy 31 end dsplcd thld painted. Four tie down locations.

**AIRPORT MANAGER:** 620-544-7600

**WEATHER DATA SOURCES:** AWOS-3PT 118.600 (620) 544-4000.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ KANSAS CITY CENTER APP/DEP CON 134.0

**CLEARANCE DELIVERY PHONE:** For CD ctc Kansas City ARTCC at 913-254-8508.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE LBL.

**LIBERAL (H) (H) VORTACW** 112.3 LBL Chan 70 N37°02.66'

W100°58.27' 280° 20.5 NM to fld. 2891/11E.

TACAN AZIMUTH unusable:

240°-280°

**NDB (MHW)** 365 HQG N37°09.82' W101°22.48' at fld. 3143/9E. NOTAM FILE ICT.

