

LOKKS N40°43.74' W73°11.41' NOTAM FILE ISP.
NDB (LOWW) 366 IS 059° 5.7 NM to Long Island Mac Arthur. 12/14W.

NEW YORK

LONG ISLAND MAC ARTHUR (See NEW YORK on page 229)

LONG LAKE

LONG LAKE/HELMS SPB (NY9) 0 N UTC-5(-4DT) N43°58.50' W74°25.23'

NEW YORK

1629 NOTAM FILE BUF

WATERWAY NE-SW: 15000X1500 (WATER)

SERVICE: S2 FUEL 100LL

SEAPLANE REMARKS: Attended Apr-Nov 1300Z±-dusk. Bridge across lake (Route 30) 500' NW of base. Do not taxi under bridge at high water levels, possible at low water level, stay to west (high) side of bridge. Water levels may vary +/- 10'. Pline at base and building across from base, +50' plines along road and bridge (Route 30). One rwy north of bridge and the other rwy south of bridge.

AIRPORT MANAGER: 518-624-3931

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

LONG LAKE SAGAMORE SPB & MARINA SPB (KØ3) 1 N UTC-5(-4DT) N43°58.14' W74°25.73'

NEW YORK

1629 NOTAM FILE BUF

WATERWAY ALL-WAY: 15000X2000 (WATER)

SEAPLANE REMARKS: Attended April-Nov dawn-dusk. Major rwy orientation is NE-SW. Do not taxi under bridge at high water levels, possible at low water levels. Stay to west (high) side of bridge. Water levels vary +/- 10'. Access to Sagamore Base from land side via Owlhead Lane off of Rt 30 north of US Post Office on east side. One rwy north of bridge, another rwy south of bridge. Bridge across lake (Route 30) and building across road. +50' P-lines along road and bridge (Route 30). Sagamore Base located 1/4 mile south of bridge on east shore. SPB located 60 NM east of Carthage, NY.

AIRPORT MANAGER: 518-624-5520

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

LT WARREN EATON (See NORWICH on page 233)

LUFKER (See EAST MORICHES on page 199)

MALONE-DUFORT (MAL)(KMAL) 2 W UTC-5(-4DT) N44°51.22' W74°19.74'

MONTREAL

790 B NOTAM FILE BTV

L-32G

RWY 05-23: H3994X100 (ASPH) S-20 MIRL 0.4% up SW

IAP

RWY 05: REIL. PAPI(P2L)—GA 3.15° TCH 42'. Trees.

RWY 23: REIL. PAPI(P2L)—GA 3.0° TCH 43'. Trees.

RWY 14-32: H3250X75 (ASPH) S-12.5 MIRL 0.9% up SE

RWY 14: Trees.

RWY 32: Thld dsplcd 348'. Tree.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 05: TORA-3994 TODA-3994 ASDA-3994 LDA-3994

RWY 14: TORA-3250 TODA-3250 ASDA-3250 LDA-3250

RWY 23: TORA-3994 TODA-3994 ASDA-3994 LDA-3994

RWY 32: TORA-3250 TODA-3250 ASDA-3250 LDA-2902

SERVICE: FUEL 100LL LGT ACTIVATE PAPI Rwy 05 and Rwy 23, MIRL

Rwy 05-23, Rwy 14-32 and twy lgt—CTAF.

AIRPORT REMARKS: Airport not attended. Rwy 14-32 has snow removal but visual inspection and NOTAM check must be done as town roads are plowed before arpt. Haying activity and equipment present Jun-Sept.

AIRPORT MANAGER: (518) 483-4740

WEATHER DATA SOURCES: AWOS-AV 122.8 (518) 651-2601.


COMMUNICATIONS: CTAF/UNICOM 122.8

® BOSTON CENTER APP/DEP CON 135.25

CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

RADIO AIDS TO NAVIGATION: NOTAM FILE MSS.

MASSENA (H) TACAN Chan 88 MSS (114.1) N44°54.87' W74°43.36' 116° 17.2 NM to fld. 198/14W.

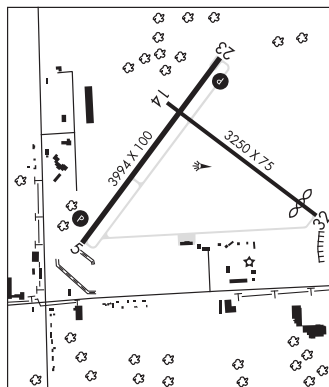

MARCY FLD (See KEENE on page 214)