

MONTPELIER N44°05.13' W72°26.96' NOTAM FILE MPV.
 (H) (H) **ABVORW**DME 116.9 MPV Chan 116 342° 8.6 NM to Edward F Knapp State. 2086/16W.
RCO 122.2 (BURLINGTON RADIO)
RCO 122.6 (BURLINGTON RADIO)

MONTREAL
L-32G
IAP

MORRISVILLE-STOWE STATE (MVL)(KMVL) 2 SW UTC-5(-4DT) N44°32.06' W72°36.84'
 733 B NOTAM FILE MVL

MONTREAL
L-32G
IAP

RWY 01-19: H3700X75 (ASPH) S-25 PCN 12 F/A/X/T HIRL

0.5% up N

RWY 01: REIL. P-line.

RWY 19: REIL. PAPI(P2L)—GA 3.5° TCH 31'.

SERVICE: S4 **FUEL** 100LL, JET A **LGT** ACTIVATE REIL Rwy 01 and Rwy 19, PAPI Rwy 19, HIRL Rwy 01-19—CTAF.

AIRPORT REMARKS: Attended 1300-2300Z \ddagger . For fuel and svcs after hrs and information call 802-253-2332. After hrs self-serve fuel kiosk does not accept Mastercard. Rwy conditions may not be monitored or reported when the arpt is unattended. Rwy 01 glider opr are right traffic. 3' swales middle 1/3 of rwy on east and west sides outside of rwy safety area. Cold temperature airport. Altitude correction required at or below -20C.

AIRPORT MANAGER: (802) 253-2332

WEATHER DATA SOURCES: ASOS 135.625 (802) 888-7934.

COMMUNICATIONS: CTAF/UNICOM 122.8

BOSTON CENTER APP/DEP CON 135.7

CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

RADIO AIDS TO NAVIGATION: NOTAM FILE BTV.

BURLINGTON (L) (L) VOR/DME 117.5 BTW Chan 122 N44°23.83' W73°10.96' 086° 25.8 NM to fld. 417/15W.

VOR unusable:


075°-132° byd 30 NM blo 9,000'

133°-165° byd 30 NM blo 8,000'

DME unusable:

075°-132° byd 30 NM blo 9,000'

133°-165° byd 30 NM blo 8,000'

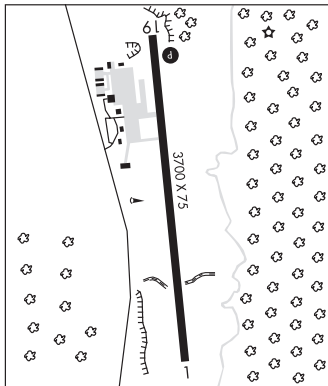

NEWPORT

NORTHEAST KINGDOM INTL (EFK)(KEFK) 3 SW UTC-5(-4DT) N44°53.29' W72°13.72'
 934 B LRA NOTAM FILE BTV

MONTREAL
H-11D, L-32H
IAP

RWY 18-36: H5301X100 (ASPH) S-30, D-44 PCN 33 F/D/X/T MIRL

RWY 18: REIL. PAPI(P4L)—GA 3.0° TCH 43'. Thld dspcd 299'.

RWY 36: REIL. PAPI(P4L)—GA 3.0° TCH 44'. Pole.

RWY 05-23: H3996X100 (ASPH) S-30, D-44

RWY 05: Trees.

RWY 23: Pole.

SERVICE: S4 **FUEL** 100LL, JET A+ **LGT** ACTVT PAPI Rwy 18 and 36; MIRL Rwy 18-36—CTAF.

AIRPORT REMARKS: Attended 1400-2200Z \ddagger . Fuel 24/7 self serve. Mobile fuel vehicle when attended. Rwy conditions may not be monitored or reported when the arpt is unattended. Gulls on and in vicinity of arpt. Cold temperature restricted airport. Altitude correction required at or below -32C.

AIRPORT MANAGER: 802-334-5001

WEATHER DATA SOURCES: AWOS-3P 118.275 (802) 334-4427.

COMMUNICATIONS: CTAF/UNICOM 122.8

NEWPORT RCO 122.5 (BURLINGTON RADIO)

Ⓡ **BOSTON CENTER APP/DEP CON** 135.7

CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

RADIO AIDS TO NAVIGATION: NOTAM FILE BML


BERLIN (H) DME 116.55 BML Chan 112(Y) N44°38.01' W71°11.17' 289° 47.1 NM to fld. 1730/OE.

DME unusable:

080t-125t blo 10,000'

188t-198t blo 10,000'

275t-292t blo 10,000'

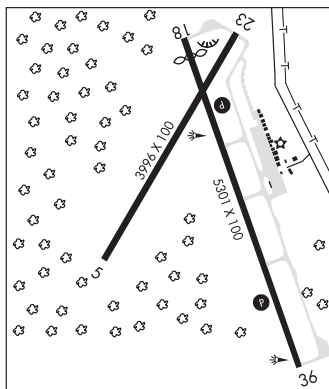

NORTHEAST KINGDOM INTL (See NEWPORT on page 332)