

LONGMONT

VANCE BRAND (LMO)(KLMO) 3 SW UTC-7(-6DT) N40°09.86' W105°09.82'

CHEYENNE
L-10F, A
IAP

5055 B NOTAM FILE DEN

RWY 11-29: H4799X75 (CONC) S-30 MIRL 0.5% up NW

RWY 11: VASI(V2L)—GA 3.0° TCH 24'. Tree.

RWY 29: VASI(V2L)—GA 3.0° TCH 35'. Road.

SERVICE: S4 FUEL 100LL, JET A, MOGAS LGT ACTIVATE MIRL Rwy 11-29 and VASI Rwy 11 and Rwy 29—CTAF. Rwy 11 VASI unusable byd 3.9 NM. VASI does not provide obst clnc byd 3.9 NM from thld.

NOISE: Noise abatement procedures in effect ctc arpt manager 303-651-8431.

AIRPORT REMARKS: Attended dalgt hrs. Parachute jumping on and invof arpt primarily of rwy, avoid overflights mid fld. Ultralight and helicopter activity on and invof arpt. Rwy 29 has +15' highway 702' from thld, +25' to 35' bldgs/tanks aprx 1300' left of thld. NOTE: See Special Notices—Aerobatic Operations in Colorado, USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 303-792-5203

WEATHER DATA SOURCES: AWOS-3 120.0 (303) 684-7545.

COMMUNICATIONS: CTAF/UNICOM 122.975

Ⓡ DENVER APP/DEP CON 125.12

CLEARANCE DELIVERY PHONE: For CD ctc Denver Apch at 303-342-1916.

RADIO AIDS TO NAVIGATION: NOTAM FILE BJC.

JEFFCO (H) (H) VORW/DME 115.4 BJC Chan 101 N39°54.78' W105°08.34' 345° 15.1 NM to fld. 5737/11E.

VOR portion unusable:


226°-245° byd 36 NM blo 17,000'

246°-278° byd 30 NM blo 19,000'

279°-300° byd 34 NM blo 18,000'

DME unusable:

246°-278° byd 30 NM

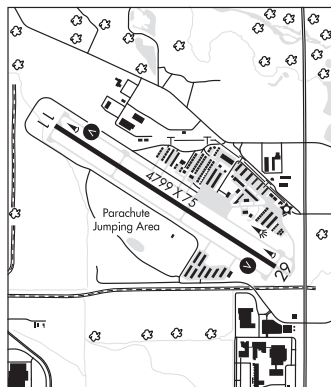

MC ELROY AIRFIELD (See KREMMLING on page 291)

MEADOW LAKE (See COLORADO SPRINGS on page 270)

MEEKER COULTER FLD (EEO)(KEEO) 2 E UTC-7(-6DT) N40°02.93' W107°53.16'

CHEYENNE
H-3E, L-9E, 11E
IAP

6415 B NOTAM FILE EEO

RWY 03-21: H6503X100 (ASPH) S-30, D-60 PCN 16 F/C/X/U MIRL

0.9% up NE

RWY 03: REIL. PAPI(P2L)—GA 3.0° TCH 40'. Rgt tfc.

RWY 21: REIL.

SERVICE: S4 FUEL 100LL, JET A OX 1, 2 LGT ACTIVATE MIRL Rwy 03-21, PAPI Rwy 03, and REIL Rwy 03 and Rwy 31—CTAF.

AIRPORT REMARKS: Attended continuously. Deer and elk and waterfowl invof arpt, wildlife fence surrounds arpt. Rwy 03 PAPI does not provide obstruction clearance byd 2.5 NM from thld. Mountains surround arpt. Cold temperature rstd arpt. Altitude correction required at or blo -25C.

AIRPORT MANAGER: 970-878-5045

WEATHER DATA SOURCES: ASOS 135.525 (970) 878-5036.

COMMUNICATIONS: CTAF/UNICOM 122.8


RCO 122.15 (DENVER RADIO)

Ⓡ DENVER CENTER APP/DEP CON 134.5

RADIO AIDS TO NAVIGATION: NOTAM FILE DEN.

(H) (H) VORW/DME 115.2 EKR Chan 99 N40°04.05'

W107°55.50' 107° 2.1 NM to fld. 7630/15E.

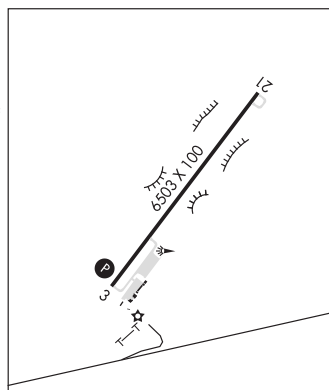

MILE HIGH N39°53.68' W104°37.46' NOTAM FILE DEN.

DENVER
H-3E, 5A, L-10F, A

(H) (H) VORTACW 114.7 DVV Chan 94 221° 3.0 NM to Denver Intl. 5279/8E.

TACAN AZIMUTH unusable:

040°-049° byd 20 NM

040°-049° wi 20 NM blo 11,500'

050°-039° byd 10 NM

050°-039° wi 10 NM blo 11,500'