

VORTAC RIC 114.1 Chan 88	APP CRS 323°	Rwy Idg 9003 TDZE 161 Apt Elev 167
----------------------------------------------	------------------------	---------------------------------------------------------------

VOR RWY 34

RICHMOND INTL (RIC)



DME or RADAR required. RADAR required for procedure entry.

ALSF-2


MISSED APPROACH: Climbing right turn to 2000 via RIC R-018 to EPICS INT and hold.

For inop ALS, increase S-34 Cat C/D visibility to RVR 5500.

ATIS 119.15 263.025	POTOMAC APP CON 126.4 282.375 (001°-185°) 126.75 307.2 (186°-360°)	RICHMOND TOWER 121.1 257.8	GND CON 121.9 348.6	CLNC DEL 127.55 348.6
-------------------------------	----------------------------------------------------------------------------------------	--------------------------------------	-------------------------------	---------------------------------

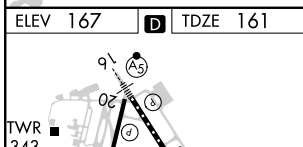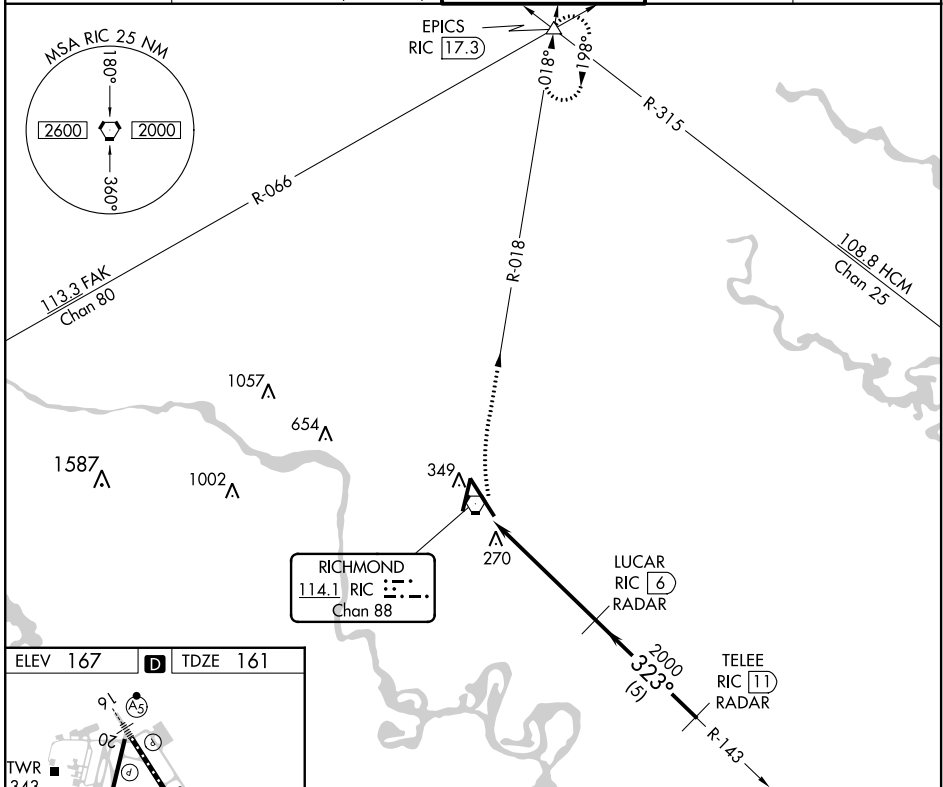

2000 RIC R-018	EPICS △	VGSI and descent angles not coincident (VGSI Angle 3/00/TCH 79).	LUCAR RIC 6 RADAR	TELEE RIC 11 RADAR
-------------------	------------	---------------------------------------------------------------------	-------------------------	--------------------------

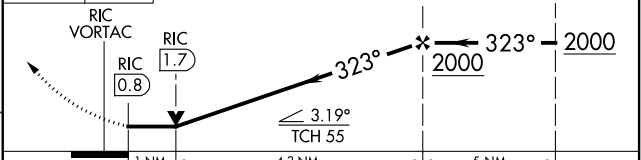

CATEGORY	A	B	C	D
S-34	540/24 379 (400-½)		540/40 379 (400-¾)	540/50 379 (400-1)
<input checked="" type="checkbox"/> CIRCLING	660-1 493 (500-1)		700-1½ 533 (600-1½)	720-2 553 (600-2)

NE-3, 02 DEC 2021 to 30 DEC 2021

NE-3, 02 DEC 2021 to 30 DEC 2021