

LOC I-TPA 110.3	APP CRS 187°	Rwy Idg 8300
		TDZE 26
		Apt Elev 26




ILS RWY 19L (CAT II)

TAMPA INTL (TPA)



▽ Simultaneous approach authorized. RADAR required. RVR 1000 authorized with specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown.

⚠ MISSED APPROACH: Climb to 600 then climbing left turn to 2800 on heading 160° and on PIE VORTAC R-138 to GIBBS INT/PIE 29.3 DME and hold.

ARR 126.45	D-ATIS 128.475	DEP 118.5 307.175	TAMPA APP CON 119.5 269.4	TAMPA TOWER 119.5 269.4	GND CON 121.7 269.4	CLNC DEL 133.6	CPDLC
----------------------	--------------------------	-----------------------------	-------------------------------------	-----------------------------------	-------------------------------	--------------------------	-------

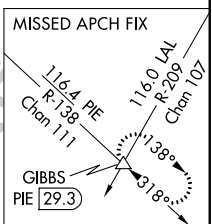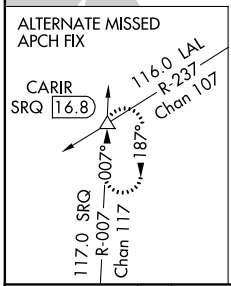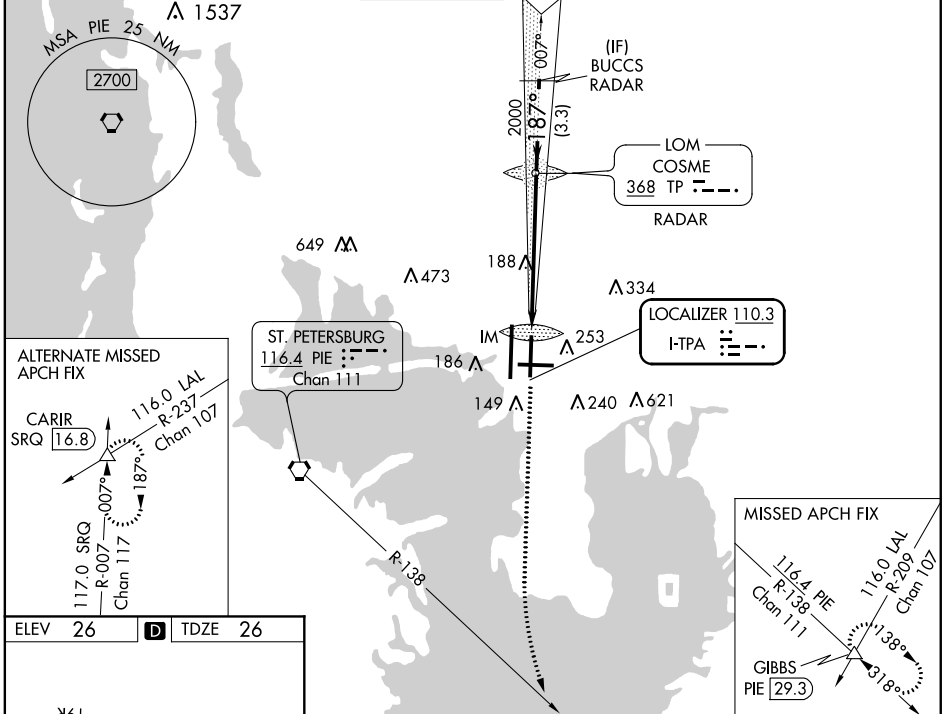

ELEV 26	D	TDZE 26
---------	----------	---------

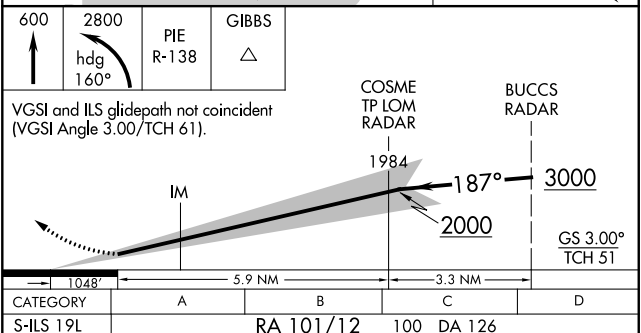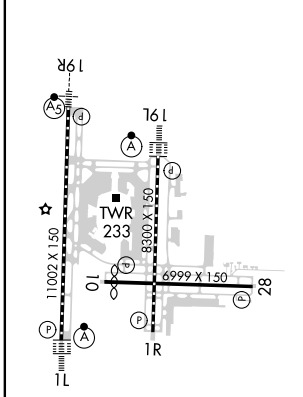

CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

REIL Rwy 1R
 TDZ/CL Rws 1L and 19L
 HIRL Rws 1L-19R, 1R-19L, and 10-28

SE-3, 30 DEC 2021 to 27 JAN 2022

SE-3, 30 DEC 2021 to 27 JAN 2022