

MC COOK BEN NELSON RGNL (MCK)(KMCK) 2 E UTC-6(-5DT) N40°12.38' W100°35.53'

OMAHA

2583 B Class IV, ARFF Index A NOTAM FILE MCK MON Airport

H-5B, L-10H

RWY 12-30: H6450X100 (CONC) S-30, D-38 MIRL 0.6% up NW

IAP, AD

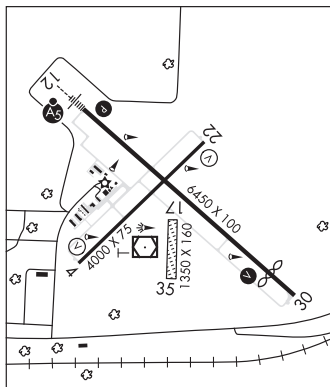
RWY 12: MALSR. PAPI(P4L)—GA 3.0° TCH 38'. Tree.**RWY 30:** REIL. VASI(V4L)—GA 3.0° TCH 44'. Thld displcd 750'. Rgt tfc.**RWY 04-22:** H4000X75 (CONC) S-30, D-38 PCN 34 R/C/W/T MIRL**RWY 04:** VASI(V2L)—GA 3.0° TCH 26'. Pole. Rgt tfc.**RWY 22:** VASI(V2L)—GA 3.0° TCH 26'.**RWY 17-35:** 1350X160 (TURF)**RWY 35:** Rgt tfc.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 04:** TORA-4000 TODA-4000 ASDA-4000 LDA-4000**RWY 12:** TORA-6448 TODA-6448 ASDA-5698 LDA-5698**RWY 22:** TORA-4000 TODA-4000 ASDA-4000 LDA-4000**RWY 30:** TORA-6448 TODA-6448 ASDA-6448 LDA-5698**SERVICE:** S4 **FUEL** 100LL, **JET A** **LGT** ACTIVATE VASI Rwy 30 and PAPI Rwy 12 and MALSR Rwy 12—CTAF. Rwy 12 VASI unusable byd 5° right of centerline and 8° left of centerline.**AIRPORT REMARKS:** Attended dalgt hrs. Parachute Jumping. Rwy 17-35 not avbl for sked acr opns with more than 9 psgr seats or unsked acr at least 31 psgr seats.**AIRPORT MANAGER:** 308-345-2022**WEATHER DATA SOURCES:** ASOS 119.025 (308) 345-1193.**COMMUNICATIONS:** CTAF/UNICOM 122.8

RCO 122.6 (COLUMBUS RADIO)

① DENVER CENTER APP/DEP CON 132.7

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Denver ARTCC at 303-651-4257.**AIRSPACE:** CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MCK.(H) (H) **VORW/DME** 115.3 MCK Chan 100 N40°12.23' W100°35.65' at fld. 2570/8E.

ILS/DME 110.95 I-MCK Chan 46(Y) Rwy 12. Class IT.

**MILLARD** (See OMAHA on page 300)**MILLER FLD** (See VALENTINE on page 309)**MINDEN****PIONEER VILLAGE FLD** (ØV3) 1 NE UTC-6(-5DT) N40°30.90' W98°56.74'

OMAHA

2160 B NOTAM FILE OLU

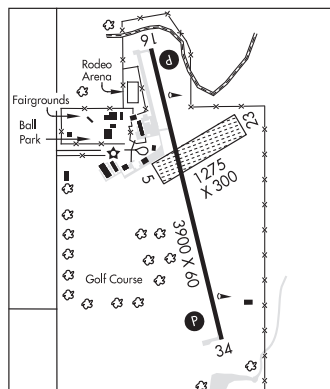
L-10H

RWY 16-34: H3900X60 (CONC) S-30, D-52 MIRL

IAP

RWY 16: PAPI(P2L)—GA 3.0° TCH 40'. Fence.**RWY 34:** PAPI(P2L)—GA 3.5° TCH 40'. Trees. Rgt tfc.**RWY 05-23:** 1275X300 (TURF)**RWY 05:** Tree.**RWY 23:** Fence.**SERVICE:** **FUEL** 100LL **LGT** ActvtPAPI Rwy 16 and 34; MIRL Rwy 16-34—CTAF.**AIRPORT REMARKS:** Unattended. Ultralight activity on and invof arpt. Rwy 05 clsd for takeoffs. Rwy 16 unlighted pivot irrigation system rotates through approach area during irrigation season. Tower 1163' AGL, 3240' MSL 9 NM east northeast.**AIRPORT MANAGER:** 308-830-0391**COMMUNICATIONS:** CTAF/UNICOM 122.7

① MINNEAPOLIS CENTER APP/DEP CON 119.4

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.**RADIO AIDS TO NAVIGATION:** NOTAM FILE EAR.**KEARNEY (L) VORW** 111.2 EAR N40°43.54' W99°00.31' 163° 12.9 NM to fld. 2127/5E.**MODISSETT** (See RUSHVILLE on page 303)