

REDDING

**BENTON FLD** (O85) 1 W UTC-8(-7DT) N40°34.42' W122°24.44'

KLAMATH FALLS

723 B NOTAM FILE RIU

**RWY 15-33:** H2420X75 (ASPH) S-12.5 MIRL

**RWY 15:** PAPI(P2L)—GA 3.5° TCH 24'. Rgt ftc.

**RWY 33:** PAPI(P2L)—GA 3.5° TCH 24'.

**SERVICE:** S2 **FUEL** 100LL, JET A **LGT** ACTIVATE MIRL Rwy 15-33, PAPI Rwy 15 and Rwy 33—CTAF. Twy lighting rwy entrances only.

**NOISE:** For noise abatement climb to 1500' AGL before turning.


**AIRPORT REMARKS:** Attended 1400Z±-dusk. High & lo pressure & ox replacement bottles avbl at Redding Muni (RDD). Large birds frequently on and invof arpt Oct-Apr. Calm wind preferred direction is Rwy 33.

**AIRPORT MANAGER:** 530-224-4321

**WEATHER DATA SOURCES:** AWOS-2 118.675 (530) 225-4183.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

**CLEARANCE DELIVERY PHONE:** For CD ctc Oakland ARTCC at 510-745-3380.

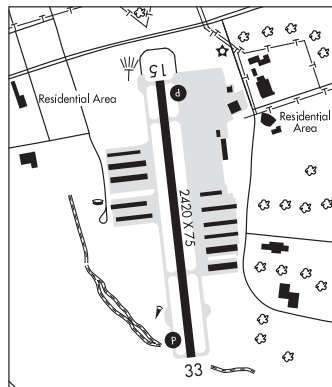

**REDDING MUNI** (RDD)(KRDD) 6 SE UTC-8(-7DT) N40°30.54' W122°17.60'

KLAMATH FALLS

505 B Class I, ARFF Index B NOTAM FILE RDD MON Airport

H-3B, L-2H

**RWY 16-34:** H7003X150 (ASPH-GRVD) S-98, D-128, 2S-135, 2D-195 PCN 60 F/C/X/T HIRL

IAP, AD

**RWY 16:** RLLS. REIL. PAPI(P4L)—GA 3.43° TCH 40'. Tree.

**RWY 34:** MALSR. PAPI(P4L)—GA 3.0° TCH 55'.

**RWY 12-30:** H5067X150 (ASPH) S-60, D-72, 2S-91, 2D-110 PCN 60 F/C/X/T MIRL

**RWY 12:** Trees.

**RWY 30:** PAPI(P2L)—GA 3.0° TCH 32'. Tree.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 12:** TORA-5067 TODA-5067 ASDA-5067 LDA-5067

**RWY 16:** TORA-7003 TODA-7003 ASDA-7003 LDA-7003

**RWY 30:** TORA-5067 TODA-5067 ASDA-5067 LDA-5067

**RWY 34:** TORA-7003 TODA-7003 ASDA-7003 LDA-7003

**SERVICE:** S4 **FUEL** 100LL, JET A **OX** 1, 2, 3, 4 **LGT** ACTIVATE MALSR Rwy 34; REIL Rwy 16; PAPI Rwy 16; HIRL Rwy 16-34; MIRL Rwy 12-30; twy lgts—CTAF.

**NOISE:** For noise abatement avoid overflights of residential housing when possible.

**AIRPORT REMARKS:** Attended dawn-dusk. PPR For unscheduled air carrier ops with more than 30 passenger seats. 0530-1430Z± call arpt manager 530-224-4321. US Forest Service on fld, expect heavy air tanker activity during fire season.

**AIRPORT MANAGER:** 530-224-4321

**WEATHER DATA SOURCES:** ASOS (530) 221-7144

**COMMUNICATIONS:** CTAF 119.8 ATIS 124.1 UNICOM 122.95

**RCO** 122.1R 108.4T (RANCHO MURIETA RADIO)

Ⓜ **OAKLAND CENTER APP/DEP CON** 132.2

**TOWER** 119.8 (1430-0530Z±) **GND CON** 121.7

**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Oakland ARTCC at 510-745-3380.

**AIRSPACE:** CLASS D svc 1430-0530Z±; other times CLASS G.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE RDD.

(T) (T) **VOR/DME** 108.4 RDD Chan 21 N40°30.27' W122°17.50' at fld. 496/18E.

**ILS/DME** 108.7 I-RDD Chan 24 Rwy 34. Class IE. Unmonitored when ATCT clsd. Localizer backcourse unusable wi 2 DME avb 2,000'.

**COMM/NAV/WEATHER REMARKS:** Emerg frequency 121.5 not avbl at twr.

