

LA JUNTA MUNI (LHX)(KLHX) 3 N UTC-7(-6DT) N38°03.00' W103°30.59'

WICHITA
H-5A, L-10F
IAP

4229 B NOTAM FILE LHX

RWY 08-26: H6849X75 (ASPH) S-30, D-50, 2D-90 MIRL
1.1% up W

RWY 08: REIL. VASI(V4L)—GA 3.0° TCH 45'. Road.

RWY 26: REIL. PAPI(P2L)—GA 3.0° TCH 43'.

RWY 12-30: H5803X60 (ASPH-CONC) S-50, D-65, 2D-100
0.5% up NW

SERVICE: FUEL 100LL, JET A LGT ACTIVATE MIRL Rwy 08-26, VASI Rwy 08, PAPI Rwy 26 and REIL Rwy 08 and Rwy 26—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1400-2300Z. Self serve Jet A not avbl. Antelope on and invof arpt. Rwy 12-30 surface raveling with foreign object damage potential. Be alert, intensive USAF student training invof Colorado Springs and Pueblo Colorado. Rwy 12-30 has loose asph material in primary surface west side of rwy full length. Heavy Air Guard ops during summer months. Rwy 12-30 edge undefined. Heavy agricultural ops during summer months. See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: (719) 384-2698

WEATHER DATA SOURCES: ASOS 135.525 (719) 384-5961.

COMMUNICATIONS: CTAF/UNICOM 123.0

RCO 122.6 (DENVER RADIO)


Ⓡ **DENVER CENTER APP/DEP CON** 128.375

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAA.

LAMAR (VH) (DH) VORW/DME 116.9 LAA Chan 116 N38°11.83' W102°41.25' 245° 39.9 NM to fld. 3944/12E.

HELIPAD H1: H145X145 (ASPH)

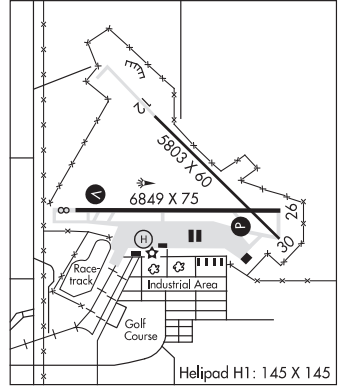

LA VETA

CUCHARA VALLEY AT LA VETA (Ø7V) 1 N UTC-7(-6DT) N37°31.43' W105°00.56'

DENVER
H-5A, L-10F, 15A

7153 B NOTAM FILE DEN

RWY 06-24: H5798X60 (ASPH) MIRL(NSTD)

RWY 06: Thld dsplcd 250'.

RWY 24: Thld dsplcd 198'. Road.

SERVICE: LGT Rwy 06-24 NSTD MIRL, Rwy 06 first 96' unlighted, Rwy 24 first 92' unlighted. ACTIVATE MIRL Rwy 06-24-122.7.

AIRPORT REMARKS: Unattended. Wildlife on and invof Rwy 06-24, higher occurrence during Jun-Oct. Be alert, intensive USAF student training invof Colorado Springs and Pueblo Colorado. Rwy 06-24 has severe cracking on ramp and rwy. See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: (719) 742-3631

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE ALS.

ALAMOSA (H) (H) VORTACW 113.9 ALS Chan 86 N37°20.95' W105°48.93' 062° 39.9 NM to fld. 7535/13E.

VOR unusable:

025°-045° byd 25 NM blo 15,900'

150°-180° byd 35 NM blo 11,600'

TAC AZM unusable:

025°-045° byd 25 NM blo 15,900'

150°-180° byd 35 NM blo 11,600'

DME unusable:

025°-045° byd 25 NM blo 15,900'

150°-180° byd 35 NM blo 11,600'

LA VETA PASS VTP N37°30.72' W105°10.23'/10216

AWOS-3 119.925 (719) 587-3120

DENVER
L-10F, 15A

LAKE CO (See LEADVILLE on page 299)

LAKE MEREDITH SPB (See ORDWAY on page 303)